

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT # 0008794		CLAIM STATUS	Authorized
MYERS RV CENTER INC		CLAIM	2645000
12024 CENTRAL AVE S.E.		CLAIM ORIGIN	WEB
ALBUQUERQUE, NM 87123		ORIGINAL CLAIM ID	
USA		VIN	5ZT3CSVB4SG128261
		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$190.00	SITE/WAREHOUSE	049 / 049B
OWNER INFORMATION		ITEM #	CSF295BHS
LAURA LICCIONE		DEALER RO #	73183
3310 ICARIAN CT NE		CLAIM START DATE	04/16/2026
Rio Rancho, NM 87124		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	01/17/2026	WARRANTY EXPIRATION DATE	01/17/2027

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	30-100-15-11-004731	Pantry Lock - Interior/Cabinetry/Repair or Replace/Electrical		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:17:44 :: Complaint: Pantry door will not shut, states you need to lift up on the door for it to close, magnets have come off the inside of the door. Cause: Factory has no backing wood behind the door. Top of pantry door, the door pin was not attached Correction: Will need to remove magnet plate, cut it, paint it and reinstall in order to fix pantry door. Replace magnet in better location and door pin on top of pantry door was will be placed back in.			
Model#	Dlr Sub Hrs	1.00	Sub Labor Amt	\$190.00
Serial#	Appr Hrs	1.00	Appr Labor Amt	\$190.00
	Notes			
	NVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD			

Labor

Line# 2	Operation Code	Operational Description		
	30-101-24-00-001079	Sliding, Pocket Door Track - Interior/Interior Doors/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:20:00 :: Complaint: Track for bathroom pocket door is loose Cause: Some of the screws fell out due to factory not using long enough screws Correction: Used longer screws in different locations and reinstalled the door			
	Model#	Dlr Sub Hrs	0.50	Sub Labor Amt \$95.00
	Serial#	Appr Hrs	0.30	Appr Labor Amt \$57.00
	Notes			
	NVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD			

Labor

Line# 3	Operation Code	Operational Description		
	30-100-24-00-001051	Cabinet - complete - Interior/Cabinetry/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:21:53 :: Complaint: When microwave is on it sounds like it is hitting something. Cause: Screws have fallen because screws were not long enough from factory			
	Correction: Added longer screws Additional Note : stephanie@dealer-advisors.com, 2026-04-16 16:22:17 :: Had to remove microwave from cabinet to add longer screws			
Model#	Dlr Sub Hrs	1.00	Sub Labor Amt	\$190.00
Serial#	Appr Hrs	1.00	Appr Labor Amt	\$190.00
Notes				
NVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD				

Labor

Line# 4	Operation Code	Operational Description		
	20-56-24-00-000599	Slide Out T-Molding - Exterior/Slide Out System-Seals, Exterior Room/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:29:47 :: Complaint: Customer states when the drivers side slide is out there is a screw missing off the underside of the skirt Cause: Missing screws Correction: Added new screws			
	Model#	Dlr Sub Hrs	0.10	Sub Labor Amt \$19.00
	Serial#	Appr Hrs	0.10	Appr Labor Amt \$19.00
Notes				

Labor

Line# 5	Operation Code	Operational Description		
	40-196-01-11-004472	Charging Center - USB and USB-C - Electrical/12 Volt Interior/Replace/Electrical		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:32:48 :: Complaint: Customer states USB plug in passenger side storage compartment is missing a screw and is loose Cause: Screws missing Correction: Replace 3 screws in correct location Additional Note : stephanie@dealer-advisors.com, 2026-04-16 16:34:45 :: This is not a replacement, just was not able to find a flat rate code to resecure it.			
	Model#	Dlr Sub Hrs	0.20	Sub Labor Amt \$38.00
	Serial#	Appr Hrs	0.20	Appr Labor Amt \$38.00
	Notes			

Labor

Line# 6	Operation Code	Operational Description		
	30-100-01-00-001045	Cabinet Drawer Catch - Interior/Cabinetry/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:36:19 :: Complaint: Customer states both drawers under the benches at the kitchen table are popping open in transit Cause: Drawers keeping sliding out due to factory locks not working Correction: Need to locks to hold drawers in place while driving			
	Model#	Dlr Sub Hrs	0.50	Sub Labor Amt \$95.00
Serial#	Appr Hrs	0.20	Appr Labor Amt \$38.00	
Notes				
NVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD				

Labor

Line# 7	Operation Code	Operational Description		
	30-100-24-00-004815	Cabinet Panel, each - Interior/Cabinetry/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:39:11 :: Complaint: Cabinet at the entry door got damaged when the drawrr at ktichen table came open in transit Cause: Drawer sliding open in transit due to bad latches Correction: Need to paint cabinet fo fix it, touch up paint needed			
	Model#	Dlr Sub Hrs	0.50	Sub Labor Amt \$95.00
Serial#	Appr Hrs	0.40	Appr Labor Amt \$76.00	
Notes				
NVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD				

Labor

Line# 8	Operation Code	Operational Description		
	40-196-01-11-004472	Charging Center - USB and USB-C - Electrical/12 Volt Interior/Replace/Electrical		
	Complaint, Cause, Correction			
	Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:41:59 :: Complaint: In the bunkhouse the cavinet over the desk the USB port is not secured Cause: USB outlet has not screws from factory Correction: Added new screws to outlet. This is not a replacement, just could not find a resecure code for this.			
	Model#	Dlr Sub Hrs	0.20	Sub Labor Amt \$38.00
Serial#	Appr Hrs	0.20	Appr Labor Amt \$38.00	
Notes				

Labor

Line# 9	Operation Code 30-95-01-00-000948	Operational Description Dinette Table Top - Booth - Interior/Dinette/Replace/No Tread Code
Complaint, Cause, Correction Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:49:20 :: Complaint: On the dinette table it looks like a bolt is starting to pop through Cause: Factory drilled the table screws nearly through the table Correction: Unit needs a new table due to factory assembly of the table being screwed too deeply in multiple locations - where pen point shows bulging in pics		
Model#	Dlr Sub Hrs 0.20	Sub Labor Amt \$38.00
Serial#	Appr Hrs 0.20	Appr Labor Amt \$38.00
Notes		

Labor

Line# 10	Operation Code 30-102-01-00-001097	Operational Description Seam Tape, per 8 ft. Strip - Interior/Panels, Ceilings, & Interior Moldings/Replace/No Tread Code
Complaint, Cause, Correction Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:51:45 :: Complaint: Trim molding by the dinette booth when standing at the table on the right side towards the bottom is wrinkled Cause: Trim from factory is wrinkling and coming off Correction: Will need to steam the seam tape to remove, staple panel to backer board, currently there are no staples in back board and then replace entire seam tape.		
Model#	Dlr Sub Hrs 2.00	Sub Labor Amt \$380.00
Serial#	Appr Hrs 0.30	Appr Labor Amt \$57.00
Notes Will need more pictures showing the problem I just see new seam tape.TD The bottom of the seam tape is wrinkled, the vertical piece. I uploaded the same picture with the area highlighted. Excessive labor to remove old seam tape, flatten edge of offset panel. Staple panel and apply new seam tape.		

Labor

Line# 11	Operation Code 20-73-24-00-000739	Operational Description Fenderskirt - Exterior/Fender Skirts, Wheel Well/Repair/No Tread Code
Complaint, Cause, Correction Original Note : stephanie@dealer-advisors.com, 2026-04-16 16:53:22 :: Complaint: Drivers side screw on fender skirt is missing the washer and needs a new screw Cause: Washer is missing and the screw was the incorrect one Correction: Remove old rusted screw and added washer. Must be paint and new screw added.		
Model#	Dlr Sub Hrs 0.10	Sub Labor Amt \$19.00
Serial#	Appr Hrs 0.10	Appr Labor Amt \$19.00
Notes NVCB,Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met.TD		

Submitted	Labor Amt	\$1,197.00	Approved	Labor Amt	\$760.00
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$1,197.00		Total	\$760.00

DEALER _____ DATE _____
SIGNATURE _____
I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER _____ DATE _____
SIGNATURE _____
All repairs described have been inspected and are satisfactory.