

# FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT # 0008794  
 MYERS RV CENTER INC  
 12024 CENTRAL AVE S.E.  
 ALBUQUERQUE, NM 87123  
 USA

CLAIM STATUS Authorized  
 CLAIM 2566314  
 CLAIM ORIGIN WEB  
 ORIGINAL CLAIM ID  
 VIN 5ZT2LNMB9T9011957  
 CHASSIS VIN  
 MILEAGE 0  
 SITE/WAREHOUSE 501 / 501  
 ITEM # LNT230FK  
 DEALER RO # 71720  
 CLAIM START DATE 01/30/2026  
 CLAIM END DATE 01/01/1900

Labor rate: \$190.00  
 OWNER INFORMATION

Retail Date of Purchase WARRANTY EXPIRATION DATE

## Claim Line Details

### Labor

Line# 1      **Operation Code**      **Operational Description**  
 60-138-24-00-001524      Termination Valve Assembly (Read Notes!!!) - Plumbing/Drainage System/  
 Repair/No Tread Code

**Complaint, Cause, Correction**

Original Note : stephanie@dealer-advisors.com, 2026-01-30 12:10:10 :: Complaint: Black tank failed floor test, found is is leaking past the valve. Cause: Incorrect installation/component failure. Correction: Black tank valve seal leaks when termination cap is open and all tanks are full, black tank shows steady leak. Gained access to valve by removing rear portion of underbelly from rear bumper to axle, as black tank is positioned between both acles. Unit has cable valve, cable valve has to be disassembled along with propane lines and fasteners. Remove support straps for termination. Replace valve. Labor breakdown provided as previously requested on claim 2550364. 2.0 hours to remove and reinstall underbelly/refoam cut out 2.0 hours to remove and replace cable valve, disassemble propane lines/support straps .5 hours to perform floor test

<b>Model#</b>	<b>Dlr Sub Hrs</b>	4.00	<b>Sub Labor Amt</b>	\$760.00
<b>Serial#</b>	<b>Appr Hrs</b>	2.50	<b>Appr Labor Amt</b>	\$475.00

**Notes**

Could you please send a video of the leak past the valve to jwiner@forestriverinc.com?  
 Unfortunately we do not have a video and are unable to get one.  
 Dealer has requested more time than what is normally approved for this repair.  
 1.0-underbelly  
 1.0-cable valve  
 0.5-testing

### Labor

Line# 2      **Operation Code**      **Operational Description**  
 60-138-01-00-001519      Grey Water Tank (Read Notes!!!) - Plumbing/Drainage System/Replace/No Tread  
 Code

**Complaint, Cause, Correction**

Original Note : stephanie@dealer-advisors.com, 2026-01-30 12:14:40 :: Complaint: Front grey tank number one failed flood test. Cause: Tank was damaged by screw at install. Correction: Had to pull front portion of underbelly, P-clips holding propane line, propane manifold, grey tank, dump handle valve and drain. Disconnected vent and drain. Removed angle iron supporting tank and inspected. Tank shows 3/16 hole on door side a quarter inch from the top shows blue arrow pointing to hole: Correction: Recommend replacing grey tank. Tank and tape used to connect ABS outlet to ABS tank will also need to be ordered. This is from claim 2550364. Labor breakdown provided as requested on previous claim. 2.0 hours to remove and reinstall underbelly/refoam cut outs 4.5 hours to remove and replace grey tank (cut vent, remove valve, flood test) .4 to remove and reinstall two scissor jacks .45 to remove and reinstall LP lines .3 drop test

<b>Model#</b>	<b>Dlr Sub Hrs</b>	7.65	<b>Sub Labor Amt</b>	\$1,453.50
<b>Serial#</b>	<b>Appr Hrs</b>	4.00	<b>Appr Labor Amt</b>	\$760.00

**Notes**

Dealer has requested more time than what is normally approved for this repair.

Dealer has requested more time than what is normally approved for this repair.  
Removal/replacement of underbelly- 2.0  
Removal/replacement of jacks- 1.0  
Removal/replacement of tank- 1.0

---

**Submitted**

Labor Amt	\$2,213.50
Parts & Freight	\$0.00
Total	\$2,213.50

**Approved**

Labor Amt	\$1,235.00
Parts & Freight	\$0.00
Total	\$1,235.00

---

**DEALER****DATE****SIGNATURE**

I certify that I have performed these repairs consistent with Forest River Policies.

---

**CUSTOMER****DATE****SIGNATURE**

All repairs described have been inspected and are satisfactory.