

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0008794	CLAIM STATUS	Authorized
MYERS RV CENTER INC		CLAIM	2550364
12024 CENTRAL AVE S.E.		CLAIM ORIGIN	WEB
ALBUQUERQUE, NM 87123		ORIGINAL CLAIM ID	
USA		VIN	5ZT2LNMB9T9011957
		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$190.00	SITE/WAREHOUSE	501 / 501
OWNER INFORMATION		ITEM #	LNT230FK
		DEALER RO #	71720
		CLAIM START DATE	01/14/2026
		CLAIM END DATE	01/01/1900

Retail Date of Purchase _____ WARRANTY EXPIRATION DATE _____

Claim Line Details

Labor

Line# 1

Operation Code	60-138-24-00-001524	Operational Description
		Termination Valve Assembly (Read Notes!!!) - Plumbing/Drainage System/Repair/No Tread Code
Complaint, Cause, Correction		
Original Note : stephanie@dealer-advisors.com, 2026-01-14 09:59:45 :: Complaint: Black tank failed flood test, found it is leaking past valve Cause: Incorrect installation/component failure Correction: Black tank valve seal leaks When termination cap is open and all tanks are full, black tank shows steady leak. Gained access to valve by removing rear portion of underbelly from rear bumper to axle, as black tank is positioned between both axles. Unit has cable valve, cable valves have to be disassembled along with propane lines and fasteners. Remove support straps for termination. Replace valve.		
Model#	Dlr Sub Hrs	Sub Labor Amt
	4.50	\$855.00
Serial#	Appr Hrs	Appr Labor Amt
	0.00	\$0.00
Notes		
Could you please provide a break down with times for each thing that needs to be done for this repair?		
No response - denying line after 14 days.		

Labor

Line# 2

Operation Code	20-58-12-00-004601	Operational Description
		Lower Radius Metal Trim - Exterior/Metal, Aluminum Siding/Resecure or Tighten/No Tread Code
Complaint, Cause, Correction		
Original Note : stephanie@dealer-advisors.com, 2026-01-14 10:01:34 :: Complaint: Fender by entry door is missing screw covers Cause: Missing Correction: Installed screw covers		
Model#	Dlr Sub Hrs	Sub Labor Amt
	0.10	\$19.00
Serial#	Appr Hrs	Appr Labor Amt
	0.10	\$19.00
Notes		

Labor

Line# 3

Operation Code	30-99-24-00-001018	Operational Description
		Day Night Shade or Roller Shade - Interior/Soft Goods/Repair/No Tread Code
Complaint, Cause, Correction		
Original Note : stephanie@dealer-advisors.com, 2026-01-14 10:04:18 :: Complaint: Day nightshade in bedroom and behind recliners will not stay in the up position Cause: Incorrect installation Correction: Loosened string lock and added more tension to allow for correct operation		
Model#	Dlr Sub Hrs	Sub Labor Amt
	0.20	\$38.00
Serial#	Appr Hrs	Appr Labor Amt
	0.00	\$0.00
Notes		
According to the flat rate code, Dealers must supply pictures for this repair. Please attach pictures using the Upload button in the Feedback overlay before acknowledging the line. Refer to		

the flat rate code Notes to ensure all necessary pictures are provided. If pictures are not provided within 14 days, the repair line will be denied according to The Forest River Way guidelines.

No response - denying line after 14 days.

Labor

Line# 4

Operation Code 60-138-01-00-001519 **Operational Description** Grey Water Tank (Read Notes!!!) - Plumbing/Drainage System/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-01-14 10:06:49 :: Complaint: Front grey tank number one failed flood test Cause: Tank was damaged by screw at install Correction: Had to pull front portion of underbelly P clips holding propane line, propane manifold, gray tank, dump handle valve and drain. Disconnected vent and drain. Removed angle iron supporting tank and inspected. Tank shows 3/16 hole on door side a quarter inch from the top shows blue arrow pointing to hole. Recommend replacing gray tank. Tank and tape used to connect ABS outlet to ABS tank will need to be ordered

Model#	Dlr Sub Hrs	8.00	Sub Labor Amt	\$1,520.00
Serial#	Appr Hrs	0.00	Appr Labor Amt	\$0.00

Notes

Could you please provide a break down with times for each thing that needs to be done for this repair?

No response - denying line after 14 days.

Labor

Line# 5

Operation Code 60-138-01-00-001536 **Operational Description** Vacuum Breaker - 1.5" Anti-Siphon Vent - Plumbing/Drainage System/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-01-14 10:09:18 :: Complaint: Black tank flush does not work Cause: When operating black tank flush, no water was getting to the black tank. Located vacuum breaker for black tank flush and noted it was not installed properly. Correction: Reinstall vacuum breaker, during removal and reinstallation, the spring popped out inside of backblow preventer. Need to replace.

Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$95.00
Serial#	Appr Hrs	0.50	Appr Labor Amt	\$95.00

Notes

Labor

Line# 6

Operation Code 50-134-01-00-001442 **Operational Description** LP Tank or Bottle - LP Gas/LP Gas System/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-01-14 10:10:24 :: Complaint: Propane tank would not take propane Cause: Tank is defective Correction: Remove and replace tank

Model# 123	Dlr Sub Hrs	0.30	Sub Labor Amt	\$57.00
Serial# abc	Appr Hrs	0.20	Appr Labor Amt	\$38.00

Notes

Sent information to vendor for authorization.

Thank you.

Per vendor: Pre-approved replacement of tank; to be confirmed with photos.

Submitted	Labor Amt	\$2,584.00	Approved	Labor Amt	\$152.00
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$2,584.00		Total	\$152.00

DEALER _____ DATE _____
SIGNATURE _____
I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER _____ DATE _____
SIGNATURE _____
All repairs described have been inspected and are satisfactory.