

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT # 0008794
 MYERS RV CENTER INC
 12024 CENTRAL AVE S.E.
 ALBUQUERQUE, NM 87123
 USA

CLAIM STATUS Authorized
 CLAIM 2656655
 CLAIM ORIGIN WEB
 ORIGINAL CLAIM ID
 VIN 5ZT2AVPB0TB942177
 CHASSIS VIN
 MILEAGE 0
 SITE/WAREHOUSE 050 / 050
 ITEM # AVT25MKO-1
 DEALER RO # 73041-1
 CLAIM START DATE 04/28/2026
 CLAIM END DATE 01/01/1900

Labor rate: \$190.00
 OWNER INFORMATION

Retail Date of Purchase WARRANTY EXPIRATION DATE

Claim Line Details

Labor

Line# 1 **Operation Code** **Operational Description**
 10-9-24-00-000169 Enclosed Underbelly Panel(s) - Frame & Chassis/Levelers, Underbelly/Repair/No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-04-28 11:03:00 :: Complaint: Underbelly is hanging down under the unit at the front Cause: Pulled loose during transport Correction: Tucked in the wires and secured to prevent failing again, resecured the underbelly and made a repair using underbelly tape at the access panel just behind the A frame.

Model#	Dlr Sub Hrs	0.75	Sub Labor Amt \$142.50
Serial#	Appr Hrs	0.75	Appr Labor Amt \$142.50

Notes
 Authed

Labor

Line# 2 **Operation Code** **Operational Description**
 20-43-24-00-000589 Die Cut, Stripe, Decal, Graphic - Exterior/Exterior Miscellaneous/Repair/No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-04-28 11:06:38 :: Complaint: Decals are bubbly and peeling Cause: Decals throughout unit are bubbling and some have debris from transport under the decal and will not allow proper adhesion. Correction: Tried to smooth out all the bubbles manually, the majority did smooth out. One decal will need to be replaced. Time requested for smoothing decals and replacing AVENGER decal.

Model#	Dlr Sub Hrs	1.50	Sub Labor Amt \$285.00
Serial#	Appr Hrs	1.25	Appr Labor Amt \$237.50

Notes
 Wrong code used
 Excessive labor requested to remove air bubbles. Reduced to a reasonable amount

Labor

Line# 3 **Operation Code** **Operational Description**
 60-138-01-00-001525 Termination Valve Handle - Plumbing/Drainage System/Replace/No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-04-28 11:07:47 :: Complaint: Black tank handle is missing Cause: Checked in unit and packet and no handles were included, missing at delivery Correction: Replace one black tank handle, valterra brand

Model#	Dlr Sub Hrs	0.10	Sub Labor Amt \$19.00
Serial#	Appr Hrs	0.03	Appr Labor Amt \$5.70

Notes
 Excessive labor requested to install missing handle. Reduced to a reasonable amount

Labor

Line# 4 **Operation Code** **Operational Description**

30-103-24-00-001125 Linoleum - Interior/Flooring/Repair/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-04-28 11:09:22 :: Complaint: Linoleum is bubbly in the bathroom Cause: Floor boards seem to have a mismatch in height creating a bubble in lino Correction: PLease advise on this one, we need to know what the proper repair procedure would be here. Additional Note : stephanie@dealer-advisors.com, 2026-04-28 11:09:57 :: Will update labor after repair suggestion is provided

Model#	Dlr Sub Hrs	8.00	Sub Labor Amt	\$1,520.00
Serial#	Appr Hrs	2.50	Appr Labor Amt	\$475.00

Notes

Would recommend removing trim around floor. Remove toilet, cut under wall edges to get to lino. Lift to discover issue. Fill, sand or whatever to get flat. Use spray glue and stretch lino. staple carefully along edges so trim will cover. Reinstall toilet and trim
Ok, thank you. Let me get this to the tech so they can review, and I will update the labor request once I know.
Tech is requesting 8 hours for this
Lets start out at 2.50 hours. If the tech is not completed by then, stop, take pictures and describe the troubles they are having getting it finished. We can adjust later if needed.

Labor Line# 5

Operation Code	Operational Description
20-78-02-00-000797	Lippert Awning - complete - Exterior/Awnings (Lippert)/Adjust/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-04-28 11:11:40 :: Complaint: Front awning arm needs to be adjusted slightly, it's catching Cause: Upper arm is catching on the stationary arm attached to the wall, awning arm is misaligned Correction: Remove screws that attach the arm to the wall, take horizontal and diagonal measurements to properly locate the arm. Filled old holes with silicone to prevent water intrusion. Relocate and reinstall forward awning arm, resealing all screws during installation.

Model#	Dlr Sub Hrs	1.00	Sub Labor Amt	\$190.00
Serial#	Appr Hrs	1.00	Appr Labor Amt	\$190.00

Notes

Authed to adjust awning

NO VCB

Labor Line# 6

Operation Code	Operational Description
30-103-24-00-001125	Linoleum - Interior/Flooring/Repair/No Tread Code

Complaint, Cause, Correction

Original Note : stephanie@dealer-advisors.com, 2026-04-28 11:14:04 :: Complaint: Front bedroom doorway has bubbles in lino Cause: Bedroom lino is bubbling due to lack of floor glue Correction: Added more glue to area to readhere

Model#	Dlr Sub Hrs	0.75	Sub Labor Amt	\$142.50
Serial#	Appr Hrs	0.75	Appr Labor Amt	\$142.50

Notes

Authed

Submitted	Labor Amt	\$2,299.00	Approved	Labor Amt	\$1,193.20
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$2,299.00		Total	\$1,193.20

DEALER **DATE**
SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER **DATE**
SIGNATURE

All repairs described have been inspected and are satisfactory.