

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville IN
US
47725
812-867-5200

WORK ORDER # 64057

Completed : 31 MAY 21 Customer : 10024 - FOREST RIVER TRAVEL TRAILER
Licence # : Invoice # :
Stock No : 10875 Description : 2021 TT FOREST RIVER CHEROKEE 306MM
Tag : HERE Date In : 29 APR 21 Mileage : 0
Author : BJW Promised : 15 MAY 21
Location : DELIVERY 0515 Date Sched :
Serial# : 4X4TCKG21MX151962 Chassis# : 4X4TCKG21MX151962
Warr. Date : 15 MAY 21 Cust PO# :
Print Date : 04 JUN 21

Job # Description JOB INFORMATION Type Bill To

PDIN COMPLAINT: PDI - NEW TRAVEL TRAILER I PDI PRE-D
CAUSE: pdi
CORRECTION: filled lp tanks, ran lp leak test,
checked tire pressure, running
lights,brakes, interior lights, all
appliances, electrical system, water and
plumbing system for leaks, filled
holding tanks, documented model and
serial numbers for appliances, checked
roof, dewinterized, installed theatre
seating.
FPDI COMPLAINT: FINAL PDI ON NEW TRAVEL TRAILERS I PDI PRE-D
CAUSE: final
CORRECTION: running lights,brakes, interior lights,
all appliances, electrical system, water
and plumbing system for leaks, drained
tanks
DELU DELUXE STARTER KIT I DO DEALE
EQUA COMPLAINT: INSTALL 1000# EQUALIZER HITCH I DO DEALE
CAUSE: INSTALL HITCH
CORRECTION: INSTALLED HITCH BRACKETS AND HITCH HEAD.
1 Transferred to BAS*64348 on 04 JUN 21 Estimate I DO DEALE
amount was 0.00 INSTALL THEATER SEATING. SEE CAM
2 COMPLAINT: THE RADIO IS INOP W 10024 FORES
CAUSE: radio would not power up.
CORRECTION: pulled radio. noticed that the power
wires were not making a good connection,
recrimped wires on radio.
3 COMPLAINT: THERE IS NO GASKET FOR THE BLACK TANK W 10024 FORES
FLUSH INLET.
CAUSE: no gasket/ screen on black tank flush
inlet
CORRECTION: installed gasket on inlet
4 COMPLAINT: THE BLACK FLUSH VACCUM BREAKER IS W 10024 FORES
LEAKING
CAUSE: vaccum breaker for black tank flusk is

Continued on page 2

Work Order : 64057

```

*****
Job #  Excode  Description  EXTRAS  bill to  Qty  Price  Total
*****
1  FRT  FREIGHT CHAIRS  I-DO  0.00  125.00  0.00
*****

```

 CUSTOMER COMMENTS

BH SENT PREAUTH WAITING TO HEAR BACK

 BILLINGS SUMMARY

Type	Bill Id	Parts	Labour	Sublet	Extras	Tax	Total
I	DO	818.89	127.50	0.00	0.00	0.00	946.39
I	PDI	23.99	1235.00	0.00	71.72	0.00	1,330.71
W	10024	16.39	260.00	0.00	0.00	0.00	276.39
Totals		859.27	1622.50	0.00	71.72	0.00	2,553.49

Work Order : 64057

 Job # Description JOB INFORMATION Type Bill To

leaking

CORRECTION: replaced vaccum breaker

5 COMPLAINT: THE GASKET FOR THE MAIN SLIDEOUT ON TOP W 10024 FORES
 HAS CAME LOOSE

CAUSE: D SEAL GASKET CAME OUT ON TOP OF SLIDE
 OUT. SEAL IS COVERED WITH SEALANT AND
 NEEDS REPLACED WITH NEW PIECE

CORRECTION: REMOVED OLD SEAL, INSTALLED NEW PIECE
 AND SEALED TO TRACK.

WALK COMPLAINT: WALK THRU I PDI PRE-D
 CORRECTION: DONE EF

 Job # Part No Description PARTS Bill to Qty Price Total

FPDIN	5516	A10-3050FHVP 30M-5	I-PDI	1	23.99	23.99
DELUX	40052	40052 BRASS W.P. R	I-DO	1	14.99	14.99
DELUX	13-0181	40274 2-PLY TST TO	I-DO	1	5.99	5.99
DELUX	11-0018	39741 20' RHINOFLE	I-DO	1	59.99	59.99
DELUX	19-0381	30F/15M 12" ADAPTE	I-DO	1	14.99	14.99
DELUX	10-0278	22753 50' 1/2" TAS	I-DO	1	29.99	29.99
DELUX	41559	41559 15-PK TST LA	I-DO	1	14.99	14.99
EQUAL	710831	EQUALIZER 1000#/10	I-DO	1	677.95	677.95
1	5698	SEISMIC RIGHT HAND	I-DO	0	867.99	0.00
1	5699	SEISMIC LEFT HAND	I-DO	0	867.99	0.00
1	5697	SEISMIC CENTER CONSOLE (MIL	I-DO	0	0.00	0.00
4	C01285152	VACUUM BREAKER, BK	W-10024	1	10.15	10.15
5	20X48346A	SLIDE OUT, BULB "D	W-10024	8	0.78	6.24

 Job# Lab Code Description LABOUR Mech Bill to Hrs Rate Total

DINTT	Z991	MISC LABOUR CODE (INTE ZMS	I-PDI	1.42	130.00	184.60
DINTT	Z991	MISC LABOUR CODE (INTE ZMS	I-PDI	2.28	130.00	296.40
DINTT	Z991	MISC LABOUR CODE (INTE ZMS	I-PDI	0.41	130.00	53.30
DINTT	Z991	MISC LABOUR CODE (INTE ZMS	I-PDI	1.89	130.00	245.70
DINTT	PDINTT	PDI - NEW TRAVEL TRAIL ZMS	I-PDI	2.00	130.00	260.00
R1000	Z990	MISC LABOUR CODE (EXTE ZMS	I-DO	1.20	85.00	102.00
R1000	Z990	MISC LABOUR CODE (EXTE ZMS	I-DO	0.30	85.00	25.50
	2 Z990	MISC LABOUR CODE (EXTE ZMS	W-10024	0.20	130.00	26.00
	3 Z990	MISC LABOUR CODE (EXTE ZMS	W-10024	0.30	130.00	39.00
	4 Z990	MISC LABOUR CODE (EXTE ZMS	W-10024	0.30	130.00	39.00
	5 Z990	MISC LABOUR CODE (EXTE ZMS	W-10024	1.20	130.00	156.00
WALK	Z990	MISC LABOUR CODE (EXTE EF	I-PDI	1.50	130.00	195.00

 Job # Excode Description EXTRAS bill to Qty Price Total

DINTT	SS	SHOP SUPPLIES	I-PDI	1.00	35.00	35.00
DINTT	LPGI	LP - UNIT SALES	I-PDI	8.00	4.59	36.72
R1000	SS	SHOP SUPPLIES	I-DO	0.00	11.25	0.00

Continued on page 3

Parts Requisition

Vendor: _____

Customer Name: Vanmatre, Carl

Model: Forest River Cherokee Serial#: 4x4 TCKG21/MX 15/962

RO# or WRO#(please circle): 64057

Ordered on PO#: _____ Order Date: _____

Quantity: _____ Description or Part#: _____

Quantity: _____ Description or Part#: _____

Quantity: _____ Description or Part#: _____

Notes for Parts

Job 5.

D-seal for outside of slide out.
10 ft.

~~A~~

20 X 483 46A

PO

* 62144

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	594625
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	4X4TCKG21MX151962
USA		CHASSIS VIN	
		MILEAGE	0
		SITE/WAREHOUSE	017 / 017A
Labor rate:	\$130.00	ITEM #	ACKT306MM
OWNER INFORMATION		DEALER RO #	64057
		CLAIM START DATE	05/07/2021
		CLAIM END DATE	01/01/1900

Retail Date of Purchase

WARRANTY EXPIRATION DATE

Claim Line Details

Labor

Line# 1	Operation Code 40-132-24-00-002280	Operational Description Any Audio Connection Behind Radio - Electrical/Low Voltage Wiring/ Repair/No Tread Code
	Complaint, Cause, Correction Original Note : bhoffman@americanrvcenter.com, 2021-05-07 16:04:44 :: THE RADIO IS INOP pulled radio. noticed that the power wires were not making a good connection, recrumped wires on radio.	
	Model #	Dlr Sub Hrs 0.30 Sub Labor Amt \$39.00
	Serial #	Appr Hrs 0.20 Appr Labor Amt \$26.00

Notes

Labor

Line# 2	Operation Code 60-138-01-00-001537	Operational Description Black Tank No Fuss Flush Valve (picture) - Plumbing/Drainage System/ Replace/No Tread Code
	Complaint, Cause, Correction Original Note : bhoffman@americanrvcenter.com, 2021-05-07 16:06:02 :: THERE IS NO GASKET FOR THE BLACK TANK FLUSH INLET. installed gasket on inlet	
	Model #	Dlr Sub Hrs 0.40 Sub Labor Amt \$52.00
	Serial #	Appr Hrs 0.30 Appr Labor Amt \$39.00

Notes

time adjusted to flat rate

Labor

Line# 3	Operation Code 60-138-01-00-001536	Operational Description Vacuum Breaker - 1.5" Anti-Siphon Vent (pictures) - Plumbing/Drainage System/Replace/No Tread Code
	Complaint, Cause, Correction Original Note : bhoffman@americanrvcenter.com, 2021-05-07 16:07:09 :: THE BLACK FLUSH VACCUM BREAKER IS LEAKING vacuum breaker for black tank FLUSH is leaking replaced vacuum breaker	
	Model #	Dlr Sub Hrs 0.40 Sub Labor Amt \$52.00
	Serial #	Appr Hrs 0.30 Appr Labor Amt \$39.00

Notes

time adjusted to flat rate

Labor

Line# 4	Operation Code 10-11-01-00-000208	Operational Description Slide Out Slip On D-Seal - Frame & Chassis/Slide Out System-Seals/ Replace/No Tread Code
	Complaint, Cause, Correction	

Original Note : bhoffman@americanrvcenter.com, 2021-05-07 16:08:01 :: THE GASKET FOR THE MAIN SLIDEOUT ON TOP HAS CAME LOOSE D SEAL GASKET CAME OUT ON TOP OF SLIDE OUT. SEAL IS COVERED WITH SEALANT AND NEEDS REPLACED WITH NEW PIECE REMOVED OLD SEAL, INSTALLED NEW PIECE AND SEALED TO TRACK.

Model #	Dlr Sub Hrs	1.20	Sub Labor Amt	\$156.00
Serial #	Appr Hrs	1.20	Appr Labor Amt	\$156.00

Notes

Submitted	Labor Amt	\$299.00
	Parts & Freight	\$0.00
	Total	\$299.00

Approved	Labor Amt	\$260.00
	Parts & Freight	\$0.00
	Total	\$260.00

DEALER
SIGNATURE

DATE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER
SIGNATURE

DATE

All repairs described have been inspected and are satisfactory.