

# FOREST RIVER WARRANTY CLAIM FORM

<b>DEALER ACCOUNT #</b>	0008794	<b>CLAIM STATUS</b>	Paid
<b>MYERS RV CENTER INC</b>		<b>CLAIM</b>	2634464
12024 CENTRAL AVE S.E.		<b>CLAIM ORIGIN</b>	WEB
ALBUQUERQUE, NM 87123		<b>ORIGINAL CLAIM ID</b>	
USA		<b>VIN</b>	4X4TRPU1XTB035128
		<b>CHASSIS VIN</b>	
		<b>MILEAGE</b>	0
<b>Labor rate:</b>	\$190.00	<b>SITE/WAREHOUSE</b>	080 / 080
<b>OWNER INFORMATION</b>		<b>ITEM #</b>	RPT192-80
DONALD CASUSE JR		<b>DEALER RO #</b>	73148
1412 VASSAR DR NE		<b>CLAIM START DATE</b>	04/08/2026
Albuquerque, NM 87106		<b>CLAIM END DATE</b>	04/30/2026
USA			
<b>Retail Date of Purchase</b>	04/11/2026	<b>WARRANTY EXPIRATION DATE</b>	04/11/2027

## Claim Line Details

### Labor

<b>Line# 1</b>	<b>Operation Code</b>	<b>Operational Description</b>		
	40-106-24-11-001253	Exterior 12 Volt Wiring - Electrical/12 Volt Exterior/Repair/Electrical		
	<b>Complaint, Cause, Correction</b>			
	Original Note : stephanie@dealer-advisors.com, 2026-04-08 09:37:26 :: Complaint: Solar panel is inop Cause: During the SFD found there was no voltage coming from the solar panel to the controller. Removed controller from the wall and disconnected the wires from the controller, tested for voltage, reading was .03. Set a ladder up and got on the roof and disconnected the solar panel from the roof entry cap and tested voltage, reading was 22.76. Removed the roof entry cap and tested continuity at the wire nuts to the control panel both were good. Found a locking nut on the entry cap, quick disconnect was broken and allowing negative side to freely move. Correction: Recommend replacement for the roof mount entry cap and replace of the wiring from the roof entry cap to the controller. Requesting 1.65 hours in diag, plus 2.0 hours for replacement/repairs. Reinstalled roof entry cap due to weather. Additional Note : stephanie@dealer-advisors.com, 2026-04-08 09:39:59 :: ***labor codes were limited on this unit, chose a close labor code for recommended repair***			
<b>Model#</b>	<b>Dlr Sub Hrs</b>	3.65	<b>Sub Labor Amt</b>	\$693.50
<b>Serial#</b>	<b>Appr Hrs</b>	2.50	<b>Appr Labor Amt</b>	\$475.00
	<b>Notes</b>			
	excessive time requested. Time reduced based on photos, description and flat rate. changed to a more suitable code for this repair.			

### Part

<b>Line# 1</b>	<b>Item #</b>	<b>Description</b>				
	USERPART	49329 Dicor self leveling sealant				
	<b>Model #</b>	<b>Serial #</b>	<b>Part tag</b>			
	<b>Sub Qty</b>	1.00	<b>Sub Dlr Price</b>	\$7.42	<b>Sub Freight</b>	\$0.00
	<b>Appr Qty</b>	1.00	<b>Appr Dlr Price</b>	\$7.42	<b>Appr Freight</b>	\$0.00
	<b>Notes</b>					
<b>Line# 3</b>	<b>Item #</b>	<b>Description</b>				
	USERPART	GPO83189 Cable entry plate with red and black wires				
	<b>Model #</b>	<b>Serial #</b>	<b>Part tag</b>			
	<b>Sub Qty</b>	1.00	<b>Sub Dlr Price</b>	\$21.60	<b>Sub Freight</b>	\$0.00
	<b>Appr Qty</b>	1.00	<b>Appr Dlr Price</b>	\$21.60	<b>Appr Freight</b>	\$0.00
	<b>Notes</b>					

<b>Submitted</b>	Labor Amt	\$693.50	<b>Approved</b>	Labor Amt	\$475.00
	Parts & Freight	\$29.02		Parts & Freight	\$29.02

Total \$722.52

Total \$504.02

---

**DEALER** **DATE**  
**SIGNATURE**

I certify that I have performed these repairs consistent with Forest River Policies.

---

**CUSTOMER** **DATE**  
**SIGNATURE**

All repairs described have been inspected and are satisfactory.