

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville IN
US
47725
812-867-5200

WORK ORDER # 64191

Completed : 10 NOV 21 Customer : 10024 - FOREST RIVER TRAVEL TRAILER
Licence # : Invoice # :
Stock No : 10899 Description : 2021 TT FOREST RIVER CHEROKEE WOLF
Tag : Date In : 12 MAY 21 Mileage : 0
Author : BH Promised : 24 JUL 21
Location : 1115 CLINT CALL CUSDate Sched :
Serial# : 5ZT2CKEC6MY015302 Chassis# : 5ZT2CKEC6MY015302
Warr. Date : 10 MAY 21 Cust PO# :
Print Date : 10 NOV 21

Job # Description JOB INFORMATION Type Bill To

1 COMPLAINT: FRESH WATER TANK LEAKING AT FITTING FOR W 10024 FORES
 WATER PUMP
 CAUSE: FRESH WATER TANK LEAKING AT FITTING FOR
 WATER PUMP.
 CORRECTION: Moved unit into shop from service lot.
 Disconnected wiring and all hoses from
 fresh water tank. Removed tank
 supports. Drop tank down from frame.
 Changed fittings over from old tank to
 new tank. Installed new tank and
 secured with original tank supports.
 Tightened screws securely. Reconnected
 all wiring and hoses. Filled tank andl
 checked all hose connections. Moved
 unit to service lot.
WINT COMPLAINT: WINTERIZE UNIT AND DRAIN HOLDING TANKS. E 51273 CULIV
 INCLUDES 2 GALLONS OF ANTI-FREEZE
 UNITS WITH WASHING MACHINE OR ICEMAKER
 WILL BE EXTRA **DE-WINTERIZATION IS NOT
 INCLUDED**
 CAUSE: WINTER - WINTERIZE UNIT AND DRAIN
 HOLDING TANKS. INCLUDES 2 GALS
 ANTIFREEZE.
 CORRECTION: By-passed waer heater. Blew out water
 lines and faucets. Added antifreeze to
 all water lines and faucets, including
 outside shower. Poured antifreeze in
 all drain traps. Draned all holding
 tanks, including water heater.
2 COMPLAINT: CHECK FUSE ON JACK E 51273 CULIV
 CAUSE: CHECK FUSE ON JACK.
 CORRECTION: Removed battery box cover. Battery box
 full of water. Jack fuse holder was
 down in water. Fuse holder was rusted

Continued on page 2

Work Order : 64191

 Job # Description JOB INFORMATION Type Bill To

and wire broken off. Removed battery
 and drilled holes in bottom of box to
 allow water to drain out when it rains.
 Cut off damaged wiring. Installed new
 fuse holder and placed on top of
 battery. REconnected battery. Checked
 operation of jack. OK Replaced battery
 box cover..

ROOF COMPLAINT: INSPECT ROOF AND SEAMS - FILL VOIDS E 51273 CULIV
 TT/FW
 CAUSE: ROOFT - INSPECT ROOF AND SEAMS - FILL
 VOIDS TT/FW.
 CORRECTION: Inspected roof and sealed a few spots to
 prevent future leaks.

 Job # Part No Description PARTS Bill to Qty Price Total

1	F100166139	FRESH WATER HOLDIN	W-10024	1	84.55	84.55
WINT	24181	-50 RV ANTI-FREEZE GALLON	E-51273	2	4.49	8.98
2	19-3535	Fuse Holder; ATO/	E-51273	1	4.99	4.99
ROOFT	13-1320	PW HAPS FREE SELF-LEVELING	E-51273	1	9.99	9.99
ROOFT	BRV47996	SILICONE II - WHITE	E-51273	1	9.99	9.99

 Job# Lab Code Description LABOUR Mech Bill to Hrs Rate Total

1	Z990	MISC LABOUR CODE (EXTE DKM	W-10024	0.00	130.00	0.00
1	Z990	MISC LABOUR CODE (EXTE GWG	W-10024	0.50	130.00	65.00
1	Z990	MISC LABOUR CODE (EXTE GWG	W-10024	0.00	130.00	0.00
1	Z990	MISC LABOUR CODE (EXTE DKM	W-10024	0.00	130.00	0.00
1	Z990	MISC LABOUR CODE (EXTE DKM	W-10024	0.00	130.00	0.00
INTER	Z990	WINTERIZE UNIT DKM	E-51273	1.00	130.00	130.00
2	Z990	MISC LABOUR CODE (EXTE DKM	E-51273	0.50	130.00	65.00
ROOFT	Z990	MISC LABOUR CODE (EXTE DKM	E-51273	0.50	105.00	52.50

 Job # Excode Description EXTRAS bill to Qty Price Total

1	FRT	UPS-TANK	W-10024	1.00	137.85	137.85
INTER	SS	SHOP SUPPLIES	E-51273	1.00	9.70	9.70
ROOFT	SS	SHOP SUPPLIES	E-51273	0.00	24.75	0.00

 CUSTOMER COMMENTS

 BW TRIED TO CALL AGAIN ON 08/02/21. NO ANSWER AND MAILBOX IS FULL

bw called on 07/08, but mailbox was full. BW emailed customer on 07/08.

Continued on page 3

Work Order : 64191

BH CALLED CUSTOMER AND CANT LEAVE A MESSAGE 06-30
 BH CALLED CUSTOMER AND COULDNT LEAVE MESSAGE MAIL BOX FULL
 TANK IN BACKROOM 6-8-21...CAM

 BILLINGS SUMMARY

Type	Bill Id	Parts	Labour	Sublet	Extras	Tax	Total
E	51273	33.95	247.50	0.00	9.70	3.06	294.21
W	10024	84.55	65.00	0.00	137.85	0.00	287.40
	Totals	118.50	312.50	0.00	147.55	3.06	581.61