



Phone: (423) 235-1167
Toll Free: (877) 635-1167
Fax: (423) 235-1176

1202 Idell Road
Bulls Gap, TN 37711

W/O: 26801
Promised Date:



WO #: 26801 (Appointment Date: 09 MAR 2026 - Time: 10:00am)

Customer: 93045 - SWIFT, AUBURNI
Address: 13525 HWY 67 WEST
BUTLER, TN
37640

Home Phone:
Work Phone:
Author: CHL
Location: IH
Invoice #:

Stock #: 11087
Stock Desc: 2025 THTT FOREST RIVER ROGUE
29SUT
Model: 29SUT
Serial #: 5NHTVGE28SC005513
Chassis #:
Mileage: 0
Key #:
Req'n #:
License #:
Trim:

Purchase Date: 19 JUL 25
Date In: 07 MAR 26
Promise Date: 30 MAR 26
Promise Time: 09:00am
Schedule Date:
Completed:
Warr. Date: 19 JUL 25

Job #1 - Warranty

COMPLAINT: cs that the trim is coming loose ON OUTSIDE FRONT UNDER FRONT WINDOW

CAUSE: JWRAP ANCHOR RAIL SEPERATING FROM WALL

CORRECTION: NEED TO REMOVE THE JWRAP AND RESECURE RAIL AND REINSTALL JWRAP TO CORRECT DOOR
LABOR 2.5

Subtotal for Job #1: 0.00

Job #2 - Warranty

COMPLAINT: CS THAT RAMP DOOR IS LEAKING OFF DOOR SIDE REAR

CAUSE: PREFORMED WATER TEST TO VERIFY WATER LEAK. WATER IS LEAKING PAST SEAL ON OFF DOOR SIDE OF RAMP.

CORRECTION: REMOVE CURRENT SEAL ON RAMP DOOR AND REPLACE WITH NEW SEAL , WATER TEST.
LABOR 2.5

Subtotal for Job #2: 0.00

Job #3 - Warranty

COMPLAINT: CS THAT THE AWNING LEAKS AT A SEAM ABOVE THE LIVING ROOM ENTRY DOOR

CAUSE: WATER IS LEAKING THROUGH SEAM WHERE AWNING RAIL/GUTTER MEET.

CORRECTION: TECH REQUEST TO CLEAN AREA AND RESEAL TO STOP THE LEAKING
LABOR .50

Subtotal for Job #3: 0.00

Job #4 - Warranty

COMPLAINT: CS THAT AWNING WONT ROLL OUT WITHOUT HELP ARMS ARE STICKING

CAUSE: TECH WAS ABLE TO EXTEND AND RETRACK THE AWNING AT THIS TIME WITH NO ISSUES (JPS)
WARRANTY VERIFIED THIS AWNING IS WORKING AS DESIGNED. (SPD)

Customer #: 93045
SWIFT, AUBURNI



CORRECTION: EMPLOYEE WILL GO OVER THIS WITH CUSTOMER AT PICK UP

Subtotal for Job #4: 0.00

Job #5 - Warranty

COMPLAINT: CS THAT THE FRONT COMPARTMENT DOOR WHERE GEN GOES IS LEAKING WATER IN

CAUSE: TECH VERIFIED THIS ISSUE BY PUTTING WATER ON THE AREA AND CONFIRMED THE LEAK INTO THE COMPARTMENT DOOR. WATER IS GETTING IN THROUGH SEAL BEING FAULTY.

CORRECTION: NEED TO REMOVE THE CURRENT SEAL AND REPLACE WITH NEW DOOR SEAL LABOR ..75

Subtotal for Job #5: 0.00

Job #6 - Warranty

CS THAT THE CAMERA IS INOP CANT LINK TO PHONE NO SCREEN WITH UNIT

Subtotal for Job #6: 0.00

Job #7 - Warranty

COMPLAINT: CS THAT WATER IN THE SHOWER WILL NOT STAY HOT UNLESS YOU RUN THE WATER IN THE BATHROOM SINK

CAUSE: TECH WAS NOT TO DUPLICATE CONCERN AT THIS TIME. WATER TEMPS ARE HEATING ACCURATELY. (JPS) WARRANTY VERIFIED THIS TO BE CORRECT (SPD)

CORRECTION: WILL GO OVER ISSUE WITH CUSTOMER

Subtotal for Job #7: 0.00

Job #8 - Warranty

COMPLAINT: CS THE SLIDE REAR SLIDE IS LEAVING BLACK MARKS ON UNIT WHEN OPENING CLOSING

CAUSE: EXCESS PUTTY FROM SLIDE FASCIA HAS GOTTEN ON SLIDE SEAL AND IS TRACKING/SMEARING ACROSS EXT SLIDE WALL.

CORRECTION: NEED TO REMOVE THE EXCESSIVE PUTTY AND CLEAN AREA LABOR 1.0

Subtotal for Job #8: 0.00

Parts Total: 0.00
Labour Total: 0.00
Sublet Total: 0.00
Extras Total: 0.00

WORK ORDER TOTAL: 0.00

I HEREBY ACCEPT ABOVE DESCRIBED WORK AS SATISFACTORY & COMPLETE TO MY SATISFACTION.

X

MOTOR VEHICLE REPAIR REGISTRATION #MV-04967

Customer Signature : _____

Date: 25 Mar 2026

W/O: 26801
Promised Date: 30 MAR 26



Customer #: 93045
SWIFT, AUBURNI

