



Phone: (423) 235-1167  
Toll Free: (877) 635-1167  
Fax: (423) 235-1176

1202 Idell Road  
Bulls Gap, TN 37711

W/O: 26801  
Promised Date:



WO #: 26801 (Appointment Date: 09 MAR 2026 - Time: 10:00am)

Customer: 93045 - SWIFT, AUBURNI  
Address: 13525 HWY 67 WEST  
BUTLER, TN  
37640

Home Phone:  
Work Phone:  
Author: CHL  
Location: IH  
Invoice #:

Stock #: 11087  
Stock Desc: 2025 THTT FOREST RIVER ROGUE  
29SUT  
Model: 29SUT  
Serial #: 5NHTVGE28SC005513  
Chassis #:  
Mileage: 0  
Key #:  
Req'n #:  
License #:  
Trim:

Purchase Date: 19 JUL 25  
Date In: 07 MAR 26  
Promise Date: 30 MAR 26  
Promise Time: 09:00am  
Schedule Date:  
Completed:  
Warr. Date: 19 JUL 25

**Job #1 - Warranty**

COMPLAINT: cs that the trim is coming loose ON OUTSIDE FRONT UNDER FRONT WINDOW

CAUSE: JWRAP ANCHOR RAIL SEPERATING FROM WALL

CORRECTION: NEED TO REMOVE THE JWRAP AND RESECURE RAIL AND REINSTALL JWRAP TO CORRECT DOOR  
LABOR 2.5

**Subtotal for Job #1: 0.00**

**Job #2 - Warranty**

COMPLAINT: CS THAT RAMP DOOR IS LEAKING OFF DOOR SIDE REAR

CAUSE: PREFORMED WATER TEST TO VERIFY WATER LEAK. WATER IS LEAKING PAST SEAL ON OFF DOOR SIDE OF RAMP.

CORRECTION: REMOVE CURRENT SEAL ON RAMP DOOR AND REPLACE WITH NEW SEAL , WATER TEST.  
LABOR 2.5

**Subtotal for Job #2: 0.00**

**Job #3 - Warranty**

COMPLAINT: CS THAT THE AWNING LEAKS AT A SEAM ABOVE THE LIVING ROOM ENTRY DOOR

CAUSE: WATER IS LEAKING THROUGH SEAM WHERE AWNING RAIL/GUTTER MEET.

CORRECTION: TECH REQUEST TO CLEAN AREA AND RESEAL TO STOP THE LEAKING  
LABOR .50

**Subtotal for Job #3: 0.00**

**Job #4 - Warranty**

COMPLAINT: CS THAT AWNING WONT ROLL OUT WITHOUT HELP ARMS ARE STICKING

CAUSE: TECH WAS ABLE TO EXTEND AND RETRACK THE AWNING AT THIS TIME WITH NO ISSUES (JPS)  
WARRANTY VERIFIED THIS AWNING IS WORKING AS DESIGNED. (SPD)

Customer #: 93045  
SWIFT, AUBURNI



CORRECTION: EMPLOYEE WILL GO OVER THIS WITH CUSTOMER AT PICK UP

**Subtotal for Job #4: 0.00**

**Job #5 - Warranty**

COMPLAINT: CS THAT THE FRONT COMPARTMENT DOOR WHERE GEN GOES IS LEAKING WATER IN

CAUSE: TECH VERIFIED THIS ISSUE BY PUTTING WATER ON THE AREA AND CONFIRMED THE LEAK INTO THE COMPARTMENT DOOR. WATER IS GETTING IN THROUGH SEAL BEING FAULTY.

CORRECTION: NEED TO REMOVE THE CURRENT SEAL AND REPLACE WITH NEW DOOR SEAL LABOR ..75

**Subtotal for Job #5: 0.00**

**Job #6 - Warranty**

CS THAT THE CAMERA IS INOP CANT LINK TO PHONE NO SCREEN WITH UNIT

**Subtotal for Job #6: 0.00**

**Job #7 - Warranty**

COMPLAINT: CS THAT WATER IN THE SHOWER WILL NOT STAY HOT UNLESS YOU RUN THE WATER IN THE BATHROOM SINK

CAUSE: TECH WAS NOT TO DUPLICATE CONCERN AT THIS TIME. WATER TEMPS ARE HEATING ACCURATELY. (JPS) WARRANTY VERIFIED THIS TO BE CORRECT (SPD)

CORRECTION: WILL GO OVER ISSUE WITH CUSTOMER

**Subtotal for Job #7: 0.00**

**Job #8 - Warranty**

COMPLAINT: CS THE SLIDE REAR SLIDE IS LEAVING BLACK MARKS ON UNIT WHEN OPENING CLOSING

CAUSE: EXCESS PUTTY FROM SLIDE FASCIA HAS GOTTEN ON SLIDE SEAL AND IS TRACKING/SMEARING ACROSS EXT SLIDE WALL.

CORRECTION: NEED TO REMOVE THE EXCESSIVE PUTTY AND CLEAN AREA LABOR

**Subtotal for Job #8: 0.00**

Parts Total: 0.00  
Labour Total: 0.00  
Sublet Total: 0.00  
Extras Total: 0.00

**WORK ORDER TOTAL: 0.00**

I HEREBY ACCEPT ABOVE DESCRIBED WORK AS SATISFACTORY & COMPLETE TO MY SATISFACTION.

X

MOTOR VEHICLE REPAIR REGISTRATION #MV-04967

Customer Signature : \_\_\_\_\_

Date: 25 Mar 2026

W/O: 26801  
Promised Date: 30 MAR 26



Customer #: 93045  
SWIFT, AUBURNI

