



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 79479
Promised Date:
26 APR 26

CUSTOMER WORK ORDER

WO #: 79479

Customer: 1000 - BASDEN'S AMERICAN
RV -

Tag:

Author: BH

Location: 0508 CHECK ORK

Stock #: 11742

Stock Desc: 2026 5W ALLIANCE RV
AVENUE 29RL

Chassis #: 7M5FA3327TA013263

Serial #: 7M5FA3327TA013263

Mileage: 0

Licence:

Invoice #:

Date In: 04 APR 26

Promised: 30 APR 26

Date Sched:

Completed: 30 APR 26

Warr. Date:

Job #PDINFW - Internal

PDI - NEW FIFTH WHEEL

Labor

Code	Description	Mechanic	Total
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	ZMS	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	ZMS	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	ZMS	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	ZMS	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	ZMS	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	ZMS	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
LPGI	LP - UNIT SALES	0.00	N/C	N/C

Subtotal for Job #PDINFW: 0.00

Job #1 - Warranty

COMPLAINT: TV WONT PICK UP CHANNELS

CAUSE: Ran a channel scan on the tv and it wouldn't pick up any channels. Checked that the booster was on. Tried a different tv and still couldn't get any channels. Removed the panel for the coax cable behind the tv and checked connections. Pulled the panel for the booster and checked connections. Went on the roof and removed the mounting screws for the antenna and removed dicor from the edge. Removed the antenna and found the coax cable wasnt hooked up to the antenna

CORRECTION: Secured the coax to the antenna. Ran a channel scan and the tv picked up channels. Secured the antenna to the roof. Sealed the antenna with dicor.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	19.50
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	175.50
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	97.50

Parts

Part #	Description	Qty	Price	Total
13-1320	PW HAPS FREE SELF-LEVELING DICOR	1.00	8.72	8.72

Customer #: 1000
BASDEN'S AMERICAN RV,



Subtotal for Job #1: 301.22

W/O: 79479
Promised Date: 30 APR 26



Customer #: 1000
BASDENS AMERICAN RV,



Job #2 - Warranty

COMPLAINT: LEFT SPEAKER IS INOP

CAUSE: Left speaker is not working. Removed the speaker to check connections. Removed Bluetooth receiver and inspected wiring. Traced wires to labels and found that the left speaker is hooked up to the "B" channel, which would be the outside speakers. This unit does not have outside speakers.

CORRECTION: Traced the left side "A" speakers wires. Secured the speaker wires to the wires off of the receiver and the speaker is now working, secured speaker to the ceiling. Secured the receiver to the wall.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	78.00

Subtotal for Job #2: 78.00

Job #3 - Warranty

COMPLAINT: SEWER CAP CORD IS MISSING

CAUSE: Sewer cap is missing the cord that holds it.

CORRECTION: Replaced with a new cap and cord.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	19.50

Parts				
Part #	Description	Qty	Price	Total
11-0429	39463 SEWER CAP W/HOSE CONNECTION	1.00	4.63	4.63

Subtotal for Job #3: 24.13

Job #4 - Warranty

COMPLAINT: STAPLES NEED SET ON SLIDE ROOM

CAUSE: Staples are sticking out on the slide room.

CORRECTION: Set staples and filled holes with putty.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	19.50

Subtotal for Job #4: 19.50

Job #5 - Warranty

COMPLAINT: GLUE ON THE CORNER OF THE ISLAND

CAUSE: Glue on the kitchen island.

CORRECTION: Removed glue.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	19.50

Subtotal for Job #5: 19.50

Job #6 - Warranty

COMPLAINT: OUTSIDE FAUCET IS LEAKING



W/O: 79479
Promised Date: 30 APR 26



Customer #: 1000
BASDENS AMERICAN RV,



CAUSE: When running water through the outside shower i noticed water leaking through the quick connect.

CORRECTION: Went to the parts room and removed new faucet and located the unit on the lot. Removed the original faucet and installed the replacement. Pressurized water system and now the cold water fitting going into the faucet is leaking.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	19.50
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	39.00

Parts

Part #	Description	Qty	Price	Total
14322	Faucet - Outside - Nautilus Center w	1.00	22.75	22.75

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-OUTSIDE SHWR FAUCET	1.00	10.69	10.69

Subtotal for Job #6: 91.94

Parts Total: 36.10
Labour Total: 487.50
Sublet Total: 0.00
Extras Total: 10.69
WORK ORDER TOTAL: 534.29

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 04 May 2026

