

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	2653427
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2FEKB7SW030811
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$195.00	SITE/WAREHOUSE	320 / 320
OWNER INFORMATION		ITEM #	FET21SE-320
SARAH A FISCHER		DEALER RO #	79652
2100 REIS LANE		CLAIM START DATE	04/24/2026
Wadesville, IN 47638		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	03/06/2026	WARRANTY EXPIRATION DATE	03/06/2027

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	70-147-24-00-001769	TV Coax Cable - Appliances/Television/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2026-04-24 10:49:31 :: THE ANTENNA CORD BROKE AND DETACHED FROM THE TV Coax cable broke Took off broken cable and replaced it with a new one. I put new ends on the cable			
Model#	Dlr Sub Hrs	0.20	Sub Labor Amt	\$39.00
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$39.00
	Notes			

Labor

Line# 2	Operation Code	Operational Description		
	40-196-01-11-001275	Single Pancake Light Lens - Electrical/12 Volt Interior/Replace/Electrical		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2026-04-24 10:50:02 :: Light over sink flickers - could be a loose led? Light over sink flickers So i took the light out and took off the connectors and checked the wires. I stripped two of the wires a little bit more and put new connectors on. But the longer you leave the light on it starts to flicker. I checked the voltage and it was good at the light. So i put in a parts request for a new light			
Model#	Dlr Sub Hrs	0.40	Sub Labor Amt	\$78.00
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$58.50
	Notes			
	R&R light; additional time given above flat rate			

Labor

Line# 3	Operation Code	Operational Description		
	60-136-01-00-001500	Fitting - Plumbing/Fresh Water Supply/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2026-04-24 10:51:26 :: Outdoor sink cold line leaks underneath and it drips fairly often from the faucet - tried tightening but I think there's a plastic piece that was broken. Outdoor kitchen cold line leaks I pressurize the system and seen the cold line drip. So i took it apart and the fitting may have a crank. So i replaced the fitting and i cut some off the hose to make a good seal. And tested it on pump and city no leaks			
Model#	Dlr Sub Hrs	0.60	Sub Labor Amt	\$117.00
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$39.00
	Notes			
	replaced water line fitting - see repair code 60-136-01-00-001500 for replacing the fitting			
	corrected repair code to 60-136-01-00-001500 for replacing the fitting			

Labor

Line# 4 **Operation Code** **Operational Description**
60-139-01-00-001564 Sink Drain Hose - Plumbing/Kitchen (Galley) Sink/Replace/No Tread Code
Complaint, Cause, Correction
Original Note : bhoffman@americanrvcenter.com, 2026-04-24 10:52:04 :: Outdoor sink water drain line leaks at white joint coupler - tried tightening but it was still leaking. Outdoor kitchen drain leaks Pressurized system and ran water through the drain and i seen it leak. So i went ahead and took the drain apart and made sure the rubber hose was pushed up were it neede to be and put some dope on the threads and made sure it screwed on properly and tightened the joint and checked it again for leaks. And no leaks. I tested it on pump and city water pressure

Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$97.50
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$58.50

Notes
take sink drain hose off and put sealer on threads - see repair code 60-139-01-00-001564 for drain hose
corrected repair code to 60-139-01-00-001564 for sink drain hose

Labor
Line# 5 **Operation Code** **Operational Description**
20-69-01-17-000700 Key Lock - Exterior/Compartment Doors/Replace/Latch
Complaint, Cause, Correction
Original Note : bhoffman@americanrvcenter.com, 2026-04-24 10:52:47 :: THE OUTDOOR KITCHEN DOES NOT LOCK Outdoor kitchen door hard to lock. After inspection of the door lock and you had to push in on the door. I changed the lock blade and it locks easily now

Model#	Dlr Sub Hrs	0.10	Sub Labor Amt	\$19.50
Serial#	Appr Hrs	0.10	Appr Labor Amt	\$19.50

Notes

Labor
Line# 6 **Operation Code** **Operational Description**
60-136-12-00-001500 Fitting - Plumbing/Fresh Water Supply/Resecure or Tighten/No Tread Code
Complaint, Cause, Correction
Original Note : bhoffman@americanrvcenter.com, 2026-04-24 10:56:23 :: INSIDE KITCHEN FAUCET IS LEAKING ON THE HOT SIDE Hot water line under kitchen sink leaks When i was hooked up to city water working on the outdoor kitchen leakthat the hot line was leaking. So i took it apart and seen the from the factory the cone washer was installed incorrectly. So i put a. Ew cone washer in and pressurized the system and no leaks.

Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$58.50
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$39.00

Notes
replaced cone washer inside fitting on hot side of interiior kitchen faucet - see repair code 60-136-12-00-001500 for fitting
corrected repair code for fitting 60-136-12-00-001500

Submitted	Labor Amt	\$409.50	Approved	Labor Amt	\$253.50
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$409.50		Total	\$253.50

DEALER DATE
SIGNATURE
I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER DATE
SIGNATURE
All repairs described have been inspected and are satisfactory.