

BASDEN RV CENTER, INC dba AMERICAN RV  
600 E. Baseline Rd.  
Evansville, IN  
US  
47725  
812-867-5200

WARRANTY CLAIM # 79577  
MANUFACTURER'S CLAIM #:

Manufacturer: 1013 - KEYSTONE RV CO  
Customer: 1000 - BASDEN'S AMERICAN RV  
Address: 600 E. BASELINE RD. EVANSVILLE, IN  
USA  
47725

Phone:

Stock Number: 11729 - 2026 MONTANA 3100RL 4YDFM0R22T4700700

VIN: 4YDFM0R22T4700700 HIN:

SER#: 4YDFM0R22T4700700

Mileage: 0

Work Order Comp: 20 MAY 26

Auth. No:

Dealer #: 1194

Warr. Date:

Work Order Date: 14 APR 26

Inv #: 430295

\*\*\*\*\*  
WO #      Job #      Description      JOB INFORMATION  
\*\*\*\*\*  
79577      1      26-482 Montana Underbelly Securement Recall It has been decided  
that the vehicles in the recall population may have inadequate  
securement of the underbelly to the drop-down section of the  
frame. Under certain conditions during travel, the underbelly may  
come loose or detach from the vehicle, leading to an increased  
risk of a vehicle crash.  
there are multiple tears in the underbelly where they are secured  
to the frame. also, there are no crossmembers to attach self  
taping screws to secure the liddle section of the underbelly.  
tech recommends removing the damages underbelly and replacing it.  
we will also need crossmembers to complete the recall. 7ft x 9ft  
underbelly  
Closed the slide rooms and pulled the unit up to the shop.  
Removed rivets and screws from the frame and removed the  
underbelly. Took the new underbelly material and cut to length.  
Secured the underbelly with self tapping screws and washers.  
Measured and secured the cross members at 60 and 90 inches from  
the front.. Installed front and rear aluminum bracing. Cleaned up  
tools and parked unit. Typed notes and put the remaining  
underbelly up.  
  
79577      2      SHOCK ON THE DOOR SIDE REAR TIRE HAS FELL OFF  
The bolt that holds the shock together is missing. A strut was  
ordered. Took a bolt off another strut because we couldnt get one  
from warranty went out to the unit and found the bolt is broken  
and is stuck inside the hanger.

Claim : 79577

\*\*\*\*\*  
 WO #      Job #      Description      JOB INFORMATION  
 \*\*\*\*\*

The broken bolt was removed. A replacement bolt and washer were installed.

79577      3      REMOVE THE BOLT WITH THE BROKEN HEAD ON THE FRONT DOOR SIDE AXLE SHOCK  
 Bolt is snapped off of shock mount.  
 I drilled the bolt and extracted it.

\*\*\*\*\*

Part No	Job#	Description	PARTS	Qty	Price	Total
695481	1	WOVEN UNDERBELLY - 74"w X LENGTH		56.00	1.04	58.24
790039	1	Crossmember - C Channel - 72 1/8"		2.00	28.41	56.82
771236	2	Axle - Shock - TCS - 12.63" - EXT		1.00	116.14	116.14

\*\*\*\*\*

\*\*\*\*\*

Lab Code	Job#	Description	LABOUR	Hrs	Rate	Total
Z990	1	MISCELLANEOUS REPAIR		0.50	190.00	95.00
Z990	1	MISCELLANEOUS REPAIR		0.00	190.00	0.00
Z990	1	MISCELLANEOUS REPAIR		0.00	190.00	0.00
Z990	1	MISCELLANEOUS REPAIR		0.00	190.00	0.00
Z990	1	MISCELLANEOUS REPAIR		0.50	190.00	95.00
Z990	1	MISCELLANEOUS REPAIR		0.50	190.00	95.00
Z990	1	MISCELLANEOUS REPAIR		0.50	190.00	95.00
Z990	2	MISCELLANEOUS REPAIR		0.00	190.00	0.00
Z990	2	MISCELLANEOUS REPAIR		0.20	190.00	38.00
Z990	2	MISCELLANEOUS REPAIR		0.10	190.00	19.00
Z990	2	MISCELLANEOUS REPAIR		0.00	190.00	0.00
Z990	3	MISCELLANEOUS REPAIR		0.30	190.00	57.00

\*\*\*\*\*

\*\*\*\*\*

Excode	Job#	Description	EXTRAS	Qty	Price	Total
FRT	1	UPS-UNDERBELLY		1.00	119.98	119.98
FRT	2	UPS-SHOCK		1.00	12.57	12.57

\*\*\*\*\*

Parts Total:      231.20  
 Labour Total:     494.00  
 Sublet Total:     0.00  
 Extras Total:     132.55

>>>> Claim Total:      857.75

Customer Signature: \_\_\_\_\_

Date: \_\_\_\_\_