

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 13418

Date In:	27 APR 26	Author:	KOTT
Promised Date:	04 JUL 26	Stock No:	
:		Year:	2021
Customer Name:	15094 - ALDRIDGE, TRAV	Manufacturer:	GRAND DESIGN
Address:	W9930 RIVER OAKS ROAD	Brand:	SOLITUDE
:	POYNETTE, WI	Model:	390RK-R
Postal/Zip:	53955	Miles/Hrs:	
Phone#(res):	608-697-2032	Exterior Color:	
Phone#(bus):		Unit Type:	FW-FIFTH WHEEL
Cell Phone:	608-635-8940	License#:	
Email:	TRAVIS.ALDRIDGE@GMAIL.	Tag#:	HELPING SRT
Purchased Date:		:	
Delivery Date:		:	
InService Date:		:	
Serial#:	573FS4426MAA05254	:	

Job #	Description	JOB INFORMATION	Type	Bill To
1	COMPLAINT: CAUSE:	ASSISTING SRT WITH UNIT- help the srt guy with front cap on Aldridge unit. For the kitchen floor concern, SRT discovered the campaign repair had begun to fail, the lag bolts into the sidewalls to support the kitchen floor began to back out. He added an adhesive sealant to each lag to prevent them from backing out as well as adding expanding rivets between each lag. For the "frame flex" concern, measurements were taken and everything was within tolerance, however there was large popping and squeaking in the bedroom floor and ceiling behind the washer closet. SRT removed the lower filon and we assisted removing the front cap to inspect. He added additional lags and carriage bolts to secure the sidewalls to the frame as well as discovering a cracked weld that he repaired. The squeaking and popping came from the front cage that was only attached to the sidewalls with 3 screws on each side. He added well over a dozen per side and also secured the cage to the floor. SRT assisted throwing the front cap back on with a couple screws	W	1020 GRAND

Continued on page 2

Work Order : 13418

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
                to hold it in place.  We finished
                reassembling everything and resealing.
CORRECTION: ... REQ: 2.50
2 COMPLAINT: PUTTING THE FILON BACK UP AFTER SRT DID W 1020 GRAND
                THE REPAIRS ON THE UNIT
CAUSE: For the kitchen floor concern, SRT
                discovered the campaign repair had begun
                to fail, the lag bolts into the
                sidewalls to support the kitchen floor
                began to back out.  He added an adhesive
                sealant to each lag to prevent them from
                backing out as well as adding expanding
                rivets between each lag.  For the "frame
                flex" concern, measurements were taken
                and everything was within tolerance,
                however there was large popping and
                squeaking in the bedroom floor and
                ceiling behind the washer closet.  SRT
                removed the lower filon and we assisted
                removing the front cap to inspect.  He
                added additional lags and carriage bolts
                to secure the sidewalls to the frame as
                well as discovering a cracked weld that
                he repaired.  The squeaking and popping
                came from the front cage that was only
                attached to the sidewalls with 3 screws
                on each side.  He added well over a
                dozen per side and also secured the cage
                to the floor.  SRT assisted throwing the
                front cap back on with a couple screws
                to hold it in place.  We finished
                reassembling everything and resealing.
CORRECTION: RESEAL AND PUT UP FILON AFTER SRT REQ:
                7 HOURS OF LABOR

```

```

*****
Job # Part No      Description      PARTS      Bill to      Qty      Price      Total
*****
2      851599003008 NOVAFLEX PRO 10 OZ TRANS W-1020      2      9.28      18.56
2      677917000333 Dicor 501LSW-1 EPDM Self W-1020      9      8.52      76.68
*****
Job#  Lab Code  Description  LABOUR  Mech Bill to      Hrs      Rate      Total
*****
1 WARR      MANUFACTURER WARRANTY  TD  W-1020      1.00      140.00      140.00
1 WARR      MANUFACTURER WARRANTY  TD  W-1020      0.84      140.00      117.60
1 WARR      MANUFACTURER WARRANTY  JGK W-1020      0.20      140.00      28.00
1 WARR      MANUFACTURER WARRANTY  TD  W-1020      0.37      140.00      51.80
2 WARR      MANUFACTURER WARRANTY  JS  W-1020      0.00      140.00      0.00

```

Continued on page 3

Work Order : 13418

```

*****
Job#  Lab Code  Description    LABOUR    Mech Bill to      Hrs      Rate      Total
*****
  2  WARR      MANUFACTURER WARRANTY          W-1020      0.00    140.00      0.00
  2  WARR      MANUFACTURER WARRANTY    JS    W-1020      3.41    140.00     477.40
  2  WARR      MANUFACTURER WARRANTY    JS    W-1020      2.67    140.00     373.80
  2  WARR      MANUFACTURER WARRANTY    JL    W-1020      0.75    140.00     105.00
*****

```

```

*****
                        BILLINGS SUMMARY
Type Bill Id      Parts      Labour      Sublet      Extras      Tax      Total
*****
W      1020      95.24    1293.60      0.00      0.00      0.00    1,388.84

      Totals      95.24    1293.60      0.00      0.00      0.00    1,388.84
*****

```

&k2S
&k0S