


AIR CONDITIONER CHECKLIST FOR WARRANTY REQUEST

WARRANTY

Diagnostic Information

Is there a visible refrigerant leak within the AC unit, location of leak? Yes ☐ No ☒

If Yes Photo Required - Click box below to add photo

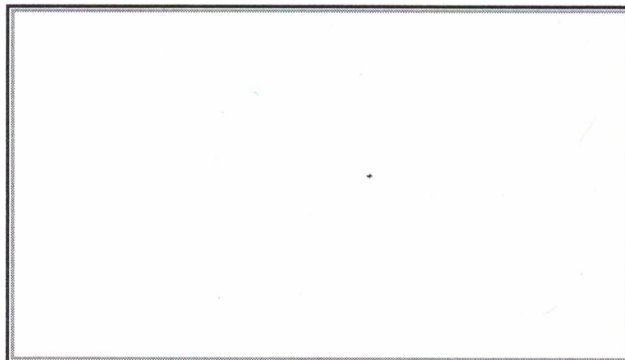

***** If a leak is identified, no additional testing is required *****

*After running the unit for 15 minutes at the coldest setting, please provide the following:

Does compressor run? NA Amp draw on blue compressor wire: NA

Outdoor temperature at the upper unit while testing: 68°F AC Volts: 121

Outdoor temp must be higher than 65 degrees F

Return/Intake Temperature: 68 Discharge/Supply Temperature: NA

Blower Motor Condition: good no issues Amp Draw: NA AC Volts: NA

Blower Wheel Condition: good no issues

Condenser Motor Condition: good no issues Amp Draw: NA AC Volts: NA

Condenser Fan Blade Condition: Blade is broke off due to Insulation Blanket camel case

Run Capacitor/MFD: IF: NA OF: NA CP: NA

Wiring Condition/Correct: correct

Thermostat DC Volts: NA Control DC Volts: NA Control Dip Settings: _____

Freeze Sensor Location/Ohms: _____ ICE Build UP on Evaporator: Yes ☐ No ☒

Room Temperature Sensor Location: Return Air grill

Roof Thickness: 5" Compressor Cycle On and Off: Yes ☐ No ☒
cannot Run unit

Please note: Submitting this form does not guarantee your claim will be paid or replacement will be issued. Furrion may request additional details based on the documentation you have completed.

AIR CONDITIONER CHECKLIST FOR WARRANTY REQUEST

WARRANTY

FURRION® AIR CONDITIONER CHECKLIST FOR WARRANTY REQUEST

Once completed – E-mail to support@Furrion.com

*Incomplete or inaccurate information will delay processing. Replacement parts will be shipped unless otherwise noted.

Dealer Name: Tri-Am RV Center Dealer Account #: 008017
 Dealer Phone: 423-235-1167 E-mail: tnwarranty@triamrv.com
 Dealer Contact: Stephanie CC: ashlee@dealers-advisors.com
 Customer Name: Jayson Stebbins Dealer PO #: 26880
 Shipping Address: 1202 Idell Road Original Owner: ☒ Yes ☐ No
 City: Bulls Gap State: TN Case #: _____
 Coach Manufacturer: Keystone Model of Coach: Coogar Floorplan: 34TSB
 Complete Coach VIN #: 4YDT34T26MV504308 Year of Coach: 2021
 Date of Manufacture: _____ Original Date of Purchase: _____
 Model #: FAC218VSDA-PS-AM Serial #: 540V8005301A10020150004

Nature of the Complaint & Troubleshooting Performed:

During initial startup test, AC began to start up and a ticking noise was noticed. When technician turned AC off to inspect noise, a loud clunk noise was observed and AC stopped immediately. Upon further inspection, shroud up top was removed and tech found a piece of insulation blanket wrapped around condenser fan blades and found fan blade broke off and condenser damaged, tech found fan blade at right rear.

Control Type / Thermostat

Thermostat Model and Version: _____ Controller Model and Version: _____

ADB Model: FAC218VSDA-PM-AM Heat Strip Model If Installed: NO
2024040312