



600 E. Baseline Rd.  
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200  
FAX 812.868.1012

W/O: 79336  
Promised Date: 28 MAR 26

### CUSTOMER WORK ORDER

WO #: 79336

Customer: 56598 - GOEBEL, DAVID -  
812-430-9916

Tag:

Author: BH

Location: 0403 CHECK PREAUTH

Stock #: 11693

Stock Desc: 2026 TT COACHMEN APEX  
242BARV

Chassis #: 5ZT2CXNB0TS049693

Serial #: 5ZT2CXNB0TS049693

Mileage:

Licence:

Invoice #:

Date In: 23 MAR 26

Promised: 28 MAR 26

Date Sched:

Completed: 31 MAR 26

Warr. Date: 28 MAR 26

#### Job #FPDINTT - Internal

COMPLAINT: FINAL PDI ON NEW TRAVEL TRAILERS

CAUSE: New final pdi

CORRECTION: Pulled unit from lot. Checked coupling, safety chains, tonguejack, stability jacks, lights, breakaway switch and brakes. Checked Tire pressure and lug Torque. Checked all exterior seals and doors. Dewinterized unit and filled Fresh tank to check sensors and pump. Hooked up to City water connection. Performed LP DropTest with Furnace and Water Heater. Checked Stovetop, Grille and Microwave. Checked both Fridges and Wine Cooler. Checked both TVs. Checked all windows and blinds. Checked both ACs. Checked all roof vents and fans. Checked Awning and lights. Checked Converter charge at 13v. Checked Shore Power Cord. Checked all 120v Recepticals and 12v USB ports. Ran sinks and toilet to fill Grey and Black tanks to activate sensors. Dumped all tanks. Closed unit up and pulled it outside to test antenna because i cant get reception inside. Outside bartop tv worked, bedroom tv worked but the livingroom tv does not. Pulled the Conversion port in bedroom and pull in in living room. Corrected the Coax issue and filled out Paperwork.

#### Labor

Code	Description	Mechanic	Total
PDINTT	PDI - NEW TRAVEL TRAILER	JRK	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	JRK	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	JRK	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	JRK	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	JRK	N/C

#### Parts

Part #	Description	Qty	Price	Total
DC-24	DP24 GROUP 24 DEEP CYCLE BATTERY	1.00	N/C	N/C
5516	A10-3050FHVP 30M-50F PIGTAIL	1.00	N/C	N/C

**Subtotal for Job #FPDINTT: 0.00**

#### Job #1 - Internal

COMPLAINT: SWAP MATTRESS FROM TRADE

CAUSE: Mattress swap

CORRECTION: Swapped mattresses between to campers.

#### Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C



Customer #: 56598  
GOEBEL, DAVID



Subtotal for Job #1: 0.00

W/O: 79336  
Promised Date: 28 MAR 26



Customer #: 56598  
GOEBEL, DAVID



**Job #2 - Internal**

COMPLAINT: LONG HANDLERAIL (SEE LOGAN)

CAUSE: Replace handrail with longer one.

CORRECTION: Removed old handrail and installed new one.

**Labor**

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C

**Parts**

Part #	Description	Qty	Price	Total
SP56-469	TELESCOPING RV ENTRY DOOR RAIL; MAGN	1.00	N/C	N/C

Subtotal for Job #2: 0.00

**Job #3 - Internal**

COMPLAINT: BE SURE A/C HAS SOFT START

CAUSE: Wire in Soft Starts on both ACs.

CORRECTION: None of the manufacturer AC come with Soft Starts unless inverters are installed. Doublecheck and submitted parts request for both AC. Received Soft Starts. Retrieved unit. Retrieved steps and all my tools for job. Went to roof and removed shroud and metal cover box. Researched for the wiring diagram for this specific model but couldnt find it but found 2 diagrams that matched the same components and followed instructions on one and turned power on. fan turned on but compressor never turned on. Waited the 5 to 10 minutes timeframe for compressor to power up but never did. Went back up to roof and swapped the Red and Brown wires around off the Soft Start and powered it back up and waited the time frame and compressor kicked on and started cooling properly. Repeated the process to the 2nd AC. Front AC that is the single ceiling unit has less of a delay on start up. Main AC takes about 10mins to power up. Returned Cover boxes and shouds to both units and cleaned all my tools and supplies up. Went over to walk thru and hooked up shore power and turned livingroom ac on and compressor kicked on within a few minutes and gave it a minute or so and then turn on the bedroom ac and within a few minutes compressor kicked on and was cooling efficiently.

**Labor**

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C
Z990	MISC LABOUR CODE (EXTERNAL)		N/C
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C

**Parts**

Part #	Description	Qty	Price	Total
12884	A/C SOFT START KIT	2.00	N/C	N/C

Subtotal for Job #3: 0.00

**Job #SWAP - Internal**

COMPLAINT: SWAP CUSTOMER'S HITCHWORK

CAUSE: Swap hitchwork

CORRECTION: Drove the vehicle thru the gate then jacked up the camper and disconnected the truck from the camper. Unbolted the L brackets and the license plate. Drove the truck to the walkthru. Leveled the camper then checked the ball height and adjusted as needed. Connected the truck to the camper. Connected the 7 way, safety chains and breakaway cable. Bolted the license plate.

**Labor**

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C





**Other Services**

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

**Subtotal for Job #SWAP: 0.00**

**Job #4 - Internal**

COMPLAINT: FIX TRIM AROUND BATHROOM DOOR

CAUSE: Plastic door jam not installed properly

CORRECTION: Looked bathroom door trim over and only thing i see is where the plastic jam cover is not properly sitting in jam on outside of Bathroom door. Loosened the wall pocket and put plastic door jam into place and tightened wall pocket to hold into place.

**Labor**

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C

**Subtotal for Job #4: 0.00**

**Job #MAXX - Internal**

COMPLAINT: ROOF VENT COVER - INSTALLED EACH

CAUSE: Install vent covers

CORRECTION: Installed 2 vent covers

**Labor**

Code	Description	Mechanic	Total
Z990	INSTALL MAXX AIR VENT	JRK	N/C

**Parts**

Part #	Description	Qty	Price	Total
22-0257	40443 BLK CAMCO VENT COVER	2.00	N/C	N/C

**Other Services**

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
PARTS	UNINVENTORIED PARTS	0.00	N/C	N/C

**Subtotal for Job #MAXX: 0.00**

**Job #5 - Warranty**

COMPLAINT: THE LIVING ROOM TV IS NOT GETTING ANY CHANNELS

CAUSE: Coax not installed properly.

CORRECTION: Test all 3 antenna hook ups... outside bar and bedroom had reception but livingroom tv did not. Pulled the main splitter in the bedroom with the on off switch and there was only 2 antenna hookups in it so i pulled the other wall hookups to see if i could locate a splitter but no luck. Going onto roof to pull the Wingard cover to see if its inside it. Part requested a splitter. Received it the following morning. Had to make a female to female section and installed it on coaxes. Tested TV receptions and all working properly. Reinstalled the rooftop Winegard dome and all the wall pull ins.

**Labor**

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	146.25
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	48.75
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

**Parts**

Part #	Description	Qty	Price	Total
3107612	SPLITTER 2-WAY SATELLITE	1.00	15.59	15.59



Subtotal for Job #5: 210.59

Parts Total: 15.59  
Labour Total: 195.00  
Sublet Total: 0.00  
Extras Total: 0.00

**WORK ORDER TOTAL: 210.59**

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : \_\_\_\_\_

Date: 02 Apr 2026

Customer Work Order

W/O: 79336  
Promised Date: 28 MAR 26



Customer #: 56598  
GOEBEL, DAVID

