



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 80082
Promised Date:
20 JUN 26



Customer #: 56778
ART, EMILY



CUSTOMER WORK ORDER

WO #: 80082

Customer: 56778 - ART, EMILY -
256-695-8773

Tag:

Author: BJW

Location: 0611 SEE IF JTW HAS
COMPLETED THIS YET

Stock #: 11698

Stock Desc: 2026 TT COACHMEN

CATALINA 303RKDSLE

Chassis #: 5ZT2CAVB1TX036824

Serial #: 5ZT2CAVB1TX036824

Mileage: 0

Licence:

Invoice #:

Date In: 01 JUN 26

Promised: 30 JUN 26

Date Sched:

Completed: 10 JUN 26

Warr. Date: 21 MAY 26

Job #1 - Warranty

COMPLAINT: CUSTOMER NOTICED WATER RUNNING INTO THE UNDERBELLY, ESPECIALLY WHEN TAKING A SHOWER. CUSTOMER ADVISED THAT HE FEELS LIKE THE WATER IS LEAKING WHERE THE DRAIN LINE FROM THE SHOWER TIES INTO THE MAIN DUMP LINE.

CAUSE: Water leaking into underbelly when taking a shower

CORRECTION: On inspection of the shower it removed the access panel from under the shower pan. And found that the factory never glued the connection. And it was on the pipe when it left here and with the customer taking a shower put pressure on the pipe causing it to pop off the connection. So I cleaned it and put glue on the pipe and pushed in the connection and tightened up everything. Did a water test on it and no leaks

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JTW	9.75
Z990	MISC LABOUR CODE (EXTERNAL)	JTW	87.75
Z990	MISC LABOUR CODE (EXTERNAL)	JTW	97.50

Subtotal for Job #1: 195.00

Job #2 - Warranty

COMPLAINT: WHEN RUNNING THE MAIN SLIDE ROOM IN, IT TILTS UPWARD SO HARD AT THE END OF IT'S TRAVEL THAT THE CROWN MOLDING ON THE TOP OF THE SLIDE ROOM HITS THE INTERIOR LIGHTS AND TURNS THEM OFF.

CAUSE: Slideroom hitting the lines

CORRECTION: Slideroom is not hitting the lights and turning them off. But I did notice that the Slideroom flap seal is torn. And i put in a parts requestfor anew one. And the slideroom is not centered in the wall going to try to adjust it if possible. We adjusted the slideroom. Waiting on new seal to come in. New seal came in. So I had to heat up the old sealer to get it to come off. Then I had to pull out all the staples that they had holding the seal on. Then I cleaned the area and put the new seal on. And stapled it. And then I sealed the edges with Geo seal. Good to go

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JTW	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JTW	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JTW	390.00
Z990	MISC LABOUR CODE (EXTERNAL)	JTW	0.00

Parts

Part #	Description	Qty	Price	Total
--------	-------------	-----	-------	-------



13332	SEAL, WIPE TOP 2.75 W/TALL BULB FLIP	8.00	3.20	25.60
-------	---	------	------	-------

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-SEAL	1.00	16.79	16.79

Subtotal for Job #2: 432.39

Job #3 - Warranty

COMPLAINT: THIS UNIT IS EQUIPPED WITH A BAL TONGUE JACK. THE TELSCOPING FOOT IS DIFFICULT TO PULL OUT AND PUSH IN WHEN TRYING TO ADJUST IT. CUSTOMER REQUESTS THAT WE LUBE THE TUBING ON THE FOOT SO THAT IT SLIDES IN AND OUT EASIER.

CAUSE: Tounge jack foot stuck

CORRECTION: So i got the tounge jack foot out. And I checked it for burs. I ran a file over it and lubricant it. It moves better.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JTW	78.00

Subtotal for Job #3: 78.00

Parts Total: 25.60
Labour Total: 663.00
Sublet Total: 0.00
Extras Total: 16.79

WORK ORDER TOTAL: 705.39

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 10 Jun 2026

W/O: 80082
Promised Date: 30 JUN 26



Customer #: 56778
ART, EMILY

