



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 79897



Customer #: 1000
BASDEN'S AMERICAN RV,



CUSTOMER WORK ORDER

WO #: 79897

Customer: 1000 - BASDEN'S AMERICAN
RV -

Tag:

Author: BH

Location: 0522 CHECK PREAUTH

Stock #: 11759

Stock Desc: 2026 TT COACHMEN APEX
293RLDS

Chassis #: 5ZT2CXUB0TS050313

Serial #: 5ZT2CXUB0TS050313

Mileage: 0

Licence:

Invoice #:

Date In: 12 MAY 26

Promised:

Date Sched:

Completed: 22 MAY 26

Warr. Date:

Job #PDINTT - Internal

COMPLAINT: PDI - NEW TRAVEL TRAILER

CAUSE: PDI

CORRECTION: Filled two 20 gallon LP. Installed battery box. Checked all four brakes on tires. Checked air pressure. Checked break away. Lowered jacks. Checked roof. Inspected outside of trailer. Checked compartment doors. Checked interior cabinets and windows. Checked tv. Checked freige and stove vent. Checked microwave. Checked fireplace. Checked outside tv. Checked furniture. Checked outlets. Checked awning operation. Put water in fresh tank and checked water pump. Ran city water and checked tanks. Turned on lp and tested water heater, furnace and stove. Did drop test

Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	BB	N/C
Z991	MISC LABOUR CODE (INTERNAL)	BB	N/C
Z991	MISC LABOUR CODE (INTERNAL)	BB	N/C
Z991	MISC LABOUR CODE (INTERNAL)	BB	N/C
Z991	MISC LABOUR CODE (INTERNAL)	BB	N/C

Parts

Part #	Description	Qty	Price	Total
13034	55362 STD BATTERY BOX	1.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
LPGI	LP - UNIT SALES	0.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #1 - Warranty

COMPLAINT: LIGHT FELL OF OFF DINING ARE CEILING

CAUSE: Light hanging down upon delivery

CORRECTION: Screwed light back up. And tested

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BB	39.00



Subtotal for Job #1: 39.00

Job #2 - Warranty

COMPLAINT: WIRE LOOM IS STICK OUT OF BOTTOM OF SLIDE ROOM FLOOR

CAUSE: Wire loom sticking out under slideroom trim on the floor.

CORRECTION: Removed trim. Zip tied some wires trying to hold them back. Closed and open room. Didn't work. Removed trim again. So much wire to try to hold back. Cut wire ties and straighten out 110. Wired tie to wall. Put trim back. Closed and open room. Still showing 12v wires. Removed trim. Wired tied back 12v. Closed and open room. Good

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BB	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BB	195.00

Subtotal for Job #2: 195.00

Job #3 - Warranty

COMPLAINT: BATTEN STRIP LOOSE OVER THE STOVE

CAUSE: Plastic trim loose on slideroom ceiling

CORRECTION: Siliconed under trim and stuck back.

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BB	19.50

Subtotal for Job #3: 19.50

Job #4 - Warranty

COMPLAINT: STAPLE HOLES NEEDS FILLED IN SLIDE ROOM MISSING PUTTY

CAUSE: Staples in ceiling missing putty

CORRECTION: Put white putty on where needed.

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BB	19.50

Subtotal for Job #4: 19.50

Job #5 - Warranty

COMPLAINT: PANCAKE LIGHT MISSING COVER

CAUSE: Light missing cover upon delivery
Missing locking cover ring.

CORRECTION: Ordered new light.
Received new light with cover. Retrieved unit. Opened the light and manufacturer sent the light with the ring LOCKED onto light which wasn't easy to twist and unlock but used table vise with Allen wrenches in screw holes to hold in place and twisted ring from light and installed on light in unit.

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	39.00
Z990	MISC LABOUR CODE (EXTERNAL)	BB	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

Parts Part #	Description	Qty	Price	Total
--------------	-------------	-----	-------	-------

W/O: 79897



Customer #: 1000
BASDEN'S AMERICAN RV,



F100664315 LIGHT 4.6" LED 12V SURF MOUNT 1.00 5.77 5.77
WHITE

Other Services

Code	Description	Qty	Price	Total
FRT	FREIGHT	1.00	16.83	16.83

Subtotal for Job #5: 61.60

Job #6 - Warranty

COMPLAINT: THERE IS A LEAK FROM THE UNDERBELLY NEAR THE AREA OF THE DUMP VALVES.

CAUSE: Water dripping by dumping valve.

CORRECTION: Removed spray foam around pipe. Cut back underbelly. Found leak on 4" pipe going to tank. Dumped tanks, let dry over night. Took black ABS cement and applied around 4" pipe. Let dry. Put more water in tank to check for leaks,

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BB	107.25
Z990	MISC LABOUR CODE (EXTERNAL)	BB	126.75

Subtotal for Job #6: 234.00

Parts Total: 5.77

Labour Total: 546.00

Sublet Total: 0.00

Extras Total: 16.83

WORK ORDER TOTAL: 568.60

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 22 May 2026

W/O: 79897



Customer #: 1000
BASDENS AMERICAN RV,

