

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 79897
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 1000 - BASDEN'S AMERICAN RV
Address: 600 E. BASELINE RD. EVANSVILLE, IN
USA
47725
Phone:
Stock Number: 11759 - 2026 APEX 293RLDS 5ZT2CXUB0TS050313
VIN: 5ZT2CXUB0TS050313 HIN: SER#: 5ZT2CXUB0TS050313
Mileage: 0 Work Order Comp: 22 MAY 26
Auth. No: Dealer #:
Warr. Date: Work Order Date: 12 MAY 26 Inv #: 430430

WO # Job # Description JOB INFORMATION

79897 5 PANCAKE LIGHT MISSING COVER
Light missing cover upon delivery Missing locking cover ring.
Ordered new light. Received new light with cover. Retrieved unit.
Opened the light and manufacturer sent the light with the ring
LOCKED onto light which wasnt easy to twist and unlock but used
table vise with Allen wrenches in screw holes to hold in place
and twisted ring from light and installed on light in unit.

79897 1 LIGHT FELL OFF OFF DINING ARE CEILING
Light hanging down upon delivery
Screwed light back up. And tested

79897 2 WIRE LOOM IS STICK OUT OF BOTTOM OF SLIDE ROOM FLOOR
Wire loom sticking out under slideroom trim on the floor.
Removed trim. Zip tied some wires trying to hold them back.
Closed and open room. Didnt work. Removed trim again. So much wire
to try to hold back. Cut wire ties and straighten out 110. Wired
tie to wall. Put trim back. Closed and open room. Still showing
12v wires. Removed trim. Wired tied back 12v. Closed and open
room. Good

79897 3 BATTEN STRIP LOOSE OVER THE STOVE
Plastic trim loose on slideroom ceiling
Siliconed under trim and stuck back.

79897 4 STAPLE HOLES NEEDS FILLED IN SLIDE ROOM MISSING PUTTY

Claim : 79897

 WO # Job # Description JOB INFORMATION

Staples in ceiling missing putty
 Put white putty on where needed.

79897 6 THERE IS A LEAK FROM THE UNDERBELLY NEAR THE AREA OF THE DUMP
 VALVES.
 Water dripping by dumping valve.
 Removed spray foam around pipe. Cut back underbelly. Found leak
 on 4" pipe going to tank. Dumped tanks, let dry over night. Took
 black ABS cement and applied around 4" pipe. Let dry. Put more
 water in tanktocheckfor leaks,

 Part No Job# Description PARTS Qty Price Total

 F100664315 5 LIGHT 4.6" LED 12V SURF MOUNT WHI 1.00 5.77 5.77

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 5 MISC LABOUR CODE (EXTERNAL) 0.20 195.00 39.00
 Z990 5 MISC LABOUR CODE (EXTERNAL) 0.00 195.00 0.00
 Z990 5 MISC LABOUR CODE (EXTERNAL) 0.00 195.00 0.00
 Z990 1 MISC LABOUR CODE (EXTERNAL) 0.20 195.00 39.00
 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.00 195.00 0.00
 Z990 2 MISC LABOUR CODE (EXTERNAL) 1.00 195.00 195.00
 Z990 3 MISC LABOUR CODE (EXTERNAL) 0.10 195.00 19.50
 Z990 4 MISC LABOUR CODE (EXTERNAL) 0.10 195.00 19.50
 Z990 6 MISC LABOUR CODE (EXTERNAL) 0.55 195.00 107.25
 Z990 6 MISC LABOUR CODE (EXTERNAL) 0.65 195.00 126.75

 Excode Job# Description EXTRAS Qty Price Total

 FRT 5 FREIGHT 1.00 16.83 16.83

Parts Total: 5.77
 Labour Total: 546.00
 Sublet Total: 0.00
 Extras Total: 16.83

>>>> Claim Total: 568.60

Customer Signature: _____

Date: _____