



12024 Central Ave SE ★ Albuquerque NM 87123
www.MYERSRV.com
(505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 71968
Promised Date:
no add 26



WO #: 71968

Customer Name: 1000 - MYERS "RV"
CENTER, INC.

Completed Date: 10 APR 26

Invoice#:

Author: BRIAN

Stock Desc: 9568 2026 TRACER 275BH

Serial#: 526335

Chassis#: 5ZT2TRTB6TB526335

Miles/Hrs:

Tag#:

Purchased Date: 07 APR 26

Warranty Date: 04 APR 26

Date In: 07 JUL 25

Time In:

Job #2 - Warranty

COMPLAINT: Trailer doesnt sit level side to side

CAUSE: Springs are flat

Pass side sits about an inch and a half lower than the driver side.

CORRECTION: Remove and replace all four springs.

Springs sent no charge by manufacturer

Labor

Job #	Description	Total
2	UNIT NOT LEVEL	380.00
Subtotal for Job #2:		380.00

Job #3 - Warranty

COMPLAINT: Sealant exterior

CAUSE: Belt molding was not sealed underneath the passenger side rear compartment. The black tank flush had gaps in the silicone the city water connection also had gaps in the silicone.

CORRECTION: Cleaned the areas and sealed with clear silicone. Job completed.

Labor

Job #	Description	Total
3	EXTERIOR SEALANT	38.00

Parts

Part #	Description	Qty	Price	Total
40170	SILICONE TUBE-CLEAR	1.00	10.53	10.53
Subtotal for Job #3:				48.53

Job #4 - Warranty

COMPLAINT: Decal wrinkled, passenger side front

CAUSE: Wrinkled and pulling away from wall from the silicon at the front cap moulding.

CORRECTION: Scrape silicon from decal area on cap moulding, remove marker light, strip decal, clean wall, apply new decal, reinstall light, reseal front cap moulding.

Customer #: 1000
MYERS "RV" CENTER,
INC.,





Labor				
Job #	Description			Total
4	DECAL			95.00

Parts				
Part #	Description	Qty	Price	Total
F100734976	GRAPHIC, DC #3 TRACER 2026	1.00	20.84	20.84

Other Services				
Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	51.32	51.32

Subtotal for Job #4: 167.16

Job #5 - Warranty

COMPLAINT: Only have one compartment key

CAUSE: 2 keys for everything but compartments

CORRECTION: Order one global grey key G391

Labor				
Job #	Description			Total
5	KEY			0.00

Parts				
Part #	Description	Qty	Price	Total
90M18678A	KEY - GLOBAL FOR ENTRY DOOR/BAGGAGE (G391)	1.00	1.31	1.31

Subtotal for Job #5: 1.31

Job #6 - Warranty

COMPLAINT: Entry steps are crooked Rear

CAUSE: Stairs installed crooked

CORRECTION: Remove 7 screws, measure for proper alignment and reinstall screws. Test for proper alignment. Job completed.

Labor				
Job #	Description			Total
6	ENTRY STEPS			57.00

Subtotal for Job #6: 57.00

Job #7 - Warranty

COMPLAINT: Hole in slide out linoleum

CAUSE: The catch for the pantry door doesnt work and the pantry door opened in transit and ripped a hole in the linoleum on the slide out floor

CORRECTION: Sublet for attempted linoleum repair

Labor				
Job #	Description			Total
7	LINOLEUM			0.00

Sublet				
Description				Total
REPAIR LINOLEUM				200.00



Subtotal for Job #7: 200.00

Job #8 - Warranty

COMPLAINT: Pantry door latch

CAUSE: Catch on the door is broken.

CORRECTION: Remove old style latch, order and install new style latch.

Labor

Job #	Description	Total
8	PANTRY DOOR LATCH	38.00

Parts

Part #	Description	Qty	Price	Total
F100738338	SASH LOCK OB 336-OB	1.00	7.29	7.29

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	16.30	16.30

Subtotal for Job #8: 61.59

Job #9 - Warranty

COMPLAINT: Driver side, insert molding light

CAUSE: The insert light was not seated fully in the track

CORRECTION: I tried to just press the light into the track, but the light is held on by double sided tape. I had to peel the insert light out about 3 feet, remove the double-sided tape, clean the track and reinstall using new double-sided tape working from the bottom up to prevent any gaps. Job completed.

Labor

Job #	Description	Total
9	INSERT LIGHT	19.00

Subtotal for Job #9: 19.00

Job #10 - Warranty

COMPLAINT: Pantry door sag

CAUSE: The door latch broke, and when the door opened in transit, it didnt have the door jam to help to keep it from bouncing so the whole door was sagging and would no longer close properly

CORRECTION: I had to remove four pieces of batten trim, a small wall panel, the LP detector and the thermostat in order to access the interior of the wall. I used a wedge to prop the door up until its proper location, I then removed the five upper screws out of the tall hinge pre-drilled and used 3 1/2 inch wood screws to attach the two studs together. Then I pre-drilled a couple of pocket screws to reinforce the studs to the ceiling plate. The screws I used were not black so I had to paint those to match. Then had to pull a bunch of staples and nails from the walls and trim, reinstall the panels batten trims corner, trim, and fill all staple holes with putty. Job completed

Labor

Job #	Description	Total
10	PANTRY DOOR	380.00

Subtotal for Job #10: 380.00

Job #11 - Warranty

Glue on slide out ceiling

Labor

Job #	Description	Total
11	GLUE	0.00

W/O: 71968
Promised Date: 08 APR 26



Customer #: 1000
MYERS "RV" CENTER,
INC.,





Subtotal for Job #11: 0.00

Job #12 - Warranty

COMPLAINT: Silicone at kitchen countertop

CAUSE: Small section of countertop was not sealed

CORRECTION: Sealed countertop to the wall with white silicone. Job completed.

Labor

Job #	Description	Total
12	KITCHEN COUNTERTOP	38.00

Subtotal for Job #12: 38.00

Job #13 - Warranty

COMPLAINT: Touchup wood interior and fill staple holes

CAUSE: Staple holes throughout unit were not filled.

CORRECTION: Fill staple holes with putty, smooth out. Job completed.

Labor

Job #	Description	Total
13	TOUCH UP	95.00

Subtotal for Job #13: 95.00

Job #14 - Warranty

COMPLAINT: Screw holes and panel above the bed

CAUSE: It appears that the light has been installed, removed and reinstalled, but where it was reinstalled showed the first set of existing holes. There was also a gap between the light fixture and the cabinet ceiling panel.

CORRECTION: I remove the light cover remove the light fixture. I filled the holes with putty after scraping them down flush. I then send the light to try and cover as many of the existing holes as possible, reinstall the light with three screws and reinstalled the light cover. Tested the light everything is working as designed. Job completed.

Labor

Job #	Description	Total
14	SCREW HOLES	19.00

Subtotal for Job #14: 19.00

Job #15 - Warranty

COMPLAINT: Bedroom door is crooked

CAUSE: Bedroom door has a large gap at the bottom with no gap at the top while it is latched, making it hard to latch

CORRECTION: Remove the screws from the hinges in the center and bottom hinges relocate the hinges closer to the door jam reinstall door gap is not entirely closed at the bottom, but the door closes very easily. Job completed.

Labor

Job #	Description	Total
15	BEDROOM DOOR	38.00

Subtotal for Job #15: 38.00

Job #16 - Warranty

COMPLAINT: Table pole attachment on the underside of table is falling off





CAUSE: Screws stripped out.

CORRECTION: Remove table top, remove taleleg attachment, reclock so screws have fresh wood to be installed into, install 6 screws, test function, job completed.

Labor

Job #	Description	Total
16	TABLE	19.00

Subtotal for Job #16: 19.00

Job #17 - Warranty

COMPLAINT: Missing heater register at microwave

CAUSE: Missing

CORRECTION: Order and install

Labor

Job #	Description	Total
17	REGISTER	19.00

Parts

Part #	Description	Qty	Price	Total
30189044A	VENT, 4" ROTO VENT, BLACK - RV4BK	1.00	1.17	1.17

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	5.00	5.00

Subtotal for Job #17: 25.17

Job #18 - Warranty

COMPLAINT: Bamboo cutting board is stained from antifreeze

CAUSE: Antifreeze dripped from the faucet from the factory winterize

CORRECTION: Tried scrubbing the cutting board with dish soap, pic is after the wash and after drying. Order a new cutting board and place inside unit.

Labor

Job #	Description	Total
18	CUTTING BOARD	9.50

Parts

Part #	Description	Qty	Price	Total
F100521445	BAMBOO SINK COVER - 11.75" X 13.25"	1.00	23.97	23.97

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	16.73	16.73

Subtotal for Job #18: 50.20

Job #19 - Warranty

COMPLAINT: Cabinet door magnets are loose and out of adjustment throughout

CAUSE: Where the metal plates were attached to the cabinet doors three of them were misaligned either barely touching the magnet or the screw was the only part touching the magnet. Also, the screws stripped out of the magnet under the sink in the kitchen.

CORRECTION: I adjusted and tightened relocated magnets and plates to where they now function as they



should, total of four magnets

Labor		
Job #	Description	Total
19	CABINET DOORS	38.00
Subtotal for Job #19:		38.00

Job #20 - Warranty

COMPLAINT: Front AC fan doesnt spin

CAUSE: The squirrel cage was rubbing on the Styrofoam housing, not allowing it to spin freely

CORRECTION: I pulled the ceiling assembly down because I could hear the home didnt feel any air verified. The fan wasnt spinning, went on the roof. Had to remove 12 screws to get the shroud off the AC pull the Styrofoam housing found where it was rubbing, I moved the squirrel cage on the fan motor Out away from the Styrofoam about a half an inch for clearance. Reattach the squirrel cage put the star from housing back together spun the fan it now spins freely. Reinstall 12 screws on the shroud test unit. Job completed.

Labor		
Job #	Description	Total
20	FRONT AC	190.00
Subtotal for Job #20:		190.00

Job #21 - Warranty

COMPLAINT: Furnace does not turn on

CAUSE: The two wire thermostat wire that runs from the furnace up to the AC control board has no continuity in the white wire.

CORRECTION: I started by removing the outside cover to the furnace, I found that the wires were pulling hard on the control board and bending the terminals for the 12 V and the blower on the Control board. I remove the board I tested for Power tested the sale switch to make sure that wasnt stuck Everything on the furnace is good. I rewired the control board and reinstalled so that the wires have some slack in them. I took the thermostat off the wall to see if the thermostat was passing voltage when it calls for heat, it was. I pulled the ceiling assembly down for the air conditioner and checked continuity from the thermostat wires back to the AC control board to make sure that the wire that calls for heat was getting a signal back to the AC control board, again it was. I started testing continuity in the wires from the AC control board that go back to the furnace, and the white wire that comes from the control board that calls for heat was not getting a signal back to the furnace. A continuity test told me that the white wire in that two wire thermostat cable was broken somewhere. I disconnected the wires at the furnace. I jumped power everything came on. The thermostat wire from the AC to the furnace, needs to be rerun and reattached. in order to run this wire it goes from the ceiling assembly in the living room through the ceiling panels down the wall between the bathroom and the bunks and down to the furnace. I will probably have to pull the seam molding down in the living room, pull the ceiling panel partially down and pull the wall panel and the shelf behind the toilet in order to fish the wire down.

Repairs estimated to take 4 1/2 hours.

Labor		
Job #	Description	Total
21	FURNACE	855.00
Subtotal for Job #21:		855.00

Job #22 - Warranty

COMPLAINT: Failed LP drop test

CAUSE: Leaking at fitting under regulator

CORRECTION: Removed, cleaned, reapplied sealant, reattached and tested for leaks, none found. Performed another drop test, passed.

W/O: 71966
Promised Date: 08 APR 26



Customer #: 1000
MYERS "RV" CENTER,
INC.,



W/O: 71968
Promised Date: 08 APR 26



Customer #: 1000
MYERS "RV" CENTER,
INC.,



Labor		
Job #	Description	Total
22	LP SYSTEM	142.50
Subtotal for Job #22:		142.50

Job #PDI1 - Internal

COMPLAINT: PRE-PDI NEW TT - 3.0

CAUSE: 1003 SERVICE ADVISOR REQUESTED

CORRECTION: 1008 PDI COMPLETED

Labor				
Job #	Description			Total
PDI1	PDI TRAVEL TRAILER			N/C
Parts				
Part #	Description	Qty	Price	Total
1000	L.P. GAS	9.00	N/C	N/C
Other Services				
Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
Subtotal for Job #PDI1:				0.00

Job #WIN-STD - Internal

COMPLAINT: WINTERIZE STANDARD

CAUSE: Winter is coming

CORRECTION: Done

Labor				
Job #	Description			Total
WIN-STD	WINTERIZE RV - BASIC			N/C
Parts				
Part #	Description	Qty	Price	Total
21622	ANTIFREEZE	2.00	N/C	N/C
Subtotal for Job #WIN-STD:				0.00

Parts Total:	65.11
Labour Total:	2,470.00
Sublet Total:	200.00
Extras Total:	89.35
WORK ORDER TOTAL:	2,824.46

NOTICE:
DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.



Customer Signature : _____

Date: 10 Apr 2026

W/O: 71968
Promised Date: 08 APR 26



Customer #: 1000
MYERS "RV" CENTER,
INC.,



Customer Work
Order

