

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT # 0008794 MYERS RV CENTER INC 12024 CENTRAL AVE S.E. ALBUQUERQUE, NM 87123 USA	CLAIM STATUS Authorized CLAIM 2654967 CLAIM ORIGIN WEB ORIGINAL CLAIM ID VIN 5ZT2TRPB8TB526881 CHASSIS VIN MILEAGE 0 SITE/WAREHOUSE 048 / 048B ITEM # TRT248RE DEALER RO # 72837-1 CLAIM START DATE 04/27/2026 CLAIM END DATE 01/01/1900
--	---

Labor rate: \$190.00
 OWNER INFORMATION

Retail Date of Purchase WARRANTY EXPIRATION DATE

Claim Line Details

Labor

Line# 1 **Operation Code** 20-43-01-00-000589 **Operational Description** Die Cut, Stripe, Decal, Graphic - Exterior/Exterior Miscellaneous/Replace/No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-04-27 10:28:03 :: Complaint: Decals on the front are peeling Cause: Adhesive and/or improper surface prep during installation resulted in loss of adhesion Correction: Remove affected detail section and inspect surrounding area. Clean and prep surface to remove adhesive residue and contaminants. Installed new OEM replacement decal. Ensure proper alignment, adhesion and full contact with surface. Apply pressure and verify no lifting or air pockets. Inspect adjacent areas for additional adhesion concerns.

Model#	Dlr Sub Hrs 0.80	Sub Labor Amt \$152.00
Serial#	Appr Hrs 0.25	Appr Labor Amt \$47.50

Notes
 Excessive labor requested to replace the "R" graphic that is peeling. Reduced to a reasonable amount

Labor

Line# 2 **Operation Code** 30-92-01-00-001112 **Operational Description** Information Sticker or Decal - Interior/Interior Miscellaneous/Replace/No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-04-27 10:31:01 :: Complaint: Fresh water connection sticker is missing a section Cause: Failure of factory install. decal adhesive and/or material defect leading to premature peeling and tearing Correction: Remove damaged decal and clean surface to remove adhesive residue. Prep surface to ensure proper adhesion. Install new OEM replacement decal in correct location. Ensure proper alignment in full adhesion with no air gaps. Verify detail is secure and legible per manufacturer standards.

Model#	Dlr Sub Hrs 0.50	Sub Labor Amt \$95.00
Serial#	Appr Hrs 0.05	Appr Labor Amt \$9.50

Notes
 Excessive labor requested. Reduced to flat rate

Labor

Line# 3 **Operation Code** 20-739-01-00-000649 **Operational Description** Screen - Exterior/Power Roof Vent (Ventline/Dexter)/Replace/No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-04-27 10:33:43 :: Complaint: Rip in screen in bathroom ceiling vent Cause: Failure of factory installed screen material and/or improper tensioning during installation leading to premature tearing Correction: Remove interior trim and vent screen assy. Carefully detach damaged screen material. Install new replacement screen or complete screen assy. Ensure proper fitment of screen material. Reinstall trim components and secure to manufacturer specs. Inspect fan operation and verify screen is properly seated with no gaps.

Model#	Dlr Sub Hrs 0.50	Sub Labor Amt \$95.00
---------------	-------------------------	------------------------------

Line# 11 **Operation Code** **Operational Description**
 30-92-19-00-004336 Spot Seal Interior (Dealer) - Interior/Interior Miscellaneous/Reseal/No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-04-27 11:09:37 :: Complaint: Silicone on the top of bedroom door frame needs to be fixed Cause: Improper factory finishing and excessive sealant application resulting in substandard cosmetic appearance Correction: Clean and remove excessive silicone/sealant from affected area. Prep service for proper adhesion. Install matching wall covering trim/strip to conceal and restore finish. Ensure proper alignment of trim piece. Inspect surrounding area for consistency and proper appearance.

Model#	Dlr Sub Hrs	0.70	Sub Labor Amt	\$133.00
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$38.00

Notes
 Wrong code used.
 Reduced to a reasonable amount to clean off and reseal properly

Labor
Line# 12 **Operation Code** **Operational Description**
 60-139-01-00-001560 P-Trap - Plumbing/Kitchen (Galley) Sink/Replace/No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-04-27 11:13:04 :: Complaint: Kitchen sink is leaking Cause: Leak appears to be caused by improper seal and/or loose connection at factory install fitting/hose assy Correction: Remove and inspect drain assy connection and hose. Will need to reseal and properly secure fitting. Apply appropriate thread sealant or replace ceiling components as needed. Replace fitting/hose if defect is found. Reinstall and secure all connections to manufacturer specs. Pressure test system by running water and verifying no further leaks. Inspect surrounding area for additional leaks or damage.

Model#	Dlr Sub Hrs	1.50	Sub Labor Amt	\$285.00
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$38.00

Notes
 Wrong code used. Slnk is not leaking, the hepvo device appears to be leaking.

Excessive labor requested. Reduced to flat rate to tighten and confirm no leaks on hepvo device

Labor
Line# 13 **Operation Code** **Operational Description**
 60-140-12-00-001560 P-Trap - Plumbing/Bathroom (Lavatory) Sink/Resecure or Tighten/No Tread Code

Complaint, Cause, Correction
 Original Note : stephanie@dealer-advisors.com, 2026-04-27 11:16:32 :: Complaint: Under the vanity, the P-trap is leaking Cause: Leak determined to be caused by improper factory installation and/or compromised ceiling washer at p-trap connection resulting in loss of seal under normal operation Correction: Disassemble p-trap assy for detailed inspection. Inspect slip joint connections, trap body and ceiling washers. Cleaning and prepping all meeting surfaces. Replace defective washers and/or p-trap components as needed. Reinstall and properly align all plumbing connection. Torque slip joints to proper specs. Operate washer system and perform extended leak test to verify repair. Inspect surrounding area for secondary moisture or related concerns. 1.2-1.5 hours including diag time, assy, repair, reassembly and verification testing.

Model#	Dlr Sub Hrs	1.50	Sub Labor Amt	\$285.00
Serial#	Appr Hrs	0.10	Appr Labor Amt	\$19.00

Notes
 Excessive labor requested to remove and inspect for proper washers in p Trap. Reassemble and check for leaks

Submitted	Labor Amt	\$2,014.00	Approved	Labor Amt	\$484.50
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$2,014.00		Total	\$484.50

 DEALER DATE
 SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

 CUSTOMER DATE
 SIGNATURE

All repairs described have been inspected and are satisfactory.