

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 66241
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 27854 - JASON MILHEISER
Address: 9414 ASHWORTH DR EVANSVILLE, IN

47725

Phone: 812-480-0722

Stock Number: 11050 - 2022 FREEDOM EXPRESS 326BHDSLE 5ZT2FEYB2NW022384

VIN: 5ZT2FEYB2NW022384 HIN:

SER#: 5ZT2FEYB2NW022384

Mileage: 0

Work Order Comp: 21 JAN 22

Auth. No:

Dealer #:

Warr. Date: 15 JAN 22

Work Order Date: 04 JAN 22

Inv #: 372323

WO # Job # Description JOB INFORMATION

66241 1 2nd BATHROOM DOOR HITTING DOOR FRAME...NOTED AT DELIVERY
2ND BATHROOM DOOR HITTING DOOR FRAME.....NOTED AT DELIVERY.
Checked operation of rear bathroom door. Latch side of door
hitting door frame at top corner and at latch plate. Tightened
mounting screws in latch plate. Tightened all hinge mounting
screws. Door now closes without hitting door frame.

66241 2 FRONT TOILET TANK NOT READING ON MONITOR
FRONT TOILET TANK NOT READING ON MONITOR.
Front black holding tank is full and not reading on monitor
panel. Located area under rear black tank. Removed two screw
nails holding underbelly in place. Cut underbelly for access to
monitor wires. Found ground wire laying down on underbelly and
not connected to ground probe on tank. Screw is missing on
ground probe on tank. Could not find missing screw. Had to make
a small screw to fit. Had to cut another access hole below
ground probe location to get screw replace. Reattached ground
wire to ground probe. Checked monitor panel operation. Rear
black tank now reading full. Applied underbelly tape to both
access holes and replaced screw nails that were removed.

66241 3 SCREWS IN OUTSIDE KITCHEN DOOR ACCESS AT BOTTOM ARE LEAKING WATER
SCREWS IN OUTSIDE KITCHEN DOOR ACCESS AT BOTTOM ARE LEAKING
WATER.
Bottom screws securing outside kitchen door frame to opening were
pulled tightough frame. Removed all bottom mounting screws.

Claim : 66241

 WO # Job # Description JOB INFORMATION

Applied black silicone to holes. Reinstalled mounting screws.
 Covered screw heads with black silicone also.

Lab Code	Job#	Description	LABOUR	Hrs	Rate	Total
Z990	1	MISC LABOUR CODE (EXTERNAL)		0.30	150.00	45.00
Z990	2	MISC LABOUR CODE (EXTERNAL)		1.00	150.00	150.00
Z990	2	MISC LABOUR CODE (EXTERNAL)		0.00	150.00	0.00
Z990	3	MISC LABOUR CODE (EXTERNAL)		0.20	150.00	30.00

Parts Total: 0.00
 Labour Total: 225.00
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 225.00

Customer Signature: _____

Date: _____