

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville IN
US
47725
812-867-5200

WORK ORDER # 66260

Completed : 21 JAN 22
Licence # :
Stock No : 11068
Tag :
Author : BH
Location : 0201 CHECK PREAUTH Date Sched :
Serial# : 4YDFHMU2XNA741079
Warr. Date :
Print Date : 21 JAN 22
Customer : 1013 - KEYSTONE RV CO -
Invoice # :
Description : 2022 5W KEYSTONE MONTANA HIGH COUNT
Date In : 08 JAN 22 Mileage : 0
Promised :
Chassis# : 4YDFHMU2XNA741079
Cust PO# :

Job # Description JOB INFORMATION Type Bill To

PDIN COMPLAINT: PDI - NEW FIFTH WHEEL
CAUSE: PDINFW - PDI NEW FIFTH WHEEL. I PDI PRE-D
CORRECTION: Moved unit into shop from sales lot.
Purged and filled LP tanks. Checked all
exterior lights and brakes. Checked lug
nuts and set tire pressure at 110 psi,
including spare tire. Operated auto
leveling system. Checked power cord.
Checked converter output. Checked roof
and awning. Checked entrance doors and
all compartment doors. Checked all
interior lights. Checked all windows
and blinds. Checked all cabinets and
drawers. Checked all electrical outlets
and GFCI outlets. Checked all USB
outlets. Removed packing from all
appliances. Filled fresh water tank and
flushed antifreeze from all water lines
and faucets. Filled water heater and
purged all air from water lines and
faucets. Installed temporary Quick
connect on LP gas line. Performed LP
drop test and set LP pressure at 11
in.wc. Removed temp. quick connect from
LP gas line. Checked all connections
for leaks. Checked water heater on LP
and electric. Checked operation of TV
Antenna, TV, Radio and Fireplace.
Checked all appliances. Applied all
company decals. By-passed water heater.
Blew out all water lines and faucets.
Added antifreeze to all water lines and
faucets, including outside shower and
Washer/Dryer faucets. Poured antifreeze

Continued on page 2

Work Order : 66260

 Job # Description JOB INFORMATION Type Bill To

in all drain traps. Drained all holding
 tanks, including water heater. REcorded
 all model and serial numbers and took
 pictures. Moved back to sales lot.

1 COMPLAINT: BEDROOM DOOR WON'T LATCH CLOSED W 1013 KEYST
 CAUSE: BEDROOM DOOR WON'T LATCH CLOSED.
 CORRECTION: Bedroom door will not latch closed.
 Removed latch plate and remounted to
 accept door plunger. Checked operation
 several times. OK.

 Job # Part No Description PARTS Bill to Qty Price Total

 PDINF 06-0469 59853 LOW PRESSURE QUICK CONN I-PDI 1 41.99 41.99
 PDINF 24181 -50 RV ANTI-FREEZE GALLON I-PDI 3 4.99 14.97

 Job# Lab Code Description LABOUR Mech Bill to Hrs Rate Total

 DINFW Z991 PDI NEW FIFTH WHEEL (I DKM I-PDI 0.00 150.00 0.00
 DINFW Z991 PDI NEW FIFTH WHEEL (I DKM I-PDI 0.12 150.00 18.00
 DINFW Z991 PDI NEW FIFTH WHEEL (I DKM I-PDI 1.58 150.00 237.00
 DINFW Z991 PDI NEW FIFTH WHEEL (I DKM I-PDI 4.03 150.00 604.50
 DINFW Z991 PDI NEW FIFTH WHEEL (I DKM I-PDI 0.27 150.00 40.50
 DINFW Z991 PDI NEW FIFTH WHEEL (I DKM I-PDI 0.00 150.00 0.00
 1 Z990 MISCELLANEOUS REPAIR DKM W-1013 0.30 150.00 45.00

 Job # Excode Description EXTRAS bill to Qty Price Total

 DINFW SS SHOP SUPPLIES I-PDI 1.00 35.00 35.00
 DINFW LPGI LP - UNIT SALES I-PDI 12.00 3.99 47.88

CUSTOMER COMMENTS

 BH SENT IN PREAUTH

BILLINGS SUMMARY

 Type Bill Id Parts Labour Sublet Extras Tax Total

 I PDI 56.96 900.00 0.00 82.88 0.00 1,039.84
 W 1013 0.00 45.00 0.00 0.00 0.00 45.00
 Totals 56.96 945.00 0.00 82.88 0.00 1,084.84

Continued on page 3

Work Order : 66260