

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	1054928	CLAIM STATUS	Paid
LINK FORD & RV MINONG LLC		CLAIM	2633491
1025 W HOKAH ST		CLAIM ORIGIN	WEB
MINONG, WI 54859		ORIGINAL CLAIM ID	
USA		VIN	5ZT2LC9B8TG012140
		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$165.00	SITE/WAREHOUSE	015 / 015G
OWNER INFORMATION		ITEM #	LCT44PARK-15G
ANTHONY SCHILLING		DEALER RO #	40256
6618 S CTY RD B		CLAIM START DATE	04/07/2026
South Range, WI 54874		CLAIM END DATE	05/14/2026
USA			
Retail Date of Purchase	05/01/2026	WARRANTY EXPIRATION DATE	05/01/2027

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	30-100-24-00-001056	Backsplash - Interior/Cabinetry/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : alix@dealer-advisors.com, 2026-04-07 12:57:52 :: Complaint: Dealer states the back splash to left of stove is coming off wall. Cause: Cut too long along the top. Correction: Removed round trim from the top of the backsplash and the bottom trim from the overhead cabinet to gain access to the entire top of the backsplash section. Once trim and brad nails were removed, trimmed down the back splash and tested fit. Once fit was correct, applied new strip of adhesive tape to the back and refastened the trim pieces and resealed the corner of the backsplash and countertop.			
Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$82.50
Serial#	Appr Hrs	0.50	Appr Labor Amt	\$82.50
	Notes			
	NVCB .50 to cut the backsplash to the proper size and secure. Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. Dp.			

Part

Line# 1	Item #	Description		
	USERPART	Shop Supplies - adhesive tape, nails, sealant		
	Model #	Serial #	Part tag	
	Sub Qty	1.00	Sub Dlr Price	\$4.13
	Appr Qty	1.00	Appr Dlr Price	\$4.13
			Sub Freight	\$0.00
			Appr Freight	\$0.00
	Notes			

Labor

Line# 2	Operation Code	Operational Description		
	30-102-24-00-001101	Slide Out Fascia, each section - Interior/Panels, Ceilings, & Interior Moldings/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : alix@dealer-advisors.com, 2026-04-07 13:00:22 :: Complaint: Dealer stated fascia trim on front side of bed is loose. Cause: Trim was cut too long at factory. Correction: Removed trim piece and the upper corner plate, as the trim piece was fastened behind it with staples. Measured and cut down the trim piece to fit correctly. Fastened back in place and puttied the holes, reinstalled the corner plate.			
Model#	Dlr Sub Hrs	0.40	Sub Labor Amt	\$66.00
Serial#	Appr Hrs	0.40	Appr Labor Amt	\$66.00
	Notes			
	NVCB .40 to R&RI the slide out fascia to cut it down to the correct size. Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. Dp. Changed to the correct code. Dp.			

Part

Line# 1	Item #	Description			
	USERPART	Shop supplies - staples, putty			
	Model #	Serial #	Part tag		
	Sub Qty 1.00	Sub Dlr Price \$3.30	Sub Freight \$0.00		
	Appr Qty 1.00	Appr Dlr Price \$3.30	Appr Freight \$0.00		

Notes**Labor**

Line# 3	Operation Code	Operational Description
	30-102-01-00-001097	Seam Tape, per 8 ft. Strip - Interior/Panels, Ceilings, & Interior Moldings/Replace/ No Tread Code

Complaint, Cause, Correction

Original Note : alix@dealer-advisors.com, 2026-04-07 13:05:53 :: Complaint: Dealer states there is a glue streak next to seam tape above bedroom window. Cause: Excessive adhesive, possibly from lamination. Correction: Cleaned with adhesive remover. Additional Note : alix@dealer-advisors.com, 2026-04-07 13:06:16 :: No repair code.

Model#	Dlr Sub Hrs	0.20	Sub Labor Amt	\$33.00
Serial#	Appr Hrs	0.20	Appr Labor Amt	\$33.00

Notes

We will need pictures that can illustrate the issue described attached to this claim. Thank you Dp. Hello, you can see it in the photos provided. It is above the window, you can see what appear to look like "bubbles" but they were able to be wiped off with adhesive remover. I have requested more photos from the dealership - I did not mean to add that comment above, I thought I exited out. Dealership states they do not have any further photos, the tech cleaned it per the correction and these were the only photos they received. NVCB .20 to heat, smooth and remove the excess sealant. Repair only close code per dealer's description of this repair. This authorization is pending ALL requirements of repair code have been met. Dp

Part

Line# 1	Item #	Description			
	USERPART	shop supplies - adhesive remover			
	Model #	Serial #	Part tag		
	Sub Qty 1.00	Sub Dlr Price \$1.65	Sub Freight \$0.00		
	Appr Qty 1.00	Appr Dlr Price \$1.65	Appr Freight \$0.00		

Notes**Labor**

Line# 4	Operation Code	Operational Description
	30-101-01-00-001089	Closet Wardrobe Door Hardware Trim - Interior/Interior Doors/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : alix@dealer-advisors.com, 2026-04-07 13:07:07 :: Complaint: Dealer states left of bedroom closet, trim piece has a nick in it. Has red tape next to it from the manufacturer. Cause: Damage during install. Correction: Needs new trim piece.

Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$82.50
Serial#	Appr Hrs	0.50	Appr Labor Amt	\$82.50

Notes

NVCVB .50 to R&R the trim due to it being chipped. Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. Dp.

Part

Line# 1	Item #	Description			
	F100578285	MOLDING, MM CROWN 409P POPLAR 3/4 X 1-3/4 X 108, ANDOVER SABLE (UPPER CROWN)			
	Model #	Serial #	Part tag		
	Sub Qty 1.00	Sub Dlr Price \$22.28	Sub Freight \$109.56		
	Appr Qty 1.00	Appr Dlr Price \$22.28	Appr Freight \$109.56		

60-141-01-00-001575 Shower Faucet - Plumbing/Shower, Tub Surround/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : alix@dealer-advisors.com, 2026-04-07 13:15:59 :: Complaint: Dealer states the bunk bathroom shower drizzles water out of the shower head. Pressure still poor even with head removed. Cause: Debris in water system plugged faucet. Correction: Removed shower head to check for obstructions. Tested shower without head on. Water was coming out, but could tell the pump was rapidly pulsing. Pulled screws holding faucet plate on shower wall and removed shower faucet from water lines. Inspected the ports on the faucet for obstructions .Couldn't see anything but blew air from lungs through faucet backwards to push any unseen debris out. Reconnected faucet to water lines and tested. Water was flowing properly. Put shower head on and water was still flowing properly. Removed faucet and put plate back on, reconnected faucet to lines gain and mounted to shower wall. Did another test and then sealed the plate with caulk. Additional Note : alix@dealer-advisors.com, 2026-04-07 13:16:28 :: No repair code.

Model#	Dlr Sub Hrs	0.80	Sub Labor Amt	\$132.00
Serial#	Appr Hrs	0.80	Appr Labor Amt	\$132.00

Notes

NVCB .80 to remove the debris from the shopwer faucet. Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. Dp.

Part

Line# 1	Item #	Description		
	USERPART	shop supplies - caulk		
	Model #	Serial #	Part tag	
	Sub Qty	1.00	Sub Dlr Price	\$3.30
	Appr Qty	1.00	Appr Dlr Price	\$3.30
			Sub Freight	\$0.00
			Appr Freight	\$0.00

Notes

Labor

Line# 8	Operation Code	Operational Description		
	20-44-19-00-000553	Roof Moldings - Front or Rear - Exterior/Roof/Reseal/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : alix@dealer-advisors.com, 2026-04-07 13:17:24 :: Complaint: Dealer states roof needs sealant in several spots. Cause: Improper sealing from manufacturer. Correction: Resealed and reinspected.			

Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$49.50
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$49.50

Notes

NVCB .30 to use sealant to fill in and cover the seal voids on the entire roof membrane. Per dealers description of this repair. This authorization is pending ALL requirements of repair code have been met. Dp.

Part

Line# 1	Item #	Description		
	USERPART	0809.1088 - EPDM lap seal 11 oz tube wht		
	Model #	Serial #	Part tag	
	Sub Qty	1.00	Sub Dlr Price	\$8.83
	Appr Qty	1.00	Appr Dlr Price	\$8.83
			Sub Freight	\$0.00
			Appr Freight	\$0.00

Notes

Labor

Line# 9	Operation Code	Operational Description		
	60-142-24-00-003327	Faucet - Plumbing/Miscellaneous Plumbing/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : alix@dealer-advisors.com, 2026-04-07 13:19:04 :: Complaint: Dealer states the master bathroom faucet dripping even with both handles closed completely. Cause: Debris trapped in faucet cold water valve. Correction: Removed faucet from unit and inspected the ports for hot and cold. In the cold side at the valve there was a piece of debris. Managed to work out of faucet with a pick. Reconnected the water lines and tested.			

Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$82.50
Serial#	Appr Hrs	0.50	Appr Labor Amt	\$82.50

Notes

NVCB .50 to R&RI the faucet to remove the debris. Per dealers description of this repair. This

