

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	897380
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
		VIN	5ZT2CAYB5NX024402
EVANSVILLE, IN 47725		CHASSIS VIN	
USA		MILEAGE	0
		SITE/WAREHOUSE	205 / 205
Labor rate:	\$140.00	ITEM #	ACAT333RETSLE
OWNER INFORMATION		DEALER RO #	66311
DONALD H BRADLEY JR		CLAIM START DATE	01/14/2022
949 OSAGE DR		CLAIM END DATE	01/01/1900
Henderson, KY 42420			
USA			
Retail Date of Purchase	12/03/2021	WARRANTY EXPIRATION DATE	12/03/2022

Claim Line Details

Labor					
Line# 1	Operation Code	Operational Description			
	20-69-01-00-000703	Hold Back Latch, Catch, or Magnet - Exterior/Compartment Doors/ Replace/No Tread Code			
	Complaint, Cause, Correction				
	Original Note : bhoffman@americanrvcenter.com, 2022-01-14 12:33:05 :: HOLD BACK MISSING ON COMPARTMENT DOOR HOLD BACK MISSING ON COMPARTMENT DOOR. Installed compartment door hold back to replace missing part.				
	Model #	Dlr Sub Hrs	0.20	Sub Labor Amt	\$28.00
	Serial #	Appr Hrs	0.10	Appr Labor Amt	\$14.00
	Notes				
	EXCESSIVE AMOUNT REQUESTED. ADJUSTED TO FLAT RATE				
Labor					
Line# 2	Operation Code	Operational Description			
	20-55-01-11-000850	Awning LED Light Strip - Exterior/Awnings - Electrical (Carefree of Colorado)/Replace/Electrical			
	Complaint, Cause, Correction				
	Original Note : bhoffman@americanrvcenter.com, 2022-01-14 12:35:07 :: AWNING LIGHTS DON'T WORK Removed monitor panel. Checked for power to and from awning light switch. Both ok. Checked connections at awning light strip. Checked power connection. Power OK. Checked 4 pin connector to awning light strip. Can wiggle it and get lights to come "on". Infared "Y" adapted for awning lights needs replaced. 12/7/2021: Turned in parts request for a new part.				
	Model #	Dlr Sub Hrs	0.50	Sub Labor Amt	\$70.00
	Serial #	Appr Hrs	0.50	Appr Labor Amt	\$70.00
	Notes				
Labor					
Line# 3	Operation Code	Operational Description			
	10-9-15-00-000168	Polymax Underbelly - Frame & Chassis/Levelers, Underbelly/Repair or Replace/No Tread Code			
	Complaint, Cause, Correction				
	Original Note : bhoffman@americanrvcenter.com, 2022-01-14 12:37:11 :: OPEN HOLE UNDER BATHROOM SINK OPEN HOLE IN FLOOR UNDER BATHROOM SINK. Closed up hole from bottom with underbelly tape. Used spray foam to fill hose from top around fresh water tank fill hose.				
	Model #	Dlr Sub Hrs	0.60	Sub Labor Amt	\$84.00
	Serial #	Appr Hrs	0.50	Appr Labor Amt	\$70.00

Notes

EXCESSIVE AMOUNT REQUESTED

**Labor
Line# 4****Operation Code**

60-139-01-00-001557

Operational DescriptionSink Strainer Basket, Removable (each) - Plumbing/Kitchen (Galley)
Sink/Replace/No Tread Code**Complaint, Cause, Correction**Original Note : bhoffman@americanrvcenter.com, 2022-01-14 12:38:02 :: KITCHEN SINK BASKET MISSING
PART MISSING INSTALL NEW PART**Model #****Dlr Sub Hrs**

0.00

Sub Labor Amt \$0.00**Serial #****Appr Hrs**

0.00

Appr Labor Amt \$0.00**Notes****Labor
Line# 5****Operation Code**

20-58-01-00-000813

Operational DescriptionLower Radius Metal - Exterior/Metal, Aluminum Siding/Replace/No
Tread Code**Complaint, Cause, Correction**Original Note : bhoffman@americanrvcenter.com, 2022-01-14 12:39:11 :: OFF DOOR SIDE ON THE BOTTOM
BETWEEN THE TWO SLIDES LOOKS LIKE THE PANIT IS FADED NEED TO REPLACE THE METAL**Model #****Dlr Sub Hrs**

4.00

Sub Labor Amt \$560.00**Serial #****Appr Hrs**

1.50

Appr Labor Amt \$210.00**Notes**

EXCESSIVE AMOUNT REQUESTED. ADJUSTED TO TYPICAL REPAIR TIME FOR THIS REPAIR.

**Labor
Line# 6****Operation Code**

10-17-14-00-000296

Operational DescriptionRusty Welds - Frame & Chassis/Specialty, Utility Unit/Repaint/No Tread
Code**Complaint, Cause, Correction**Original Note : bhoffman@americanrvcenter.com, 2022-01-14 12:40:14 :: THE WELD NEAR THE SPARE TIRE
IT IS STARING TO RUST AD CRACK NEED TO BUFF OUT AND CLEAN WELD BACK AND PAINT IT**Model #****Dlr Sub Hrs**

0.50

Sub Labor Amt \$70.00**Serial #****Appr Hrs**

0.50

Appr Labor Amt \$70.00**Notes**

AUTHORIZED AS REQUESTED

**Labor
Line# 7****Operation Code**

20-55-01-11-000850

Operational DescriptionAwning LED Light Strip - Exterior/Awnings - Electrical (Carefree of
Colorado)/Replace/Electrical**Complaint, Cause, Correction**Original Note : bhoffman@americanrvcenter.com, 2022-01-14 12:44:28 :: AWNING LIGHTS DON'T WORK
INSTALLED THE Y CONNECTOR AND LIGHTS ARE THE SAME COLOR BUT WHEN MOVING THE CONNECTOR
THEY DO NOT WORK NEED TO REPLACE THE AWNING LIGHTS**Model #**

GZ168006EAR

Dlr Sub Hrs

1.20

Sub Labor Amt \$168.00**Serial #**

2149755445

Appr Hrs

0.50

Appr Labor Amt \$70.00**Notes**

EXCESSIVE AMOUNT REQUESTED

Submitted

Labor Amt \$980.00

Parts & Freight \$0.00

Total \$980.00

Approved

Labor Amt \$504.00

Parts & Freight \$0.00

Total \$504.00

**DEALER
SIGNATURE****DATE**

I certify that I have performed these repairs consistent with Forest

**CUSTOMER
SIGNATURE****DATE**

All repairs described have been inspected and are satisfactory.

