

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 12699B

Date In: 15 SEP 25 Author: MGRAY
Promised Date: 31 DEC 25 Stock No: 11455
: Year: 2026
Customer Name: 1000 - GREENEWAY RV SA Manufacturer: GRAND DESIGN
Address: 8220 STATE HWY 13 SOUT Brand: IMAGINE
: WISCONSIN RAPIDS, WI Model: 2300MK
Postal/Zip: 54494 Miles/Hrs: 0
Phone#(res): 800-758-2272 Exterior Color:
Phone#(bus): Unit Type: TT-TRAVEL TRAILER
Cell Phone: License#:
Email: NONE Tag#: DB: 9/19
Purchased Date: :
Delivery Date: :
InService Date: :
Serial#: 573TE2725T6656044 :

Job # Description JOB INFORMATION Type Bill To

WARR COMPLAINT: WARRANTY REPAIR 1 - DS front tires W 1020 GRAND
grease cap fell off and the cover for
center cap is missing
CAUSE: Mfg did not have grease cap on firmly
and it let loose during travel and it
caused inner cap to to pop out and now
it's missingJack up the unit removed
the front DS tire then installed a new
grease cap reinstalled tire. Please
order the small black cover with silver
emblem that clips into the center of the
black cap pic attached,
CORRECTION: REQUEST 1 HOUR OF LABOR
WARR COMPLAINT: WARRANTY REPAIR 2 - trim above the SLide W 1020 GRAND
is loose
CAUSE: Mfg improper install
CORRECTION: Pushed trim up and used pin nailer to
secure in proper position then puttied
the hole REQUEST .30 HOURS OF LABOR
WARR COMPLAINT: WARRANTY REPAIR 3 -the water pump needs W 1020 GRAND
to be adjusted
CAUSE: Mfg did not have water pump adjust high
enough for it to keep constant water
flow and pulsating and lights flickered
as well as it was pulsating
CORRECTION: Found water pump in front compartment
and adjusted for more pressure now it
operates without pulsating and no

Continued on page 2

Work Order : 12699B

```

*****
Job #   Description           JOB INFORMATION           Type Bill To
*****
                                flickering lights REQUEST .30 HOURS OF
                                LABOR
WARR    COMPLAINT:  WARRANTY REPAIR 4 -the roof has a couple W    1020    GRAND
                                of sealant gaps they need to be sealed
                                CAUSE:           Gaps in the roof sealant
                                CORRECTION:     Used left over dicor to seal the gaps
                                REQUEST .50 HOURS OF LABOR
WARR    COMPLAINT:  WARRANTY REPAIR 5 - toilet cap is           W    1020    GRAND
                                missing
                                CAUSE:           Mfg did not install the rear seat cover
                                cap Please order a complete new toilet
                                seat only need the round cap but will
                                most likely have to order the seat pics
                                of model and serial attached
                                CORRECTION:     ..... REQUEST .40 HOURS OF LABOR
WARR    COMPLAINT:  WARRANTY REPAIR 6 -interior speaker           W    1020    GRAND
                                seems like it's blown
                                CAUSE:           The mfg left sawdust in the speaker
                                CORRECTION:     Removed speaker checked wire all good
                                then shook speaker and sawdust fell out
                                retested sounds normal then teinstalled
                                I to ceiling and tested and it sounds as
                                it should REQUEST .40 HOURS OF LABOR
WARR    COMPLAINT:  WARRANTY REPAIR 8 - the exterior water       W    1020    GRAND
                                heater door looks bent
                                CAUSE:           Looks bent from mfg hard to notice but f
                                on the side can see like a dent wrinkle
                                Please order new black water heater door
                                for Suburban instantaneous water heater
                                pic taken of door needed
                                CORRECTION:     ..... REQUEST .20 HOURS OF LABOR
WARR    COMPLAINT:  WARRANTY REPAIR 9 - scratch in the front W    1020    GRAND
                                door above the dark grey decal door
                                closest to front of unit
                                CAUSE:           Scratched from mfg
                                CORRECTION:     I AM NOTING SO IF FUTURE CUSTOMER
                                NOTICES THIS IT HAS BEEN DOCUMENTED
*****

```

```

*****
Job#  Lab Code  Description  LABOUR  Mech Bill to  Hrs  Rate  Total
*****
ARR01 Z992     MISC LABOUR CODE (WARR HOD W-1020  0.50  140.00  70.00
ARR02 Z992     MISC LABOUR CODE (WARR HOD W-1020  0.50  140.00  70.00
ARR03 Z992     MISC LABOUR CODE (WARR HOD W-1020  0.50  140.00  70.00
ARR04 Z992     MISC LABOUR CODE (WARR HOD W-1020  0.50  140.00  70.00
ARR05 Z992     MISC LABOUR CODE (WARR HOD W-1020  0.50  140.00  70.00
ARR06 Z992     MISC LABOUR CODE (WARR HOD W-1020  0.50  140.00  70.00
ARR08 Z992     MISC LABOUR CODE (WARR HOD W-1020  0.50  140.00  70.00
ARR09 Z992     MISC LABOUR CODE (WARR HOD W-1020  0.50  140.00  70.00
*****

```

Continued on page 3

Work Order : 12699B

```
*****
Job #  Excode   Description  EXTRAS      bill to    Qty   Price   Total
*****
ARR01  SSE        SHOP SUPPLIES - EXTERNAL  W-1020    1.00   0.00    0.00
*****
```

BILLINGS SUMMARY

```
*****
Type Bill Id      Parts    Labour    Sublet    Extras    Tax    Total
*****
W      1020          0.00    560.00    0.00     0.00    0.00    560.00
      Totals          0.00    560.00    0.00     0.00    0.00    560.00
*****
```

&k2S
&k0S