

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 66627
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 1000 - BASDEN'S AMERICAN RV
Address: 600 E. BASELINE RD. EVANSVILLE, IN
USA
47725

Phone:

Stock Number: 11089 - 2022 CATALINA 293QBCKLE 5ZT2CAUB0NX025558

VIN: 5ZT2CAUB0NX025558 HIN:

SER#: 5ZT2CAUB0NX025558

Mileage: 0

Work Order Comp: 10 MAR 22

Auth. No:

Dealer #:

Warr. Date:

Work Order Date: 28 FEB 22

Inv #: 373728

WO # Job # Description JOB INFORMATION

66627 4 OUTSIDE TV CONNECTION DOES NOT PICK UP CHANNELS
OUTSIDE TV CONNECTION DOES NOT PICK UP CHANNELS.
Outside TV antenna connection does not pickup channels. Removed
booster from wall. Checkec all coax on back of booster. Outside
connector on door side is labeled Cable/Satellite, but should be
for TV outlet. Outside connector on roadside is for
Cable/Satellite, but is for TV outlet. All Connections on back
of booster are connected to wrong coax. Switched all coax
connections to correct locations. Could not get splitter pulled
out of wall. Added another splitter to send TV Channels to
doorside outside connector. Booster hole in wall was cut too big
by factory and screws are on edge of hole and not holding booster
in place. Cut and installed backing plates to hold booster to
wall. Checked operation of outside TV. Now picking up channels.

66627 1 BUNKHOUSE DOOR OFF TRACK (NOD)
BUNKHOUSE DOOR OFF TRACK (NOD)
Rollers came loose from top of door. Replaced roller in top door
socket. Adjusted rollers.

66627 2 LP LINE CLAIM BROKEN
LP LINE CLAMP BROKEN.
Screw that holds LP line clamp broken off. Removed broken screw
that holds clamp to frame. Remounted LP line clamp with new
screw.

Claim : 66627

 WO # Job # Description JOB INFORMATION

66627 3 BOTTOM DRAWER - KITCHEN CAB WILL NOT STAY IN TRACK
 BOTTOM DRAWER - KITCHEN CABINET WILL NOT STAY IN TRACK.
 Checked alinement of tracks. Rear track mounting board only has
 (1) screw in it allowing board to rock. Straightened board and
 added another scew to keep from rocking. Tracks are not
 parallel. Added washer spacers at front of tracks to make
 parallel. Checked operation of drawer. Drawer now opens and
 closes ok.

66627 5 OUTSIDE GRILL LP HOSE TOO SHORT TO REACH LP HOOK UP
 OUTSIDE GRILL LP HOSE TOO SHORT TO REACH LP HOOK UP.
 Outside grille hose about 1 inch too short to plug in to Lp
 supply line. Removed LP line junction block mounting screws in
 frame. Relocated junction block about 6 inches forward on
 frame. Drilled new mounting holes and secured to frame.
 Supported LP line with original hose clamp. Checked operation of
 outside grille. OK.

66627 6 TOP 2 DRAWERS UNDER KITCHEN SINK WONT STAY CLOSED
 TOP 2 DRAWERS UNDER KITCHEN SINK WON'T STAY CLOSED.
 Checked operation of both drawers. Drawers will not stay closed.
 Adjusted tracks. Added another screw to back supports to hold
 tracks straight.

 Part No Job# Description PARTS Qty Price Total

24-1050 4 TV Cable Splitter; Inline Coaxial 1.00 5.61 5.61

 Lab Code Job# Description LABOUR Hrs Rate Total

Z990 4 MISC LABOUR CODE (EXTERNAL) 0.00 150.00 0.00
 Z990 4 MISC LABOUR CODE (EXTERNAL) 0.50 150.00 75.00
 Z990 1 MISC LABOUR CODE (EXTERNAL) 0.40 150.00 60.00
 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.30 150.00 45.00
 Z990 3 MISC LABOUR CODE (EXTERNAL) 0.30 150.00 45.00
 Z990 5 MISC LABOUR CODE (EXTERNAL) 0.30 150.00 45.00
 Z990 6 MISC LABOUR CODE (EXTERNAL) 0.40 150.00 60.00

Parts Total: 5.61
 Labour Total: 330.00
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 335.61

Customer Signature: _____

Date: _____