

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville IN
US
47725
812-867-5200

WORK ORDER # 66627

Completed : 10 MAR 22 Customer : 10024 - FOREST RIVER TRAVEL TRAILER
Licence # : Invoice # :
Stock No : 11089 Description : 2022 TT COACHMEN CATALINA 293QBCKLE
Tag : Date In : 28 FEB 22 Mileage :
Author : DH Promised : 31 MAR 22
Location : 0311 CHECK PREAUTH Date Sched :
Serial# : 5ZT2CAUB0NX025558 Chassis# : 5ZT2CAUB0NX025558
Warr. Date : Cust PO# :
Print Date : 10 MAR 22

Job # Description JOB INFORMATION Type Bill To

PDIN COMPLAINT: PDI - NEW TRAVEL TRAILER I PDI PRE-D

CAUSE: PDINTT - PDI NEW TRAVEL TRAILER.
CORRECTION: Moved unit into shop from sales lot.
Purged and filled LP tanks. Checked all
exterior lights and brakes. Checked lug
nuts and set tire pressure at 65 psi.
Operated all stab jacks. Checked
entrance door and all compartment doors.
Checked roof and awning awning.
Checked power cord. Checked all
interior lights. Checked converter
output. Checked all electrical outlets
and GFCI outlets. Checked all USB
outlets. Checked all windows and
blinds. Checked all cabinets and
drawers. Added water to fresh water
tank. Flushed antifreeze from all water
lines and faucets. Checked all water
lines and faucets for leaks. Filled
water heater and purged air from system.
Performed LP drop test and LP pressure
at 11 in.wc. Operated all appliances.
Filled all holding tanks and checked
monitor panel. Applied all company
decals. Moved unit back to sales lot.

WINT COMPLAINT: WINTERIZE UNIT AND DRAIN HOLDING TANKS. I PDI PRE-D

INCLUDES 2 GALLONS OF ANTI-FREEZE
UNITS WITH WASHING MACHINE OR ICEMAKER
WILL BE EXTRA **DE-WINTERIZATION IS NOT
INCLUDED**

CAUSE: WINTER - WINTERIZE UNIT AND DRAIN
HOLDING TANKS.

CORRECTION: By-passed water heater. Blew out all
water lines and faucets. Added

Work Order : 66627

```

*****
Job #   Description                JOB INFORMATION                Type Bill To
*****
antifreeze to all water lines and
faucets, including outside shower and
outside spray port. Poured antifreeze
in all drain traps. Drained all holding
tanks, including water heater.
1  COMPLAINT: BUNKHOUSE DOOR OFF TRACK (NOD)                W      10024  FORES
   CAUSE:     BUNKHOUSE DOOR OFF TRACK (NOD)
   CORRECTION: Rollers came loose from top of door.
                Replaced roller in top door socket.
                Adjusted rollers.
2  COMPLAINT: LP LINE CLAIM BROKEN                W      10024  FORES
   CAUSE:     LP LINE CLAMP BROKEN.
   CORRECTION: Screw that holds LP line clamp broken
                off. Removed broken screw that holds
                clamp to frame. Remounted LP line clamp
                with new screw.
3  COMPLAINT: BOTTOM DRAWER - KITCHEN CAB WILL NOT        W      10024  FORES
   CAUSE:     BOTTOM DRAWER - KITCHEN CABINET WILL NOT
                STAY IN TRACK.
   CORRECTION: Checked alinement of tracks. Rear track
                mounting board only has (1) screw in it
                allowing board to rock. Straightened
                board and added another scew to keep
                from rocking. Tracks are not parallel.
                Added washer spacers at front of tracks
                to make parallel. Checked operation of
                drawer. Drawer now opens and closes ok.
4  COMPLAINT: OUTSIDE TV CONNECTION DOES NOT PICK UP    W      10024  FORES
   CAUSE:     CHANNELS
                OUTSIDE TV CONNECTION DOES NOT PICK UP
                CHANNELS.
   CORRECTION: Outside TV antenna connection does not
                pickup channels. Removed booster from
                wall. Checkec all coax on back of
                booster. Outside connector on door side
                is labeled Cable/Satellite, but should
                be for TV outlet. Outside connector on
                roadside is for Cable/Satellite, but is
                for TV outlet. All Connections on back
                of booster are connected to wrong coax.
                Switched all coax connections to correct
                locations. Could not get splitter
                pulled out of wall. Added another
                splitter to send TV Channels to doorside
                outside connector. Booster hole in wall
                was cut too big by factory and screws
                are on edge of hole and not holding
                booster in place. Cut and installed

```

Continued on page 3

Work Order : 66627

backing plates to hold booster to wall.
Checked operation of outside TV. Now
picking up channels.

5 COMPLAINT: OUTSIDE GRILL LP HOSE TOO SHORT TO REACH W 10024 FORES
LP HOOK UP

CAUSE: OUTSIDE GRILL LP HOSE TOO SHORT TO REACH
LP HOOK UP.

CORRECTION: Outside grille hose about 1 inch too
short to plug in to Lp supply line.
Removed LP line junction block mounting
screws in frame. Relocated junction
block about 6 inches forward on frame.
Drilled new mounting holes and secured
to frame. Supported LP line with
original hose clamp. Checked operation
of outside grille. OK.

6 COMPLAINT: TOP 2 DRAWERS UNDER KITCHEN SINK WONT W 10024 FORES
STAY CLOSED

CAUSE: TOP 2 DRAWERS UNDER KITCHEN SINK WON'T
STAY CLOSED.

CORRECTION: Checked operation of both drawers.
Drawers will not stay closed. Adjusted
tracks. Added another screw to back
supports to hold tracks straight.

Job #	Part No	Description	PARTS	Bill to	Qty	Price	Total
PDINT	13034	55362 STD BATTERY		I-PDI	1	10.95	10.95
WINTE	24181	-50 RV ANTI-FREEZE		I-PDI	2	4.49	8.98
4	24-1050	TV Cable Splitter; Inline Coa	W-10024		1	5.61	5.61

Job#	Lab Code	Description	LABOUR	Mech	Bill to	Hrs	Rate	Total
DINTT	Z991	MISC LABOUR CODE (INTE DKM		I-PDI		0.50	150.00	75.00
DINTT	Z991	MISC LABOUR CODE (INTE DKM		I-PDI		0.84	150.00	126.00
DINTT	Z991	MISC LABOUR CODE (INTE DKM		I-PDI		4.06	150.00	609.00
DINTT	Z991	MISC LABOUR CODE (INTE DKM		I-PDI		0.40	150.00	60.00
DINTT	Z991	MISC LABOUR CODE (INTE DKM		I-PDI		0.20	150.00	30.00
INTER	Z990	WINTERIZE UNIT		DKM		1.00	130.00	130.00
1	Z990	MISC LABOUR CODE (EXTE DKM		W-10024		0.40	150.00	60.00
2	Z990	MISC LABOUR CODE (EXTE DKM		W-10024		0.30	150.00	45.00
3	Z990	MISC LABOUR CODE (EXTE DKM		W-10024		0.30	150.00	45.00
4	Z990	MISC LABOUR CODE (EXTE DKM		W-10024		0.00	150.00	0.00
4	Z990	MISC LABOUR CODE (EXTE DKM		W-10024		0.50	150.00	75.00
5	Z990	MISC LABOUR CODE (EXTE DKM		W-10024		0.30	150.00	45.00
6	Z990	MISC LABOUR CODE (EXTE DKM		W-10024		0.40	150.00	60.00

Continued on page 4

Work Order : 66627

```

*****
Job #  Excode   Description  EXTRAS      bill to      Qty      Price      Total
*****
DINTT  SS       SHOP SUPPLIES          I-PDI       1.00     35.00     35.00
DINTT  LP20     20 LB. LP CYLINDER    I-PDI       2.00     14.00     28.00
INTER  SS       SHOP SUPPLIES          I-PDI       1.00      9.70      9.70

```

 CUSTOMER COMMENTS

BH SENT IN PREAUTH

```

*****
                                BILLINGS SUMMARY
Type Bill Id      Parts      Labour      Sublet      Extras      Tax      Total
*****
I    PDI          19.93     1030.00     0.00       72.70      0.00     1,122.63
W    10024         5.61      330.00     0.00        0.00      0.00       335.61

Totals          25.54     1360.00     0.00       72.70      0.00     1,458.24

```