

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 80629
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 13515 - CURTIS HARMS
Address: 212 LOREN DR GRAYVILLE, IL

62844

Phone: 812-291-0336

Stock Number: 11795 - 2027 CHEROKEE 301BH 4X4TCKF22VX169423

VIN: 4X4TCKF22VX169423 HIN: SER#: 4X4TCKF22VX169423

Mileage: 0 Work Order Comp: 17 JUL 26

Auth. No: Dealer #:

Warr. Date: 25 JUN 26 Work Order Date: 16 JUL 26 Inv #: 432830

WO # Job # Description JOB INFORMATION

80629 1 WE LOOKED AT UNIT EARLIER THIS MONTH ON 80535 AND REPAIRED WIRING
CONNECTIONS AT THE CONTROL BOARD
Hard reset
Plugged in the shore power then went inside. Went to the touch
screen, turn the AC on and had a notification for thermostat and
AC control board not communicating. Pull-down the filter from the
A.C and check the connections for the thermostat wires.
Disconnected the quick connections and put on a more firm wire
connector. Had to remove the microwave to get to the main control
board. Check the connections at the back of the touchscreen and
the control board for the whole system. Clear the code on the
touch screen for the a c. After a few seconds the code would
reappear. Disconnected the shore power the battery and seven way
from the vehicle. After about three minutes connected the battery
and shore cord and the seven way back to the vehicle. The link 2
reset than powed on the A.C thru the touchscreen. AC has been
running for 20 minutes without a code appearing on the touch
screen. Put the microwave back in the cabinet screwed back to
place. Took pictures of the process.

80629 2 THE WINDOW SEAL IS COMING OUT NEAR THE SLIDE ROOM
Slide room not center
Ran the slider out , put the sail back in the exterior part of
the window. Add a screws to hold the bulb seal back to the
exterior part of the body. Trimmed the bulb seal with geocel.
Check the side to side measurements and the window side was to

Claim : 80629

 WO # Job # Description JOB INFORMATION

tight to the window and pulling out the window seal. Loosen the bolts on the bottom of the slideroom and push the slideroom towards the rear and ran the slideroom in and out and then tightened the bolts. Now the is more room for the window seal not to catch the bulb seal.

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 1 MISC LABOUR CODE (EXTERNAL) 0.50 195.00 97.50
 Z990 2 MISC LABOUR CODE (EXTERNAL) 1.00 195.00 195.00

 Excode Job# Description EXTRAS Qty Price Total

 SS 1 SHOP SUPPLIES 1.00 0.00 0.00

Parts Total: 0.00
 Labour Total: 292.50
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 292.50

Customer Signature: _____

Date: _____