

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 66685
MANUFACTURER'S CLAIM #:

Manufacturer: 52215 - ALLIANCE RV, LLC
Customer: 1000 - BASDEN'S AMERICAN RV
Address: 600 E. BASELINE RD. EVANSVILLE, IN
USA
47725

Phone:

Stock Number: 11187 - 2022 VALOR 40V13 7M5FV4536NA005786
VIN: 7M5FV4536NA005786 HIN: SER#: 7M5FV4536NA005786
Mileage: 0 Work Order Comp: 08 APR 22
Auth. No: Dealer #:
Warr. Date: Work Order Date: 07 MAR 22 Inv #: 375100

WO # Job # Description JOB INFORMATION

66685 5 BED ROOM SLIDE WILL NOT GO OUT
BEDROOM SLIDE WILL NOT GO OUT.
Checked operation of slide. Not going out on motor side.
Istaleed test cable to check operation. Same thing. Removed
motor. found a rusty mounting screw. Removed cap covering
circuit board. Water inside cap and corrosion on circuit board.
Big gap at top of bulb seal allowing water to get inside motor
and camper. Sealed gap with clear sealer. Motor needs replaced.
Installed new motor. Checked operation of slideout with new
motor. Operates as it should going out and in. FOUND MOTOR HAD
WATER ON TOP BOARD AND IT HAD CORROSION SO WE INSTALLED NEW
BOARD AND IT IS WORKING NOW.

66685 8 L H CABINET DOOR BELOW THE KITCHEN SINK CRACKED
L H CABINET DOOR BELOW KITCHEN SINK CRACKED.
LH cabinet door below kitchen sink cracked on back side by top
hinge. Measured door, took pictures and turned in parts reques.
REMOVE DOOR. DRILLED NEW HOLES FOR HARDWARE IN DOOR AND MOUNT
BACK

66685 1 THE LP HOLDER RIVET BROKEN
THE LP HOLDER RIVET BROKEN.
The rivets on LP tank strap latch broke off. Drilled out broken
rivets. Remounted latch with new rivets

66685 2 FRONT COMP DOOR LOCK CAME APART

Claim : 66685

```

*****
WO #      Job #      Description      JOB INFORMATION
*****
FRONT COMPARTMENT DOOR LOCK CAME APART. (NOD).
Reassembled front compartment door lock and adjusted to lock and
unlock.

66685      4      ELEC RECEPTIAL IN FRONT BEDROOM HOT AND NUET REVERSED
ELECTRICAL OUTLET IN FRONT BEDROOM HOT AND NUETRAL REVERSED.
Checked outlet with a polarity checked. Shows hot and nueutral
reversed. Removed outlet from wall. Removed back of receptical.
Wire were on wrong side. Hot and nueutral reversed. Switched
wires. Replaced back of receptical. Remounted in wall. Checked
again with tester. Now ok.

66685      6      CEILING TRIM IN TOY HAULER AREA LOOSE DOORSIDE
CEILING TRIM IN TOY HAULER AREA LOOSE -DOORSIDE.
Ceiling trim above upper bunk loose and hanging down. Reattached
ceiling trim with brad nails. Filled holes with matching putty.

66685      7      REAR BED CONTROLLER CAME LOOSE FROM THE WALL
REAR BED CONTROLLER CAME LOOSE FROM THE WALL.
Cover for rear bed controller came loose from wall and controller
and all wires fell out. Replaced controller and wires back in
cover. Reattached cover to wall.

```

```

*****
Part No      Job#      Description      PARTS      Qty      Price      Total
*****
LIP236575      5      IN-WALL MOTOR - LI      1.00      273.15      273.15
90M13170A      5      RECALL - SEALANT,      1.00      15.03      15.03
15048          8      DOOR - CAB - 14.75      1.00      28.99      28.99

```

```

*****
Lab Code      Job#      Description      LABOUR      Hrs      Rate      Total
*****
Z990          5      MISC LABOUR CODE (EXTERNAL)      1.00      150.00      150.00
Z990          5      MISC LABOUR CODE (EXTERNAL)      1.00      150.00      150.00
Z990          8      MISC LABOUR CODE (EXTERNAL)      0.00      150.00      0.00
Z990          8      MISC LABOUR CODE (EXTERNAL)      0.10      150.00      15.00
Z990          8      MISC LABOUR CODE (EXTERNAL)      0.10      150.00      15.00
Z990          1      MISC LABOUR CODE (EXTERNAL)      0.30      150.00      45.00
Z990          2      MISC LABOUR CODE (EXTERNAL)      0.20      150.00      30.00
Z990          4      MISC LABOUR CODE (EXTERNAL)      0.50      150.00      75.00
Z990          6      MISC LABOUR CODE (EXTERNAL)      0.20      150.00      30.00
Z990          6      MISC LABOUR CODE (EXTERNAL)      0.00      150.00      0.00
Z990          7      MISC LABOUR CODE (EXTERNAL)      0.30      150.00      45.00

```

```

*****
Excode      Job#      Description      EXTRAS      Qty      Price      Total
*****
FRT          8      UPS-CAB DOOR      1.00      13.22      13.22

```

Claim : 66685

Excode	Job#	Description	EXTRAS	Qty	Price	Total
--------	------	-------------	--------	-----	-------	-------

Parts Total:	317.17
Labour Total:	555.00
Sublet Total:	0.00
Extras Total:	13.22
>>>> Claim Total:	885.39

Customer Signature: _____

Date: _____