

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville IN
US
47725
812-867-5200

WORK ORDER # 66731

Completed : 18 MAR 22 Customer : 10024 - FOREST RIVER TRAVEL TRAILER
Licence # : Invoice # :
Stock No : 10740 Description : 2022 TT COACHMEN FREEDOM EXPRESS 32
Tag : Date In : 11 MAR 22 Mileage : 0
Author : DH Promised :
Location : 0319 CHECK PREAUTH Date Sched :
Serial# : 5ZT2FEXB5NW023319 Chassis# : 5ZT2FEXB5NW023319
Warr. Date : Cust PO# :
Print Date : 18 MAR 22

Job # Description JOB INFORMATION Type Bill To

PDIN COMPLAINT: PDI - NEW TRAVEL TRAILER I PDI PRE-D
CAUSE: PDINTT - PDI NEW TRAVEL TRAILER.
CORRECTION: Moved unit into shop from sales lot.
Installed new battery box. Filled LP tanks. Checked all exterior lights and brakes. Checked lug nuts and set tire pressure at 80 psi. Checked roof and awning. Operated electric stab jacks. Checked entrance door and all compartment doors. Checked power cord. Checked all interior lights. Checked converter output. Checked all windows and blinds. Checked all cabinets and drawers. Checked all electrical outlets and GFCI outlets. Checked all USB outlets. Removed packaging from all appliances. Filled fresh water tank. Flushed antifreeze from all water lines and faucets. Checked all water lines and faucets for leaks. Opened by-pass on water heater and filled. Purged all air from water lines. Operater all appliances. Performed LP drop test and set LP pressure at 11 in.wc. Filled all holding tanks and checked monitor panel. Checked Radio and Fireplace. Checked Living room TV. Checked all other TV Antenna locations with test TV. Applied all company decals. Recorded all serial numbers and took pictures. Moved unit back to sales lot.
WINT WINTERIZE UNIT AND DRAIN HOLDING TANKS. ***INCLUDES I PDI PRE-D
2 GALLONS OF ANTI-FREEZE*** UNITS WITH WASHING
MACHINE OR ICEMAKER WILL BE EXTRA

Continued on page 2

Work Order : 66731

 Job # Description JOB INFORMATION Type Bill To

DE-WINTERIZATION IS NOT INCLUDED

1 COMPLAINT: OUTSIDE GRILLE WILL NOT CONNECT TO LP W 10024 FORES
 LINE
 CAUSE: OUTSIDE GRILLE WILL NOT CONNECT TO LP
 LINE.
 CORRECTION: Outside grille has a plared fitting in
 LP valve. It Does not have a fitting to
 connect to Quick connect LP hose.
 Removed flared fitting and installed a
 quick connect fitting.

 Job # Part No Description PARTS Bill to Qty Price Total

 PDINT 13034 55362 STD BATTERY I-PDI 1 10.95 10.95
 WINTE 24181 -50 RV ANTI-FREEZE I-PDI 2 4.49 8.98
 1 06-0473 59903 1/4" MPT MAL W-10024 1 10.82 10.82

 Job# Lab Code Description LABOUR Mech Bill to Hrs Rate Total

 DINTT Z991 MISC LABOUR CODE (INTE DKM I-PDI 0.00 150.00 0.00
 DINTT Z991 MISC LABOUR CODE (INTE DKM I-PDI 1.11 150.00 166.50
 DINTT Z991 MISC LABOUR CODE (INTE DKM I-PDI 4.06 150.00 609.00
 DINTT Z991 MISC LABOUR CODE (INTE DKM I-PDI 0.83 150.00 124.50
 INTER Z990 WINTERIZE UNIT DKM I-PDI 1.00 130.00 130.00
 1 Z990 MISC LABOUR CODE (EXTE DKM W-10024 0.30 150.00 45.00

 Job # Excode Description EXTRAS bill to Qty Price Total

 DINTT SS SHOP SUPPLIES I-PDI 1.00 35.00 35.00
 DINTT LPGI LP - UNIT SALES I-PDI 8.00 3.99 31.92
 INTER SS SHOP SUPPLIES I-PDI 1.00 9.70 9.70

 CUSTOMER COMMENTS

BH SENT IN PREAUTH

 BILLINGS SUMMARY

Type	Bill Id	Parts	Labour	Sublet	Extras	Tax	Total
I	PDI	19.93	1030.00	0.00	76.62	0.00	1,126.55
W	10024	10.82	45.00	0.00	0.00	0.00	55.82
Totals		30.75	1075.00	0.00	76.62	0.00	1,182.37

Continued on page 3

Work Order : 66731