



12024 Central Ave SE ★ Albuquerque NM 87123
www.MYERSRV.com
(505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 73070
Promised Date:
40 JUN 26



WO #: 73070 (Appointment Date: 21 MAR 2026 - Time: 10:15am)

Customer Name: 60239 - RAMOS,
RAMON

Completed Date: 25 JUN 26

Invoice#:

Author: BRIAN

Stock Desc: 9554 2026 AVENGER
26DBS

Serial#: 5ZT2AVRB3TB940730

Chassis#: 5ZT2AVRB3TB940730

Miles/Hrs:

Tag#: 7132

Purchased Date: 03 JUL 25

Warranty Date: 03 JUL 25

Date In: 21 MAR 26

Time In:

Job #0 - Warranty

CLAIMS: 2556225 / 2635206

Subtotal for Job #0: 0.00

Job #1 - Warranty

COMPLAINT: CUSTOMER STATES REPAIR CARPET ON SLIDE (REFERENCE: 71948)

CAUSE: Rip in carpet

CORRECTION: Started this job by removing the cushions from the dinette, removing the access covers for the under the bench storing. Remove the table by lifting it off of the legs remove both legs. Remove the panel from the back of the bench for the dinette on both sides. Unscrewed each of the benches, removing several doesnts screws, lifting the bench and setting it aside from each side of the dinette table. Leg post supports from the floor for the dinette table, removing over a dozen screws. Went to the couch, lifted the base of the couch upwards removed two screws from each side, picking up the couch and setting it aside removed nearly a dozen screws to remove the couch base, lifting it out of the way and setting aside removed the facia from all the way around the entire slide, both sides and the top. Remove the slide stops from each side of the slide room. The escape full access to the entire piece of carpet. Remove the paneling from both ends of the slide room, removing the window, retaining ring, removing the blind and the cover or Trim, removed and pulled all staples and nails from both walls from all the facia from all the trim that was removed. Went along the edge of the floor plate cutting the carpet cut the carpet along the paneling on the backside or the long side. Rolled up and remove the damaged carpet. Got the new carpet out of the tube, laid it out in the shop on top of a large piece of cardboard laid the new piece out completely, so it would lay flat laid the old piece on top of the new piece, got it perfectly, squared and set on the new piece marked it all the way around and cut the new piece to fit took the new piece inside, laid it on the floor beginning on the rear of the slide, tucked the new carpet underneath the edge of the floor plate work my way down the long side of the wall, tucking it in underneath the paneling all the way to the front side the carpet was trimmed as needed as I moved from one end to the other, ensuring that the carpet light flat once the carpet was completely tucked under the floor plates in the paneling, using a crown, staple gun stapled the carpet down along the floor plates and along the paneling all the way around the entire room. We began putting all trim back on where it came off from the side of the couch and behind the couch, I put the bat along the floor. Reinstalled the paneling on both ends of the slide room, reinstall the retaining ring for the window, the window blind, and the top trim piece, but the set screws in place for the tension of the blind adjusted the blind appropriately. Reinstalled all batten trim around the paneling that was removed. Reinstalled the slide stops on both ends of the slide room cut a new top facia for the slide room and installed put the side facia back on each end of the slide room, along with the corner, trim pieces, reinstall the base for the couch and reinstall the couch. Reinstalled both benches for the dinette staple the back paneling back in place reinstalled the base for the table, post puttied all nail holes and staples in the paneling and trim throughout

Customer #: 60239
RAMOS, RAMON



the slide room, but the access doors back on the bench for each side of the dinette, but the cushions back in place reinstalled the cushions this job is now complete

Labor

Job #	Description	Total
1	REPLACE FLOOR	1,520.00

Parts

Part #	Description	Qty	Price	Total
F100741170	FLOORING, WOVEN 45" X 156" STAB, 25RBS	1.00	32.26	32.26

Sublet

Description	Total
TEMP REPAIR	175.00

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	21.23	21.23

Subtotal for Job #1: 1,748.49

Job #1A - Warranty

SUBLET ALLOWANCE ADMIN

Other Services

Code	Description	Qty	Price	Total
EST	SUBLET ADMIN	1.00	47.50	47.50

Subtotal for Job #1A: 47.50

Job #2 - Internal

COMPLAINT: CUSTOMER STATES WATER PUMP WILL WORK THEN STOP WORKING - LIKE IT'S OVERHEATING. WHEN THEY FILLED THE FRESH WATER TANK AND TURNED PUMP ON IT CAME OUT THRU THE CITY WATER FILL INLET

CAUSE: Customer complaint water not working correctly

CORRECTION: Filled fresh tank with to full

Checked the city water connection found the washer with screen cone facing in which was pressing the back flow preventer

Turned the washer screen to the proper position

Ran water through all facets for over 5 minutes straight water pump never shut dow or stopped working , no water was coming out of the city water connection

Water pump is work as it should no water coming out of the city connector

Work complete

Filled fresh tank full

Opened low point drain

Pumped the tank empty pump did not get hot or blow a fuse

Work complete

Labor

Job #	Description	Total
2	WATER PUMP DIAGNOSE	N/C

Subtotal for Job #2: 0.00

Job #3 - Warranty

COMPLAINT: JOB ADDED: CUSTOMER STATES THERE IS A GAUGE ON THE BATHROOM SHELF UNDER THE MIRROR

CAUSE: Large gouge in cabinet face at the shelf

CORRECTION: Need to replace the cabinet face
19 x 30

W/O: 73070
Promised Date: 10 JUN 26



Customer #: 60239
RAMOS, RAMON



WARRANTY DENIED
LEAVE AS IS

Labor

Job #	Description	Total
3	CABINET EDGE	0.00

Subtotal for Job #3: 0.00

Job #4 - Internal

COMPLAINT: JOB ADDED: CUSTOMER STATES SCREWS ON THE BEDROOM WINDOW VALANCE - WINDOW TO THE LEFT WHEN STANDING AT FOOT OF BED - HAVE PULLED OUT

CAUSE: Screws pulled out

CORRECTION: Removed loose screws replaced them with larger screws. Now secure
Work complete.

Labor

Job #	Description	Total
4	VALANCE	N/C

Subtotal for Job #4: 0.00

Job #5 - Internal

COMPLAINT: JOB ADDED: CUSTOMER STATES THE SCREEN FRAME - WHEN STANDING AT THE FOOT OF BED TO THE LEFT CAME OFF

CAUSE: Screen came off

CORRECTION: Clipped screen back in place
Work complete Requesting .10

Labor

Job #	Description	Total
5	WINDOW SCREEN INSTALL	N/C

Subtotal for Job #5: 0.00

Job #6 - Internal

COMPLAINT: JOB ADDED: CUSTOMER STATES INSIDE THE FREEZER THE SCREWS ON BOTH SIDES ARE OXIDIZED

CAUSE: Screws have rust were not caped

CORRECTION: Put the plastic caps over the screws
Nothing can be done to prevent rust from forming on the screws it is a moist environment placing the caps over the screws keeps the screws from being visible.
Work completed. Requesting .10

Labor

Job #	Description	Total
6	REFER	N/C

Parts

Part #	Description	Qty	Price	Total
F100766390	REFER PART: SCREW CAP ONLY	6.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	N/C	N/C

Subtotal for Job #6: 0.00

W/O: 73070
Promised Date: 10 JUN 26



Customer #: 60239
RAMOS, RAMON





Job #7 - Warranty

COMPLAINT: JOB ADDED: CUSTOMER STATES AT THE BOTTOM BUNK LEFT WALL THER SCREW HOLE AND THE TRIM IS COMING OFF

CAUSE: Large screw hole in the wall

CORRECTION: Recommend replacement of panel screw hole not repairable

Will need full sheet of panel

Will need 3 batten trims

Will require the removal of both bunk beds

Removal of he damaged panel

Cut the new sheet of panel to fit and install

Reinstall both bunk beds

Request 8 hours

Remove bunkbed cushions removed plywood base.

Removed all batten around the wall panel that needed to be replaced.

Removed plastic jam, trim the edge of the bed and the decorator trim at the foot of each of the bunk bed.

Unscrewed the bunkbeds from the wall, removed the return vent for the furnace underneath the bottom

bunk loosen the entire panel pulled the panel out

Trimmed the support wood for the lower bunk so the new panel would slide in easily

Cut the new cut the new panel to fit back in the space. Slid the panel in space staple the panel in place

reinstalled all batten trim and put it all new button trim nail holes reattach bunkbeds to the wall. Put the base

panel back in place put the cushions back in place reinstall the trend trim pieces..

Reinstalled the plastic and cap trim work is now complete

Labor

Job #	Description	Total
7	PANEL VTRIM - INTERIOR	617.50

Parts

Part #	Description	Qty	Price	Total
F100802065	PANEL, SEAPINE MOONSHINE 5/32 X 48 X 96	1.00	45.60	45.60

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	701.29	701.29

Subtotal for Job #7: 1,364.39

Job #8 - Warranty

COMPLAINT: JOB ADDED: CUSTOMER STATES THE BOTTOM BUNK AT FOOT OF BED THE CHARGER IS NOT WORKING

CAUSE: USB charging port plug not working

CORRECTION: Tested the port no power

Removed port from the wall tested the power at the wire nuts did have correct voltage

Recommend replacement of the plug

Removed USB port from the wall disconnected the power from the USB port reconnected the power to the

new USB port with crimp wire nuts tested the new USB port did show that it was working correctly reinstall

the USB port to the wall job is now complete

Labor

Job #	Description	Total
8	CHARGING PORT	38.00

Parts

Part #	Description	Qty	Price	Total
F100668615	BLACK DUAL A CHARGER, USB 2.4 AMP	1.00	4.00	4.00



Subtotal for Job #8: 42.00

Job #9 - Internal

COMPLAINT: JOB ADDED: CUSTOMER STATES KITCHEN BLIND BY THE DINETTE TABLE WILL NOT STAY UP

CAUSE: Loose adjustment cords

CORRECTION: Adjusted the tension on the adjustment cords. Blind will now stay up.
Completed Requesting .10

Labor

Job #	Description	Total
9	BLIND ADJUST	N/C

Subtotal for Job #9: 0.00

Job #10 - Warranty

COMPLAINT: JOB ADDED: CUSTOMER STATES PANTRY LATCH NOT LOCKING

CAUSE: Latch is broken

CORRECTION: Pantry door latch is broken keeping it from fully locking and is misaligned
Need to order new latch and align it properly
Hold for parts
Request .5 time
New latch did not arrive. Check the existing latch from the spring disconnected behind. However, the mechanism for the actual watch is broken reset the screen to give it a little bit more tension in order for the door not to come open while in transit put a wedge underneath the door to prevent the door from from opening completely and ripping the carpet and or damaging the top slide facia a second time. Job will be on hold for parts.
Per Brian installed a candy cane lock at the top of the pantry door
In Oder for the lock to operate smoothly the base on the wall had to be shimmed with a piece of batten behind it
The other lock is still on order

Labor

Job #	Description	Total
10	CABINET LATCH ADJUST	38.00

Parts

Part #	Description	Qty	Price	Total
F100722596	HIDDEN PANTRY PULL, SASH LOCK, BLACK 24"	1.00	7.73	7.73

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	43.03	43.03

Subtotal for Job #10: 88.76

Job #10A - Internal

INSTALL 2ND LATCH FOR PANTRY DOOR

Labor

Job #	Description	Total
10A	LATCH	N/C

Parts

Part #	Description	Qty	Price	Total
19008	NICKEL SLIDING DOOR LATCH 2-1/2"	1.00	N/C	N/C

W/O: 73070
Promised Date: 10 JUN 26



Customer #: 60239
RAMOS, RAMON



Subtotal for Job #10A: 0.00

Job #11 - Warranty

COMPLAINT: JOB ADDED: CUSTOMER STATES SINCE PANTRY LATCH NOT WORKING IT CAUSED DAMAGE TO THE SLIDE FACIA

CAUSE: Large gouge in top facia

CORRECTION: Received wrong facia wrong color wrong length

Need to reorder facia

5 1/2 inches wide 154 inches long

Remove the upper facia insured all nails and staples have been removed. Took the measurement of the old facia 154 inches. Cut the new facia and install the new facia reinstalled the corner pieces work is now complete.

Labor

Job #	Description	Total
11	SLIDE OUT FASCIA	95.00

Parts

Part #	Description	Qty	Price	Total
F100766940	STILE 3/8 X 5-1/2 X 169 - IZZY GRANITE	1.00	19.94	19.94

Subtotal for Job #11: 114.94

Job #12 - Warranty

COMPLAINT: JOB ADDED: CUSTOMER STATES THE TRIM AROUND THE TABLE BOOTH HAS COME OFF - THE TRIM IS ON THE TABLE

CAUSE: Plastic u shaped trim pulled off base of dinette bench

CORRECTION: Recommend replacement

Trim was folded and creased will need to be replaced

14 inches long 3/4 inch wide

Cut new plastic trim to size. Using clear silicone glue the new plastic trim in place work is now complete.

Labor

Job #	Description	Total
12	PANEL V TRIM	19.00

Parts

Part #	Description	Qty	Price	Total
F100151111	U-CHANNEL 3/4" X 8' - AB BLACK	2.00	1.61	3.22

Subtotal for Job #12: 22.22

Job #13 - Internal

COMPLAINT: JOB ADDED: CUSTOMER REQUEST CHECK FUSES UNDER FRIDGE - SAYS THE FUSES KEEP BLOWING SHUTTING OFF FRIDGE - THEY NEED TO KEEP REPLACING THEM

CAUSE: Customer complaint blowing fuses for refrigerator when turning refrigerator off

CORRECTION: Turned refrigerator on and off several times on shore power didnt blow a fuse

Unplugged shore power turned refrigerator on and off while just on battery power several times didnt blow a fuse

Could not replicate Requesting .15

Labor

Job #	Description	Total
13	REFRIGERATOR DIAGNOSTIC TIME	N/C

W/O: 73070
Promised Date: 10 JUN 26

 


Customer #: 60239
RAMOS, RAMON

 


Subtotal for Job #13: 0.00

W/O: 73070
Promised Date: 10 JUN 26



Customer #: 60239
RAMOS, RAMON



Job #14 - Warranty

COMPLAINT: JOB ADDED: CUSTOMER STATES WHEN EXITING THE UNIT - DOOR FRAME ON LEFT SIDE IS MISSING THE BUTTON

CAUSE: Screw cap for trim above the entry door missing

CORRECTION: INSTALLED

Labor

Job #	Description	Total
14	BUTTON / DOOR	0.00

Parts

Part #	Description	Qty	Price	Total
30I42215A	BUTTON COVER	1.00	0.04	0.04

Subtotal for Job #14: 0.04

Job #15 - Warranty

COMPLAINT: JOB ADDED: CUSTOMER STATES THE POCKET DOOR TO BEDROOM IS DAMAGED DUE TO THE BUTTON MISSING ON THE EXIT DOOR

CAUSE: Door damaged when it was not latched

CORRECTION: Recommend replacement of the barn door

30 x 74

Request 1 hour

Will have to remove the trim from in front of the door

Will have to install all hardware on the new door

And install the door

WARRANTY DENIED

LEAVE AS IS

Labor

Job #	Description	Total
15	POCKET DOOR / BEDROOM	0.00

Subtotal for Job #15: 0.00

Job #16 - Internal

COMPLAINT: JOB ADDED: CUSTOMER STATES THE FRONT PASS. LIGHT STRIP IS DAMAGED AND DOES NOT WORK

CAUSE: Light strip and rail damaged

Light strip has a cut

Rail is bent

CORRECTION: Recommend replacement of the light strip and rail

Over length 10 feet

Light strip fits inside rail like vinyl insert

He fail is corner molding and is curved

Requesting 2 hours to replace

Will have to remove the corner mold and light disconnect wiring

Clean off all old sealant

Prep new corner molding and install

Install new light and connect wiring and test

Parts of not arrived when this work order was dispatched this job will be on hold for parts

New light strips arrived. Both front light strips had to be replaced so that the colors would be matching.

Remove the passenger side light strip first cut the electric wires underneath the unit pull the light strip off.

Straighten the damage rail as best that it could be straightened. Install the new light strip starting from the bottom all the way through the top. Put a set screw in the bottom to prevent the light strip from falling down reconnected the electric with butt slices.



Remove the driver side light strip, cut the electric wires on the bottom installed the new light strip, but a set screw on the bottom for prevent it from slipping down reconnected the electric turn the light switch on to test. The lights lights were correctly and theyre both the same color job is complete.

Labor		
Job #	Description	Total
16	LIGHT STRIP	N/C
Subtotal for Job #16:		0.00

Job #17 - Warranty

COMPLAINT: JOB ADDED: CUSTOMER STATES THE FRONT LIGHT STRIP ON DRIVERS SIDE IS HANGING DOWN

CAUSE: Light strip slipped down in the track

CORRECTION: Pushed the light back in place

Used a pair of Pilars and crimped the end to prevent the light from slipping down again

Work complete Requesting .15

Labor		
Job #	Description	Total
17	LIGHT STRIP	19.00

Parts				
Part #	Description	Qty	Price	Total
F100787505	LIGHT, COB 108" UNDERMOUNT SMOKE 30% 9W/M 6500 WHITE 10" LEAD	2.00	95.72	191.44

Other Services				
Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	451.38	451.38

Subtotal for Job #17: 661.82

Job #18 - Internal

COMPLAINT: CUSTOMER STATES PART ON ORDER FOR WINDOW ON PASS. SIDE TO THE LEFT OF THE ENTRY DOOR - REE KNEW ABOUT THIS

CAUSE: Screws all the bay through the frame

CORRECTION: Unscrewed the window blind

Unscrewed the retainer ring inside the unit. Removed the window from the outside, Un-boxed the new window and cleaned all styrofoam off the window

Set the new window in place. Attached the retainer ring from the inside.

Straightened the blind from being screwed to the wall. Drilled the holes in the blind so that it would bend again

Reattached the window blind to the wall

Tested the window for operation

Work complete. Requesting 1.5

Labor		
Job #	Description	Total
18	MISC LABOUR CODE (WARRANTY)	N/C
Subtotal for Job #18:		0.00

Job #19 - Warranty

COMPLAINT: JOB ADDED: THE CUSHIONS AT THE TABLE ARE COMING UNRAVELED

CAUSE: Fabric coming apart

CORRECTION: Recommend replacement both seat cushions

23 x 40 1/2

W/O: 73070
Promised Date: 10 JUN 26



Customer #: 60239
RAMOS, RAMON



See photos

Labor

Job #	Description	Total
19	DINETTE CUSHIONS	0.00

Parts

Part #	Description	Qty	Price	Total
F100707738	CUSHIONS, 40" DINETTE BOOTH, TEAGAN ONYX, MARIAH STONE T700	1.00	208.58	208.58

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	170.32	170.32

Subtotal for Job #19: 378.90

Job #20 - Internal

COMPLAINT: PLEASE CHECK TO MAKE SURE A/C WORKS AS IT SHOULD

CAUSE: Check ac for proper functions

CORRECTION: Plugged unit in

Turned ac on

Allowed ac to run with probes

Ac is working very well see photos of probe temps

Labor

Job #	Description	Total
20	AIR CONDITIONER CHECK	N/C

Subtotal for Job #20: 0.00

Job #NOTE - External

CUSTOMER STATES UNIT IS NOT WINTERIZED

Subtotal for Job #NOTE: 0.00

Parts Total: 512.81

Labour Total: 2,346.50

Sublet Total: 175.00

Extras Total: 1,434.75

WORK ORDER TOTAL: 4,469.06

NOTICE:

DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Customer Signature : _____

Date: 26 Jun 2026

W/O: 73070
Promised Date: 10 JUN 26



Customer #: 60239
RAMOS, RAMON

