



12024 Central Ave SE ★ Albuquerque NM 87123
www.MYERSRV.com
(505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 73627
Promised Date:
06 JUN 26



WO #: 73627

Customer Name: 54085 - FLETCHER,
SASHA MICHELLE

Completed Date: 09 JUL 26

Invoice#:

Author: BRIAN

Stock Desc: 9575 2026 SANIBEL

38LAUNDRY

Serial#: 5ZT3SN3B7TG706104

Chassis#: 5ZT3SN3B7TG706104

Miles/Hrs:

Tag#: 7251

Purchased Date: 26 MAR 26

Warranty Date: 26 MAR 26

Date In: 26 JUN 26

Time In:

Job #1 - Warranty

COMPLAINT: LINOLEUM BUBBLED AT WALL IN BEDROOM

CAUSE: Wall separating and linoleum bubbling

CORRECTION: Found a bubble in the linoleum in the master bedroom between the entry door wall and the bed. Closer examination found past the bubble going towards the slide out that the linoleum appears to be cut short and floor material visible. Looking at the wall, the wall appears to have a wave in it where it is straight in the area where the linoleum looks like it was cut short and it bows outward

Pressing on the wall of the base, the wall has a lot of flexibility in this area and with very little pressure can see past the floor edge, as if theres no base plate to support the paneling or the wall in this area.

In order to repair both linoleum and the wall, the floor batten strip must be removed. The wall panel in its entirety has to be removed in examination to determine if there is a base plate or not in this particular area and make the repair. If there is no base plate, a base plate will have to be cut put in place squared to the room. While the paneling is off and the batten strip is off where the bubble is for the linoleum, the linoleum can be cut allowed to life flat adhesive put along this edge in order to hold it in place then the paneling can be reinstalled and the batten reinstalled. Any new staple and nail holes puttied

Total time requested for this job will be 4 hours.

Remove the baseboard batten strip, pressing on the base of the wall, found that the wall connecting the laundry room to the upper front bedroom was not attached to the floor. Therefore, the flexing in the wall allowed the bat and the wall panel to hook the edge of the linoleum and push it back, causing the bubbling and gapping and the linoleum.

Removed the trim from both sides of on the top removed the barn door remove the barn door rail from the ceiling remove along the wall at the ceiling on the wall, separating the two panels remove the inside corner mole at the head of the bed. Remove the 120 V wall plug remove the USB charger from the wall removed the entire sheet of paneling.

Found the wall studs were not attached to the floor for the upper bedroom and one of the base plates for the paneling was cut about five or 6 inches too short and not attached to anything giving the wall a lot of movement

Was able to screw the wall steps to the floor cut a new one by four and put it in place of the one by four that was cut short make sure the floor was clean underneath. The linoleum lay the linoleum back down even with the floors edge reattach the wall panel with the pneumatic, staple gun. Reattach the batten strip along the edge of the ceiling with a Brad nailer reattach the batten strip along the floor with a Brad nailer the inside corner mold was reattached with a Brad nailer, and the wall panel scene button was reattached for the Brad nailer all old and new nail holes, staple holes or puttied and cleaned, reattach the barn door rail to the ceiling re-hung the barn door, reattach the trim pieces on both sides to the ceiling seal the edge of the floor between the linoleum and the batten strip with clear silicone. The wall is now secure does not flex or move. This job is complete.

Customer #: 54085
FLETCHER, SASHA
MICHELLE



Labor

Job #	Description	Total
1	FLOOR REPAIR	475.00

Subtotal for Job #1: 475.00

Parts Total: 0.00

Labour Total: 475.00

Sublet Total: 0.00

Extras Total: 0.00

WORK ORDER TOTAL: 475.00

NOTICE:

DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Customer Signature : _____

Date: 09 Jul 2026

W/O: 73627
Promised Date: 26 JUN 26



Customer #: 54085
FLETCHER, SASHA
MICHELLE

