



Phone: (423) 235-1167  
Toll Free: (877) 635-1167  
Fax: (423) 235-1176

1202 Idell Road  
Bulls Gap, TN 37711

W/O: 27329



WO #: 27329 (Appointment Date: 17 JUN 2026 - Time: 10:00am)

Customer: 93440 - SWIFT, COURTNEY  
Address: 305 PLEasant HILL RD  
CHUCKEY, TN  
37641

Home Phone: (423) 426-3276

Work Phone:

Author:SPD

Location: IH

Invoice #:

Stock #:  
Stock Desc: 2025 TT KEYSTONE  
Model:  
Serial #: 4YDTRNG11SD460002  
Chassis #:  
Mileage:  
Key #:  
Req'n #: 62831  
License #:  
Trim: 15RB

Purchase Date:  
Date In: 17 JUN 26  
Promise Date:  
Promise Time:  
Schedule Date:  
Completed: 30 JUN 26  
Warr. Date:

### Job #1 - Warranty

COMPLAINT: CUSTOMER STATES HALF THE LIGHTS ARE NOT WORKING IN HALF THE CAMPER -  
PLEASE CHECK AND ADVISE

CAUSE: CEILING LIGHTS IN LIVING AREA,KITCHEN AND HOOD FAN ARE INOP.FOUND A 15 AMP  
FUSE BLOWN, REPLACED IT AND IT BLEW IMMEDIATELY.REMOVE SWITCH PANEL TO GAIN  
ACCESS TO BACK SIDE OF FUSE BOX, INSPECTED WIRING AND LOOKS GOOD. USING METER  
VERIFIED SHORT TO GROUND AND LIGHTING CIRCUIT. TECH REMOVED LOADS 1 AT A TIME  
WHILE TESTING TO GROUND CIRCUIT IS STILL GROUNDED WITH ALL LOADS REMOVED AND  
SWITCH REMOVED FROM CIRCUIT. THIS INDICATES A SHORT IN WIRING THROUGH WALL AND  
UNDERBELLY USING ALTERNATE 12 VDC SOURCE. TESTED LIGHTS LIGHTS ON ALTERNATE  
SOURCE ARE WORKING.

CORRECTION: WILL NEED TO RUN A NEW 12 VDC SUPPLY FROM FUSE PANEL TO SWITCH PANEL  
IN ORDER TO PROPELRY CORRECT CONCERN.

LABOR 4.0

### Labor

| Job # | Description                      | Hours | Total  |
|-------|----------------------------------|-------|--------|
| 1     | RAN NEW 12 VDC SUPPLY AND TESTED | 4.00  | 700.00 |

### Parts

| Part # | Description | Qty  | Price | Total |
|--------|-------------|------|-------|-------|
| 10181  | WIRING      | 6.00 | 0.85  | 5.10  |

### Other Services

| Code | Description            | Qty  | Price | Total |
|------|------------------------|------|-------|-------|
| SSE  | SHOP SUPPLIES EXTERNAL | 1.00 | 5.99  | 5.99  |

**Subtotal for Job #1: 711.09**

### Job #2 - External

DEWIN

**Subtotal for Job #2: 0.00**

### Job #ROOFINS - Warranty

COMPLAINT: COMPLEMENTARY ROOF INSPECTION

CHECK CAULKING\_\_\_\_\_

CHECK SKYLIGHTS\_\_\_\_\_

CHECK ROOF VENTS\_\_\_\_\_

CHECK LUBE & ANTENNA\_\_\_\_\_

CHECK SATELLITE\_\_\_\_\_

CHECK RUBBER\_\_\_\_\_

Customer #: 93440  
SWIFT, COURTNEY



CAUSE: SEALS ARE OPEN AND NOT IN GOOD SHAPE. THERE IS A LOT OF PLACES THAT WILL ALLOW WATER AND MOISTURE IN.

CORRECTION: SEALANT AROUND COMPONENTS AND FRONT CAP NEED TO STRIPPED, AREA CLEANED AND NEW SEALANT LAID DOWN TO CORRECT THE ISSUES  
LABOR 4.0

KEYSTONE APPROVED TO GOODWILL .50

**Parts**

| Part #  | Description         | Qty  | Price | Total |
|---------|---------------------|------|-------|-------|
| 38-1870 | PROFLEX SEALANT WHT | 2.00 | 11.86 | 23.72 |

**Subtotal for Job #ROOFINS: 23.72**

Parts Total: 28.82  
Labour Total: 700.00  
Sublet Total: 0.00  
Extras Total: 5.99

**WORK ORDER TOTAL: 734.81**

I HEREBY ACCEPT ABOVE DESCRIBED WORK AS SATISFACTORY & COMPLETE TO MY SATISFACTION.

X

MOTOR VEHICLE REPAIR REGISTRATION #MV-04967

Customer Signature : \_\_\_\_\_

Date: 30 Jun 2026

Customer #: 93440  
SWIFT, COURTNEY