



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 66970
Promised Date: 30 APR 22

CUSTOMER WORK ORDER

WO #: 66970 (Appointment Date: 12 APR 2022 - Time: 07:00am)

Customer: 52193 - SPIEHLER, MARK -
812-319-2757

Tag:

Author: BH

Location: 0420 CHECK PARTS

Stock #: 10995

Stock Desc: (10995) 2022 COACHMEN

APEX 265RBSS

Chassis #: 5ZT2CXS1NS042985

Serial #: 5ZT2CXS1NS042985

Mileage:

Licence:

Invoice #:

Date In: 01 APR 22

Promised: 30 APR 22

Date Sched:

Completed: 16 APR 22

Warr. Date: 21 JAN 22

Job #1 - Warranty

COMPLAINT: KITCHEN SINK LEAKS WHEN DRAINING UNDER THE FAUCET

CAUSE: KITCHEN SINK LEAKS WHEN DRAINING UNDER THE FAUCET.

CORRECTION: Ran water in sink. No leaks. Removed panels under kitchen sink for access to area of leak. Filled sink half way. Pulled drain plug. Water is leaking from within the wall by sink drain pipe. Waiting on approval for repair. Removed sliding bedroom door and all hardware. Removed flat trim at top and bottom of wall panel. Removed wall panel from wall to expose kitchen sink drain pipes. Removed all staples that were securing wall panel and trim to wall frame. Added water to kitchen sink. Pulled stopper. Water is leaking at bottom plumbing joint that goes thru floor. Apex said to drop grey tank. Removed LP junction block and all LP lines from underbelly mounting. Cut underbelly under grey tank for access to tank. Disconnected all wiring from tank. Removed mounting screws holding support beam in place. Cleared foam from around drain outlet to let tank drop. Cut drain pipe inside wall to let tank drop. Dropped tank. Removed rubber grommet and pipe from top of tank. Installed new rubber grommet in top of tank. Made up test drain pipe to check fit of tank hole and hole in floor. Dropped tank and glued up drain pipe to come up thru floor. Remounted grey tank. Inserted new drain down into tank. Connected drain from kitchen sink to new drain pipe in tank. Filled kitchen sink and pulled stopper. Checked new drain connections for leaks. No leaks found. Repositioned wall panel and secured in place. Need new seam tape to match wall panel. Reattached all trim pieces and filled all staple holes. Remounted sliding door track to ceiling. Rehung sliding door. Remounted trim board covering door track. Remounted underbelly to frame side rails. Cut to fit and installed board to secure underbelly that was cut for access to grey tank. Secured cut in underbelly to board. Sealed cut and all screws with underbelly tape. Sealed hole around sewer drain pipe with spray foam. Remounted LP junction block to frame and secured all LP lines. Will paint spray foam black when it sets up. 4/11/2022: Turned in parts request for new seam tape to match wall panel. 4/12/2022: Moved unit back in shop to paint spray foam around sewer outlet Black. Moved unit back to service lot. Waiting on seam tape for bedroom wall.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	75.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	150.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	600.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	600.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	75.00
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	150.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	300.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	300.00



Customer #: 52193
SPIEHLER, MARK

Z990 MISC LABOUR CODE (EXTERNAL) DKM 0.00

Parts

Part #	Description	Qty	Price	Total
11-1128	1-1/2" BEND - 1/16	2.00	2.21	4.42
11-0995	1-1/2" TANK GROMME	1.00	5.04	5.04
3673	1.5" FERNCO COUPLE	1.00	4.93	4.93
89-8002	COUPLING 1 1/2" H	1.00	1.02	1.02
F100207071	SEAM TAPE, 1" HEMP	12.00	0.15	1.80

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-SEAM TAPE	1.00	15.93	15.93

Subtotal for Job #1: 2,283.14

Job #2 - Internal

COMPLAINT: THE FAUCET IS ALSO LEAKING

CAUSE: THE FAUCET IS ALSO LEAKING.

CORRECTION: Checked all water line connections at kitchen sink. Checked kitchen faucet. Could not find any leaks from kitchen faucet. All leaks were coming from Job # 1, when draining kitchen sink.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C

Subtotal for Job #2: 0.00

Job #3 - Internal

COMPLAINT: ACCES PANEL TO THE INSIDE FRIDGE WONT OPEN FROM THE OUTSIDE

CAUSE: ACCESS PANEL TO THE INSIDE REFRIGERATOR WON'T OPEN FROM THE OUTSIDE.

CORRECTION: Lock will not open with master key or the right key number for lock. Sprayed lock cyclinder with WD40. After trying several times to unlock key was able to get lock to turn and open.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C

Subtotal for Job #3: 0.00

Job #4 - Internal

COMPLAINT: THE CAP ON THE GREY GALLEY WILL NOT OPEN IT HAS LIQUID IN IT

CAUSE: THE CAP ON THE GREY GALLEY TANK WILL NOT OPEN. IT HAS LIQUID IN IT.

CORRECTION: Removed cap on galley tank sewer outlet by hand. It was not stuck. Opened drain valve and drained galley tank. Replaced cap on drain outlet.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C

Subtotal for Job #4: 0.00

Job #5 - Internal

COMPLAINT: SIDE WINDOW BY THE DINNETE IS LEAKING WHEN RAINING

CAUSE: SIDE WINDOW BY THE DINNETE IS LEAKING WHEN RAINING.

CORRECTION: Found that window was not closed all the way, even though the latch was closed. Closed



window all the way and secured with latch. Window will not slide open if latch correctly. Checked top of window and found that it needed to be cap sealed in one place. Taped off window frame and cap sealed across top and on both sides at top.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Subtotal for Job #5:			0.00

Parts Total:	17.21
Labour Total:	2,250.00
Sublet Total:	0.00
Extras Total:	15.93
WORK ORDER TOTAL:	2,283.14

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 16 Apr 2022

W/O: 66970
Promised Date: 30 APR 22



Customer #: 52193
SPIEHLER, MARK

