

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
47725
812-867-5200

WARRANTY CLAIM # 67164
MANUFACTURER'S CLAIM #:

Manufacturer: 1013 - KEYSTONE RV CO
Customer: 1000 - BASDEN'S AMERICAN RV
Address: 600 E. BASELINE RD. EVANSVILLE, IN
USA
47725
Phone:
Stock Number: 11169 - 2022 MONTANA 3121RL 4YDFM0R2XN4702830
VIN: 4YDFM0R2XN4702830 HIN: SER#: 4YDFM0R2XN4702830
Mileage: 0 Work Order Comp: 31 MAY 22
Auth. No: Dealer #: 1194
Warr. Date: Work Order Date: 22 APR 22 Inv #: 377741

WO # Job # Description JOB INFORMATION

67164 3 TV'S WILL NOT PICK UP CHANNELS
TV's WILL NOT PICKUP CHANNELS.
TV will not pick up channels inside shop or outside shop.
Removed Wineguard 360 from its mounting on roof. and checked
power board for light. Light was on. Checked coax cable at
antenna. Center looks like it is covered with something.
Replaced coax end. Did not change anything. Still no channels.
Removed Key Signal Controller from compartment wall. Checked
coax cable up to antenna. It is good. Checked all coax cables
from controller to Both TV locations. All good. Checked coax
cables from wall plates to TVs. All good. Temporary installed
a regular TB booster next to Key unit. Connected antenna coax
and coax to rear TV to temp booster. Ran a channel scan and temp
booster picked up 12 channels inside shop. Key Signal Controller
is bad and needs replaced. 4/29/2022: Turned in parts request
for a new controller.

67164 1 BEDROOM SLIDING DOOR DON'T LATCH. NOTED ON DEL
BEDROOM SLIDING DOORS WON'T LATCH. NOTED ON DELIVERY.
Checked bedroom sliding closet doors. Neither door will latch
closed. Latch pins do not line up with hole socket. Adjusted
top rollers on both doors to prevent doors from dragging when
opened and closed. Remounted latch sockets to allow lock pins to
drop in place.

67164 2 CITY WATER FILL LEAKS ON BACK SIDE

Claim : 67164

 WO # Job # Description JOB INFORMATION

CITY WATY FILL LEAKS ON BACK SIDE.

Removed access panel that covers back of water panel. Found leak coming from back of city water fill fitting. Tightened fitting. Checked for leak at fitting. Not leaking now. Remounted panel covering back of water panel.

 Part No Job# Description PARTS Qty Price Total

 DCR505LSW-1 3 PW HAPS FREE SELF-LEVELING DICOR 2.00 6.33 12.66
 606664 3 Antenna - Multisou 1.00 80.91 80.91

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 3 MISCELLANEOUS REPAIR 0.00 150.00 0.00
 Z990 3 MISCELLANEOUS REPAIR 3.50 150.00 525.00
 Z990 3 MISCELLANEOUS REPAIR 0.00 150.00 0.00
 Z990 3 MISCELLANEOUS REPAIR 0.00 150.00 0.00
 Z990 1 MISCELLANEOUS REPAIR 0.20 150.00 30.00
 Z990 2 MISCELLANEOUS REPAIR 0.30 150.00 45.00

 Excode Job# Description EXTRAS Qty Price Total

 FRT 3 UPS-SIGNAL CONTROLLER 1.00 11.76 11.76

Parts Total: 93.57
 Labour Total: 600.00
 Sublet Total: 0.00
 Extras Total: 11.76

>>>> Claim Total: 705.33

Customer Signature: _____

Date: _____