

GREENEWAY, INC.
8220 STATE HWY 13 SOUTH
WISCONSIN RAPIDS WI
US
54494
(715) 325-5170

WORK ORDER # 13846

Date In: 21 JUL 26 Author: DLUCAS
Promised Date: 28 JUL 26 Stock No: 11292
: Year: 2025
Customer Name: 17800 - KAMMERER JR., Manufacturer: FOREST RIVER
Address: 6405 CONNIE LN Brand: FLAGSTAFF SUPER-LITE T
: WESTON, WI Model: 26FKBS
Postal/Zip: 54476 Miles/Hrs: 0
Phone#(res): 815-315-3926 Exterior Color:
Phone#(bus): Unit Type: TT-TRAVEL TRAILER
Cell Phone: License#:
Email: DON.KAMMERERJR@YAHOO.C Tag#:
Purchased Date: 28 JUL 25 :
Delivery Date: 11 AUG 25 :
InService Date: :
Serial#: 4X4TFLB20SZ195411 :

Job # Description JOB INFORMATION Type Bill To

1 COMPLAINT: CUSTOMER STATES AWNING WILL NOT RETRACT W 1021 FORES
CAUSE: pics taken I checked voltage to
controller is 13.15 volts the awning
will extend but not retract I reverse
wires on controller board to get awning
to retract on extend mode so therefore
the wiring and awning motor is good I
diagnose a bad unity board
CORRECTION: need new control module board REQUEST 1
HOUR AND PARTS
2 COMPLAINT: CUSTOMER STATES CABINET DOOR NOTED BY W 1021 FORES
DELIVERY TECH IS CRACKED
CAUSE: in the kitchen near the sink on left
side the middle lower cabinet door is
cracked on top pics and measurements
taken
CORRECTION: Will need a complete cabinet door
REQUEST .5 AND PARTS
3 COMPLAINT: CUSTOMER STATES WATER IS POOLING IN W 1021 FORES
SLIDE TOPPER OVER LIVING ROOM WONDERING
ABOUT TIGHTENING
CAUSE: pics taken seems like water was hanging
in the middle for a while on slide
topper also looks like rube maybe
sagging a little in middle
CORRECTION: disconnected slide topper arm and added
more tension on slide topper fabric
seems to help if anything customer can

Continued on page 2

Work Order : 13846

```

*****
Job #   Description                JOB INFORMATION                Type Bill To
*****
                                add a beach ball up under slide fabric
                                to help run off and remove ball when
                                retracting slide  REQUEST .78
4      COMPLAINT:  CUSTOMER STATES LIGHT AT DOORWAY WORKS    W    1021    FORES
                                BUT BUTTON ON COVER DOESNT
      CAUSE:        the lens on light near the front entry
                                door was not all the way complete seated
                                onto light fixture
      CORRECTION:   I had taken light lens off fiscally
                                inspect all components on light re
                                attached the lens so it's completely
                                tight on fixture the light button on
                                light itself is working  REQUEST .23
SC     CUSTOMER REQUESTS SERVICE CALL TO 8902 MADELINE LAKE I    FSC    FREE
      ROAD WOODRUFF WI

```

```

*****
Job#  Lab Code  Description  LABOUR  Mech Bill to  Hrs  Rate  Total
*****
  4  WARR      MANUFACTURER WARRANTY  JS  W-1021    0.50  140.00  70.00
  3  WARR      MANUFACTURER WARRANTY  JS  W-1021    0.78  140.00  109.20
  2  WARR      MANUFACTURER WARRANTY  JS  W-1021    0.50  140.00  70.00
  1  WARR      MANUFACTURER WARRANTY  JS  W-1021    0.50  140.00  70.00

```

```

*****
Job #  Excode  Description  EXTRAS  bill to  Qty  Price  Total
*****
SC  SC      SERVICE CALL                I-FSC    0.00  3.75  0.00

```

```

*****
                                BILLINGS SUMMARY
Type Bill Id  Parts  Labour  Sublet  Extras  Tax  Total
*****
W  1021      0.00  319.20  0.00  0.00  0.00  319.20

      Totals  0.00  319.20  0.00  0.00  0.00  319.20

```

&k2S
&k0S