



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 6150
Promised Date: 06 MAY 22

CUSTOMER WORK ORDER

WO #: 67260

Customer: 51115 - MARONEY, IV,
JAMES A. - 502-693-1181

Tag:

Author: BH

Location: 0609 SEE IF BH CAN CLOSE
THIS

Stock #: 10811

Stock Desc: 2021 TT FOREST RIVER

CHEROKEE GREY WOLF 26DBH

Chassis #: 4X4TCKB23MK074516

Serial #: 4X4TCKB23MK074516

Mileage: 0

Licence:

Invoice #:

Date In: 24 APR 22

Promised: 06 MAY 22

Date Sched:

Completed: 09 JUN 22

Warr. Date: 26 APR 21

Job #1 - Internal

COMPLAINT: LEAK IN THE BATHROOM WHILE IT IS RAINGING MIGHT BE COMING FROM THE VENT
LID CHECK AND ADVISE

CAUSE: pulled unit up to shop. hooked up sprayer and set on the roof to check for leak. noticed a little
water around the crank handle for the lid. got up on roof and noticed a small hole in the dicor around the
back side.

CORRECTION: sealed around the vent with dicor. check inside gasket that seals the lid. seal looks good.
will let sit overnight and test next day.
find unit and bring in, find parts

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JP	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	JP	N/C

Parts

Part #	Description	Qty	Price	Total
13-1320	PW HAPS FREE SELF-	1.00	N/C	N/C

Subtotal for Job #1: 0.00

Job #2 - Warranty

COMPLAINT: THE FAUCET HAS A LEAK IN THE HANDLE INSIDE KITCHEN

CAUSE: FOUND HANDLE LEAKING NEED TO REPLACE FAUCET

CORRECTION: get parts NEED INSTUTIONS ON HOW TO CHANGE CARTYRIGE E FOR THIS FAUSET
cartrige retaner will not unscrew by hand, finly get retaner off change carteage reassemble fauset water test
for leaks

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JP	30.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JP	0.00

Parts

Part #	Description	Qty	Price	Total
F100325225	FAUCET CARTRIDGE -	1.00	11.79	11.79



Customer #: 51115
MARONEY, IV, JAMES A.

Subtotal for Job #2: 41.79

Job #3 - Warranty

COMPLAINT: LOOK AT THE BULB SEAL WHEN THE DOOR IS IN ON THE TOP DOES NOT LOOK RIGHT

CAUSE: bulb seal pulled off track. the top wiper seal that holds the bulb seal was poorly installed. the track is very uneven towards the middle. top wiper seal needs to be replaced and bulb seal also needs replaced

CORRECTION: remove bulb seal, had to heat to brake loose flap seal from sealer, heat up sealer on metal and scrape off, use hammer to flatten metal and try to straten up bad cut om the metal, install new seal with tape and screws, install new bulb seal, cap seal with silacon,

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JP	300.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	75.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JP	0.00

Parts

Part #	Description	Qty	Price	Total
20X48346A	SLIDE OUT, BULB "D	20.00	0.87	17.40
20X71769A	SEAL 2 7/8" SINGLE	20.00	2.10	42.00
500627	CLEAR SIKASIL PLUS	1.00	17.86	17.86

Other Services

Code	Description	Qty	Price	Total
FRT	UPS - SEALS	1.00	15.99	15.99

Subtotal for Job #3: 468.25

Parts Total: 89.05
Labour Total: 405.00
Sublet Total: 0.00
Extras Total: 15.99
WORK ORDER TOTAL: 510.04

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 09 Jun 2022

W/O: 6070
Promiss Date: 06 MAY 22



Customer #: 51115
MARONEY, IV, JAMES A.

