



12024 Central Ave SE ★ Albuquerque NM 87123
www.MYERSRV.com
(505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 73814
Promised Date:
08 AUG 26

73814

WO #: 73814

Customer Name: 1000 - MYERS "RV"
CENTER, INC.

Completed Date:

Invoice#:

Author: BRIAN

Stock Desc: 9733 2027 TRACER 286RL

Serial#: 527525

Chassis#: 5ZT2TRUB3VB527525

Miles/Hrs:

Tag#:

Purchased Date:

Warranty Date:

Date In: 13 AUG 26

Time In:

Job #PDI1 - Internal

COMPLAINT: Transferred to RV*73814-1 on 17 AUG 26

Estimate amount was 0.00

PRE-PDI NEW TT - 3.0

CAUSE: Pdi travel trailer

CORRECTION: Complete

Jobs added

Labor

Job #	Description	Total
PDI1	PDI TRAVEL TRAILER	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #PDI1: 0.00

Job #992 - Warranty

COMPLAINT: Unknown object, causing damage to the underside of the driver side slide room floor

CAUSE: unknown.

CORRECTION: Brought the slide in until the edge of the floor inside began to lift

From front to back on the slide, examined underneath the floor to see if there were any objects that could possibly be sticking up or something between the slide floor that could be causing the damage did not see anything that would cause that type of damage

Brought the slide further in as the floor began to tip down, giving easier access from the outside to examine front to back to see if there were any foreign objects inside the outer wiper seal that could be causing the damage was unable to physically see inside due to the amount of space, however, was able to run my hand between the two floors feeling for any objects that would be dragging against the underside of the slider floor did not feel anything that would be causing the damage

Requesting 30 minutes labor

Labor

Job #	Description	Total
992	Slide room	N/C

Customer #: 1000
MYERS "RV" CENTER,
INC.,

1000

Subtotal for Job #992: 0.00

Job #993 - Warranty

COMPLAINT: Numerous cracking and separating areas on the roof sealant on the front cap, plumbing vents skylight, and roof fence

CAUSE: Sealant cracking.

CORRECTION: Recommend spot ceiling, the separations and cracking on the sealant on the roof with white dicor as seen in the photos. Numerous areas of separation and cracking will request 45 minutes labor.

Labor		
Job #	Description	Total
993	Roof sealant	N/C
Subtotal for Job #993:		0.00

Job #994 - Warranty

COMPLAINT: Paneling under the bed, detached from the frame, exposing the storage compartments underneath the bed

CAUSE: Paneling under the bed, detached from the frame.

CORRECTION: Correction will be using self tapping screws to attach the paneling and in lieu of. The staples used to attach the paneling into aluminum framing.
 15 minutes requesting

Labor		
Job #	Description	Total
994	Paneling under the bed	N/C
Subtotal for Job #994:		0.00

Job #995 - Warranty

COMPLAINT: Island is not properly secured, base cabinet is loose.

CAUSE: Not screwed down to the floor, and the base cabinet is loose

CORRECTION: Found during the examination underneath the kitchen sink and repairing a drain water leak that the island where the sink is located is not properly secure to the base or the floor. It is very loose sticking up on the front and passenger side corner.
 Several screws added into the base to make sure that it is properly attached and no longer moving
 Requesting 15 minutes labor

Labor		
Job #	Description	Total
995	Kitchen island cabinet	N/C
Subtotal for Job #995:		0.00

Job #996 - Warranty

COMPLAINT: Loose packing nut connecting the drain pipes to the sink basket strainer

CAUSE: Packing nut was loose

CORRECTION: Founder in the PDI the packing nut for the drain pipe connecting the drain pipe to the sink basket strainer was loose
 In order to access this access panel had to be unscrewed packing that was tightened. The sink was filled with water and a flow test was conducted again. Sink is no longer leaking access panel reinstalled
 Work is complete
 Requesting 15 minutes labor

73814

Customer #: 1000
 MYERS "RV" CENTER,
 INC.,

1000

Labor		
Job #	Description	Total
996	Kitchen sink drain	N/C
Subtotal for Job #996:		0.00

Job #01 - Warranty

COMPLAINT: Transport damage
 Valance tore off the wall
 Damaged the shade
 Damaged the wall

CAUSE: Transport damage.

CORRECTION: Recommend replacement of the valance, which is black metal is 64 inches long on the outside
 Recommend replacing the blind blind is 62 inches outside the outside
 In order to make these repairs, new parts will have to be ordered along with some steam tape
 Will require unscrewing the remaining portion of the blind, and the tension screws, leveling, and installing the new blind, doing some mild repair with a putty stick on the wall, where the hole is very large from being ripped out from the valance due to the location, the damage can be covered with some seam tape valance then can be screwed back to the wall after the blind is installed and adjusted
 Total,time requested 1 hour
 Will need to order parts and approval

Labor		
Job #	Description	Total
01	Rear valance, shade, wall	N/C
Subtotal for Job #01:		0.00

Job #02 - Warranty

COMPLAINT: Valance torn off the wall and damaged the counter top

CAUSE: Fell off during transport.

CORRECTION: Recommendation the full replacement of the countertop countertop measurements 16 inches wide 93 1/4 inches long, brown and color will require removal of drawers side panels inside the cabinet itself on both sides in order to access the underside of the countertop and be able to detach it from the cabinet. Remove the countertop completely.
 Cut new countertop to fit set new countertop in place reattach it to the cabinet base reinstall inside side panels on inside the cabinets touchup where necessary with putty and or silicone
 More hold for parts and approval
 Requesting 1.5 hours labor

Labor		
Job #	Description	Total
02	Counter top	N/C
Subtotal for Job #02:		0.00

Job #03 - Warranty

COMPLAINT: Drawer guide rails inoperable not latching and holding the drawer closed

CAUSE: They are free, floating and defective.

CORRECTION: Recommendation will be to replace the drawer guides on the top drawer and the bottom drawer inside the pantry behind the TV. The guides are not locking in place and holding the drawers secure. They are free, floating and defective.
 Draw guide measurement 14 inches they are not soft clothes. They just lock right at the end of closing or latch at the end of closing.
 On hold for parts and approval
 For these two drawer guides requesting .5 hours labor

Labor		
Job #	Description	Total
03	Pantry drawers	N/C
Subtotal for Job #03:		0.00

Job #04 - Warranty

COMPLAINT: Metal valance tore off the wall, striking the slide, fascia or style causing damage

CAUSE: Transport damage,

CORRECTION: Recommend replacement of the fascia or style on the rear of the passenger side, slide room, dark brown and color 5 1/2 inches wide by 66 inches long
 Im home for parts and approval
 Requesting .5 hours labor since this will have to be cut to fit

Labor		
Job #	Description	Total
04	Slide room fascia / stile	N/C
Subtotal for Job #04:		0.00

Job #05 - Warranty

COMPLAINT: Damage during transport was found drawer guides not latching correctly drawers opening rubbing against cabinet doors, causing damage

CAUSE: Damage during transport.

CORRECTION: Recommendation for replacement of two cabinet doors directly below the kitchen sink large rub marks on the face not sustainable or repairable door size 14 x 24 will need two of them
 One drawer in the kitchen island damaged during transport drawer face size 6 x 14 will also need 15 inch drawer guides since the drawer guides are not latching on fully closed. We will need four sets.
 Two kitchen drawers not closing correctly. This will be included with the drawer guides already requested.
 Will need a second drawer face size 8 x 21

Total time requested to replace two drawer faces four sets of drawer guides and two cabinet doors requesting two hours since holes will have to be drilled for handles drawer guides having to be replaced removing the guide off of the side of the drawer and removing the guide installed inside the cabinet reinstalling make sure that they're completely square with all screws on the back and sides, bro total of four drawers all but one drawer has cabinet bowls for opening and closing that will have to be measured and drilled on hold for parts and approval

Labor		
Job #	Description	Total
05	Kitchen cabinet doors and drawers	N/C
Subtotal for Job #05:		0.00

Job #06 - Warranty

COMPLAINT: Driver side slide at the front end where the refrigerator is does not open completely

CAUSE: It is misaligned.

CORRECTION: Recommendation full adjustment of the slide room on the front corner to ensure the slide is opening completely. It is misaligned. There is a pantry cabinet next to the slide. The slide isn't out of adjustment enough that the cabinet door will not open completely.

This will require vertical adjustment at the slide room, running the slide all the way out getting underneath and loosening the vertical adjustment bolts and adjusting the slide until it measures correctly on full extension

Then bringing the slide completely in and ensuring that the slide room is closing completely on retraction
 Verifying the cabinet door will now open and operate correctly with the slide room fully extended

Requesting one hour labor
 On hold for approval

Labor		
Job #	Description	Total
06	Slide room adjustment	N/C
Subtotal for Job #06:		0.00

Job #07 - Warranty

COMPLAINT: Batten strips came loose.

CAUSE: Batten strip not stapled to the end

CORRECTION: Using a Brad nailer Nao, the batten strip back down, ensuring that is completely secure then covering the new nail holes with putty and wiping clean requesting 15 minutes labor

Labor		
Job #	Description	Total
07	Batten strip	N/C
Subtotal for Job #07:		0.00

Job #08 - Warranty

COMPLAINT: Shower surround coming loose paneling behind shower surround also pulling away from the studs

CAUSE: Not secured properly

CORRECTION: Recommendation removing all Christmas tree rivets from the shower, surround disconnecting the shower faucet and showerhead, removing the shower, surround completely paneling behind the shower surround to be resecured shower surround, move back into place placed back in the same position using Christmas tree, rivets, and re-securing it to the wall
 Requesting two hours labor

Labor		
Job #	Description	Total
08	Shower surround	N/C
Subtotal for Job #08:		0.00

Job #09 - Warranty

COMPLAINT: Awning on passenger side slide on the front does not close completely

CAUSE: The arms on the front are considerably higher than the arms on the back

CORRECTION: Check in the awnings during PDI found that the awning on the passenger side slide does not close completely

Examining the awning further, taking measurements found that the arms on the front are considerably higher than the arms on the back as far as mounting position

In order to realign the awning, the awning will have to be unscrewed from the side of the slide prepositioned and the correct position with proper measurements reattached to the slide room, and then the slide operated again to ensure proper opening and closing

Well request 1.5 hours

On hold for approval

Labor		
Job #	Description	Total
09	Awning not closing	N/C
Subtotal for Job #09:		0.00

W/O: 73814
Promised Date: 20 AUG 26

73814

Customer #: 1000
MYERS "RV" CENTER,
INC.,

1000

Parts Total:	0.00
Labour Total:	0.00
Sublet Total:	0.00
Extras Total:	0.00
WORK ORDER TOTAL:	0.00

NOTICE:
DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Date: 17 Aug 2026

Customer Signature : _____

Customer Work Order