



12024 Central Ave SE ★ Albuquerque NM 87123
www.MYERSRV.com
(505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 73845
Promised Date:
26 AUG 26



WO #: 73845 (Appointment Date: 11 AUG 2026 - Time: 12:45pm)

Customer Name: 56167 - PIROLO,
RAYMOND D

Completed Date:

Invoice#:

Author: ADVISOR

Stock Desc: 9598 2026 OPEN RANGE

COLT 21QB

Serial#: 58TBM0BL4T76L3063

Chassis#: 58TBM0BL4T76L3063

Miles/Hrs:

Tag#: 7432

Purchased Date: 12 JUN 26

Warranty Date: 12 JUN 26

Date In: 11 AUG 26

Time In:

Job #1 - Warranty

COMPLAINT: CUSTOMER STATES THE SHOWER SURROUND IS NOT CONNECTED TO THE PAN - HE REQUESTS REMOVE THE ACCESS PANEL TO MAKE SURE NO WATER HAS LEAKED UNDER IT SAID WATER WAS COMING INTO BEDROOM FLOOR

CAUSE: Gap between the shower and shower floor

CORRECTION: Customer states water has been seen coming from the bathroom into the main body of the room. Took the access panel off from the base of the shower, examined underneath the shower no evidence of water was found under the shower. The shower does have a cloth shower curtain and it is possible for water to come out while showering.

There is some gapping between the shower wall and the shower floor.

White silicone was used all the way around the base of the shower in the shower wall to seal it

Job is now complete.

Requesting .30

Labor

Job #	Description	Total
1	SHOWER SURROUND SEAL AROUND	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C

Subtotal for Job #1: 0.00

Job #2 - Warranty

COMPLAINT: CUSTOMER STATES SHADE AT REAR OF UNIT WILL NOT STAY UP **PLEASE GET PICTURE OF DATA TAG OFF BLIND**

CAUSE: Tension strings extremely loose

CORRECTION: The blind at rear of unit was reported it would not stay up. Checked the blind, found the tension strings were extremely loose allowing the blind to pull away from the wall and considerable distance. See attached photo. Adjusted the tension strings where the blind will open and close correctly and stay up.

Job is complete.

Requesting .20

Labor

Job #	Description	Total
2	SHADE	N/C

Customer #: 56167
PIROLO, RAYMOND D



W/O: 73845
Promised Date: 20 AUG 26



Customer #: 56167
PIROLO, RAYMOND D



Subtotal for Job #2: 0.00

Job #3 - Warranty

COMPLAINT: CUSTOMER STATES GRAB BAR WILL SWING OPEN DURING TRANSIT

CAUSE: Spring in the handle was sticking

CORRECTION: Checked the grab handle at the entry door, found the springs were a little bit sticky and not completely operational. Sprayed some lubricant inside the grab handle, now operates freely and operates as intended by the manufacturer. Job is complete.

Requesting .20

Labor

Job #	Description	Total
3	ENTRY DOOR ASSIST HANDLE	N/C

Subtotal for Job #3: 0.00

Job #4 - Warranty

COMPLAINT: CUSTOMER STATES ENTRY DOOR WILL ALSO SWING OPEN DURING TRANSIT & WAS LOCKED

CAUSE: Door dragging on the striker plate not latching fully

CORRECTION: Found the entry door was dragging, not latching completely. The door would pop open during transport. Removed the striker plate by taking the two screws out, completely flattened the striker plate. Reinstalled the striker plate back in place with flathead screws.

Checked the operation of the door the door now latches solidly, and is not dragging on the striker plate any longer. Job is complete

Requesting .20

Labor

Job #	Description	Total
4	ENTRY DOOR ADJUST	N/C

Subtotal for Job #4: 0.00

Job #5 - Warranty

COMPLAINT: CUSTOMER STATES PUDDY MARKS ON WALL, ACROSS FROM SINK BETWEEN BATHROOM & BEDROOM **HARD TO SEE IN THE PICTURES AND NEED TO BE AT AN ANGLE TO SEE THE PUDDY MARKS**

CAUSE: Excessive putty

CORRECTION: Found on the short wall between the bathroom door and the bedroom curtain to have excessive amounts of putty from floor to ceiling and edge to edge.

Scrapped all the excessive putty off that would come off. Job is complete

Requesting .20

Labor

Job #	Description	Total
5	PUDDY MARKS ON WALL	N/C

Subtotal for Job #5: 0.00

Job #6 - Warranty

COMPLAINT: CUSTOMER STATES FRONT COMPARTMENT ON PASS. SIDE WILL NOT LATCH

PLEASE GET PICTURE OF DATA TAG OFF COMPARTMENT DOOR

CAUSE: Screw fell out

CORRECTION: Found the screw for the compartment door thumb latch had fallen out from the back of the thumb latch and fallen off. Reinstalled the back of the thumb latch and screw. Double checked the operation to make sure it was closing correctly. Job is complete



Requesting .15

Labor

Job #	Description	Total
6	COMPARTMENT DOOR LATCH	N/C

Subtotal for Job #6: 0.00

Job #NOTE - External

PLEASE DRAIN FRESH WATER TANK

Subtotal for Job #NOTE: 0.00

Parts Total: 0.00
Labour Total: 0.00
Sublet Total: 0.00
Extras Total: 0.00
WORK ORDER TOTAL: 0.00

NOTICE:

DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

****MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND****

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Customer Signature : _____

Date: 19 Aug 2026

W/O: 73845
Promised Date: 20 AUG 26



Customer #: 56167
PIROLO, RAYMOND D

