



12024 Central Ave SE ★ Albuquerque NM 87123
www.MYERSRV.com
(505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 73376
Promised Date:
08/11/26



WO #: 73376

Customer Name: 1000 - MYERS "RV"
CENTER, INC.

Completed Date: 18 AUG 26

Invoice#:

Author: BRIAN

Stock Desc: 9509 2025 TRACER 170RS

Serial#: 5ZT2TRFC7SB526069

Chassis#: 5ZT2TRFC7SB526069

Miles/Hrs:

Tag#:

Purchased Date: 10 JUL 26

Warranty Date: 10 JUL 26

Date In: 19 MAY 26

Time In:

Job #0 - Warranty

CLAIM: 2736037

Subtotal for Job #0: 0.00

Job #1 - Warranty

COMPLAINT: PASSENGER REAR JWRAP LOOSE

CAUSE: JWRAP NOT CUT PROPERLY AT FACTORY

The factory cut the metal to short..bear the end of the j wrap.. need to order a new piece. Measurements are in the work order .. requesting 1 hour to complete

CORRECTION: The J wrap from factory was not cut properly and therefore was not seated and in the correct position. The cut was too low at a certain spot and made it stick out from the top. A new jwrap needs to be ordered. 8 foot in length. The new piece has to be cut to a correct size in an angle for the right rear. New screws have to be installed.

Photos attached

Request 3 hours

I checked the yard to see if we had a unit that we could pull this fender skirt from there was not one so I trimmed it and reinstalled it and reinstalled it and caulked it.

Labor

Job #	Description	Total
1	JWRAP	237.50

Parts

Part #	Description	Qty	Price	Total
38-8853	D SEAL 1/2" X 3/8"	20.00	0.59	11.80
40170	SILICONE TUBE-CLEAR	1.00	12.88	12.88

Subtotal for Job #1: 262.18

Job #01 - Warranty

COMPLAINT: Driver side JWRAP BOWED WARRANTY ITEM

CAUSE: Bowing of belt molding

The jwrap was seperating slightly .

CORRECTION: The left side belt molding has to be unscrewed, molding taken off and silicone cleaned off of the unit. The left fender has to be unscrewed and removed. A relief cut of the belt molding under the

Customer #: 1000
MYERS "RV" CENTER,
INC.,





fender has to done so the belt molding can be push to flattened out where the bow is. Belt molding has to be screw back in the proper location, fitted correctly and siliconed. The fender has to be installed back to its proper location.

Repaired and secured

Labor

Job #	Description	Total
01	MISC LABOUR CODE (WARRANTY)	209.00

Subtotal for Job #01: 209.00

Job #02 - Warranty

COMPLAINT: Bathroom door difficult to open and close

CAUSE: Damaged bathroom door

Door handle is broken.the cause is unknown

CORRECTION: Bathroom door damaged where door handle is located. Damaged also where strike plate goes. The door has to be unscrewed and taken off to get ready for a new door replacement. The new door needs to be screwed back in, tested and adjusted.

Door has to be ordered.

Door size is 22x74 inches.

The door handle needs replacement do to it being stuck and broken. Handles need to be unscrewed and taken off. Needs a new door handle kit with strike plate. The new handles then needs to be screwed back onto the new door once thats in and adjusted.

Photos attached

Took door handle from bathroom door of unit 9656

Installed on bathroom door of 9509

Labor

Job #	Description	Total
02	BATHROOM DOOR	142.50

Parts

Part #	Description	Qty	Price	Total
F100216017	DOOR KNOB, SATIN NICKEL (1226-SN)	1.00	11.10	11.10

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING & HANDLING CHARGES	1.00	16.62	16.62

Subtotal for Job #02: 170.22

Job #03 - Internal

COMPLAINT: Transferred to RV*73753 on 22 JUL 26

Estimate amount was 0.00

REAR TAILLIGHT MISSING

CAUSE: Missing taillight

Took light form unit 9656

CORRECTION: Need to order new taillight with license plate holder connect wiring , screw into factory location and silicone around it. Make sure wiring is working.

Photos attached

Want .50

Installed on 9509

Labor

Job #	Description	Total
03	TAILLIGHT	N/C



Subtotal for Job #03: 0.00

W/O: 73376
Promised Date: 05 JUN 26

Parts Total: 35.78
Labour Total: 589.00
Sublet Total: 0.00
Extras Total: 16.62
WORK ORDER TOTAL: 641.40

NOTICE:
DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Customer Signature : _____

Date: 18 Aug 2026



Customer #: 1000
MYERS "RV" CENTER,
INC.,

