



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 67613

CUSTOMER WORK ORDER

WO #: 67613 (Appointment Date: 04 JUN 2022 - Time: 07:00am)

Customer: 52089 - TROESCH, ROBERT
- 812-630-6601

Tag:

Author: BJW

Location: 0615 CHECK TO SEE IF
CUSTOMER CAME BACK

Stock #: 11052

Stock Desc: (11052) 2022 COACHMEN

APEX 256BHS

Chassis #: 5ZT2CXRBO0NS042689

Serial #: 5ZT2CXRBO0NS042689

Mileage:

Licence:

Invoice #:

Date In: 04 JUN 22

Promised:

Date Sched:

Completed: 15 JUN 22

Warr. Date: 27 NOV 21

Job #1 - Internal

COMPLAINT: BOTH OF THE FRONT STAY JACKSONE OF THE ALL THREADS ON THE FRONT STAB JACK AND ONE ALL THREAD ON THE REAR STAB JACK BINDS AND WILL NOT LET THE STABILIZER JACKS GO UP AND DOWN,

CAUSE: jacks are bent. ben told me to replace all 4 jacks.

CORRECTION: removed damaged jacks. installed 4 new jacks.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Parts

Part #	Description	Qty	Price	Total
285326	24IN SCISSOR JACK	2.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C

Subtotal for Job #1: 0.00

Job #2 - Internal

COMPLAINT: SLIDE TOPPER PROBLEM WENT OVER THE SLIDE ABOUT HALF WAY OUT DGH
INSTALL SLIDE TOPPER

CAUSE: slide topper was installed incorrectly. bent all the brackets and hardware. tore up the canvas. pulled the bottom of the mounting bracket out of the wall. bent both corners of facia trim on out side. need to order new slide topper kit/assembly.

CORRECTION: removed all hardware and slide topper. bent back facia trim on both sides. removed both brackets that go into the wall. took liquid nails and secured to wall. letting set up. went to put other part of bracket on and it is hitting the facia trim. need to fabricate 2 shims to put under brackets to help push away from facia trim. cut 2 pieces of aluminum, drilled out holes, painted black, applied adhesive to the shim and bracket and installed onto wall. let sit. applied black silicone to seal. removed gutter spout. took new topper and secured to gutter rail. installed hardware. ran slide out to make sure everything cleared slide out room. installed gutter spout and sealed with silicone. cleaned up mess

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C



Customer #: 52089
TROESCH, ROBERT

Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DGH	N/C

Parts

Part #	Description	Qty	Price	Total
00-0490	V000251461 BLK SLI	1.00	N/C	N/C
Subtotal for Job #2:				0.00

Job #3 - Internal

COMPLAINT: LOOK AT THE LIGHT UNDER THE BED ARE IT IS A MOTION LIGHT

CAUSE: customer states the motion light isnt working. turned on light. light shut off. moved hand in front of sensor and light came on

CORRECTION: no correction. light is working

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Subtotal for Job #3:			0.00

Job #22V243 - Warranty

COMPLAINT: RECALL 22V243 LP QUICK CONNECT

CAUSE: quick connect does not fall under recall.

CORRECTION: no corrections made

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	15.00
Subtotal for Job #22V243:			15.00

Parts Total:	0.00
Labour Total:	15.00
Sublet Total:	0.00
Extras Total:	0.00
WORK ORDER TOTAL:	15.00

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 15 Jun 2022

Customer #: 52089
TROESCH, ROBERT

