



12024 Central Ave SE ★ Albuquerque NM 87123
www.MYERSRV.com
(505)298-7691 ★ 1-800-748-2078 ★ FAX (505)293-7172

W/O: 73782
Promised Date:
08 AUG 26

73782

WO #: 73782

Customer Name: 1000 - MYERS "RV"
CENTER, INC.

Completed Date:
Invoice#:
Author: ADVISOR
Stock Desc: 9732 2027 OPEN RANGE
COLT 26RCS
Serial#: 6Y3078
Chassis#: 58TBM0BP6V76Y3078
Miles/Hrs:
Tag#:
Purchased Date:
Warranty Date:

Date In: 19 AUG 26
Time In:

Job #PDI1 - Internal

Transferred to RV*73782-1 on 26 AUG 26
Estimate amount was 0.00
PRE-PDI NEW TT - 3.0

Labor

Job #	Description	Total
PDI1	PDI TRAVEL TRAILER	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
SS-I	SHOP SUPPLIES - INTERNAL	0.00	N/C	N/C

Subtotal for Job #PDI1: 0.00

Job #01 - Warranty

COMPLAINT: Shower pan not sealed at all

CAUSE: Factory did not seal pan.

CORRECTION: Need to silicon bottom edge of shower to seal the doors to the shower pan so it doesnt leak all over requesting 30 mins for re seal of shower pan

Labor

Job #	Description	Total
01	Shower pan is not sealed (WARRANTY)	N/C

Subtotal for Job #01: 0.00

Job #03 - Warranty

COMPLAINT: Bathroom door frame hinge side is not secured properly

CAUSE: Not installed properly.

CORRECTION: Need to take off the door and remove plastic door jam .once door and plastic are removed we need to secure the door frame bottom to the floor with wood screws to help hold the door in place and tighten up the loose door frame . Once door frame is properly secured to floor we need to then shim the door frame to close the huge gap in door frame when door is shut .Requesting one hour for repair.

Customer #: 1000
MYERS "RV" CENTER,
INC.,

1000

73782

Customer #: 1000
 MYERS "RV" CENTER,
 INC.,

1000

Labor		
Job #	Description	Total
03	Bathroom door frame is loose (WARRANTY)	N/C
Subtotal for Job #03:		0.00

Job #04 - Warranty

COMPLAINT: Inside bottom lip of top slide room fascia is damaged

CAUSE: UNKNOWN

CORRECTION: Need to order and replace slide top fascia requesting 1 hr for removal and install of new fascia . Length of fascia is 155 1/2 inches by 6 1/2 inches

Labor		
Job #	Description	Total
04	Top slide fascia damaged (WARRANTY)	N/C
Subtotal for Job #04:		0.00

Job #05 - Warranty

COMPLAINT: Loose trim by entry door

CAUSE: Not enough staples

CORRECTION: Add staples to secure trim to paneling requesting 10 mins for repair

Labor		
Job #	Description	Total
05	Trim to left of entry door loose (WARRANTY)	N/C
Subtotal for Job #05:		0.00

Job #06 - Warranty

COMPLAINT: Bed lift mount points are extremely loose

CAUSE: Not secured properly

CORRECTION: Need to secure cabinetry under bed to the floor to prevent bed lift from breaking said cabinets. Will need to take off the shelf on both sides of bed storage in order to put more screws in the bottom of said framing to help support the cabinets and bed
 Lift requesting 45 minutes for each side of the bed to secure to floor .

Labor		
Job #	Description	Total
06	Bed lift mount points are very loose	N/C
Subtotal for Job #06:		0.00

Job #07 - Warranty

COMPLAINT: Wall panel has a visible hole from hanging cabinets

CAUSE: Not installed properly

CORRECTION: Need to attach a piece of baton trim to bottom edge of cabinets to hide the hole .
 Requesting 15 mins for repair need to order appropriate baton trim that will match cabinets . Two feet of baton trim will be enough .

Labor		
Job #	Description	Total
07	Wall panel to left of entry door has a hole from framing screw	N/C

73782

Customer #: 1000
 MYERS "RV" CENTER,
 INC.,

1000

Subtotal for Job #07: 0.00

Job #08 - Warranty

COMPLAINT: Pro flex or other similar sealant is on the left side of bathroom vanity

CAUSE: Manufature damage.

CORRECTION: Since it is a lot stronger of an adhesive than silicon we cant just remove the adhesive because it will damage the white finish of the style used .need to order new style and replace . Will need to remove top and bottom frame of vanity to give me access to remove the pocket screws that secure damaged style in place . Once the screws are removed we can then remove the damaged style from the wall paneling and cut the new style to the same size .once new style is cut to size we need to install the cabinet door catch along with the securing trim . Once securing trim and door catch are installed we need to pre drill the style for pocket screws using a jig. once holes are tapped for the pocket screws we can then set new style in place and make sure everything is square and then install the screws to secure new style to the rest of vanity then staple to wall panel . Requesting 1 1/2 hrs for repair . Style measurements are 2 inches by 32 1/2 inches

Labor		
Job #	Description	Total
08	pro flex / some type of sealant on bathroom vanity style	N/C
Subtotal for Job #08:		0.00

Job #09 - Warranty

COMPLAINT: Driver side bedroom wall panel is coming loose

CAUSE: Not enough staples to hold in place.

CORRECTION: Need to add more staples to both sides of wall panel to help hold in place ,requesting 20 mins for finish staples and fill putty

Labor		
Job #	Description	Total
09	Driver side bedroom wall panel is coming off wall (WARRANTY)	N/C
Subtotal for Job #09:		0.00

Job #994 - Warranty

COMPLAINT: Bedroom cabinet on left side the backstop is loose

CAUSE: Not secured properly

CORRECTION: Need to add a screw from the back of the cabinet to hold the back wall of cabinets tight and in place .requesting 10 mins for repair

Labor		
Job #	Description	Total
994	Bedroom cabinet on left side the backstop is not secured	N/C
Subtotal for Job #994:		0.00

Parts Total: 0.00
 Labour Total: 0.00
 Sublet Total: 0.00
 Extras Total: 0.00
WORK ORDER TOTAL: 0.00

NOTICE:
DUE TO A LACK OF SPACE, A \$15/DAY STORAGE FEE WILL APPLY IF YOU DO NOT PICK UP YOUR UNIT WITHIN 48 HOURS OF NOTICE OF COMPLETION

EFFECTIVE 01/12/2026 A CREDIT CARD SURCHARGE OF 3% WILL BE APPLIED TO ALL CREDIT CARD TRANSACTIONS

MANUFACTURER'S WARRANTIES AND SERVICE CONTRACTS DO NOT COVER DIAGNOSTIC TIME IF NO PROBLEM IS FOUND

ALTHOUGH WE TAKE PRECAUTIONS TO INSURE YOUR VEHICLE'S SECURITY WHILE IN FOR REPAIRS, WE ARE NOT RESPONSIBLE FOR ANY LOSS OR DAMAGE TO THE VEHICLE OR CONTENTS DUE TO FIRE, THEFT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. WE WOULD APPRECIATE YOUR ASSISTANCE BY REMOVING OR SECURING YOUR VALUABLES SUCH AS GUNS, CAMERAS, JEWELRY, CASH, ETC.

I hereby authorize Myers RV Center, Inc. to perform the repair work set forth in this work order, including the parts and materials necessary. I agree that you are not responsible for delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets and highways for the purpose of testing, inspection or transporting to sublet vendors. An express mechanics lien is hereby acknowledged on the herein described vehicle to secure the payment for repairs performed.

Customer Signature : _____

Date: 26 Aug 2026

Customer Work Order

W/O: 73782
Promised Date: 25 AUG 26

73782

Customer #: 1000
MYERS "RV" CENTER,
INC.,

1000