



Phone: (423) 235-1167
Toll Free: (877) 635-1167
Fax: (423) 235-1176

1202 Idell Road
Bulls Gap, TN 37711

W/O: 27632



WO #: 27632 (Appointment Date: 26 AUG 2026 - Time: 09:00am)

Customer: 89454 - CONDER, ANDREA
Address: 3525 DENTON KNOB WAY
COSBY, TN
37722

Home Phone: (423) 415-9839

Work Phone:

Author: CLP

Location: IH

Invoice #:

Stock #: 11133

Stock Desc: 2025 TT KZ-RV SPORTSMEN CLASS
160QB

Model: 160QB

Serial #: 4EZTK1815S5046664

Chassis #:

Mileage:

Key #:

Req'n #:

License #:

Trim:

Purchase Date: 30 JAN 26

Date In: 26 AUG 26

Promise Date:

Promise Time:

Schedule Date:

Completed:

Warr. Date: 30 JAN 26

Job #1 - Warranty

COMPLAINT: CUSTOMER STATES HOT WATER HEATER SOUNDS LIKE ITS GONNA BLOW UP, AND SHOOT A BIG FLAME - PLEASE CHECK AND ADVISE

CAUSE: TECH STATED THE WATER HEATER WOULD FILL UP ON LP BEFORE IGNITING. TECH WATCHED FIREBALL SHOOT OUT ON LP LIGHT UP. IN ORDER TO FIND THE ISSUE, THE ISSUE HAD TO BE ADJUSTED.

CORRECTION: TECH ADJUSTED IGNITOR BRACKET TO BE MORE CENTERED. NOW THE WATER HEATER LIGHTS PERFECT ON LP.

LABOR WITH DIAG

1.5

Subtotal for Job #1: 0.00

Job #2 - Warranty

COMPLAINT: CUSTOMER STATES THERE IS A LEAK IN THE BATHROOM SINK - MAINLY WHEN HOT WATER HEATER IS RUNNING - PLEASE CHECK AND ADVISE

CAUSE: SEAL IS LEAKING TO THE FIXTURE.

CORRECTION: REMOVE AND REPLACE THE SEAL THEN RETEST

LABOR .50

Subtotal for Job #2: 0.00

Job #3 - Warranty

COMPLAINT: CUSTOMER STATES ONE OF THE UNDER COMPARTMENTS IS HARD TO GET THE KEY OUT OF WHEN HE LOCKS IS. PLEASE CHECK AND ADVISE

CAUSE: FRONT LEFT COMPARTMENT DOOR LOCK IS VERY HARD TO TURN WITH KEY, IF IT TURNS AT ALL. TECH DID LUBE THE TUMBLER TO SEE IF THIS WOULD ALLOW THE KEY TO TURN AND IT DID NOT.

CORRECTION: REPLACE THE COMPARTMENT DOOR TUMBLER, THIS IS A KEY ALIKE SYSTEM.

LABOR .40

Customer #: 89454
CONDER, ANDREA



Subtotal for Job #3: 0.00**Job #4 - Warranty**

COMPLAINT: CUS STATES LEFT SIDE DINETTE IS COMING APART, CHECK AND ADVISE

CAUSE: AFTER REMOVING THE SEAT CUSHION AND PANEL VERIFIED THE STAPLES HAVE PULLED LOOSE FROM THE BACKER TO SMALL STOPS ON FLOOR AND WALL.

CORRECTION: WILL NEED TO FULLY REMOVE THE BACKER AND STAPLES. RESECURE THE STUDS AND REPLACE THE BACKER PIECE THEN RESECURE ALL PIECES IN THE AREA FIRMLY AND CORRECTLY.

LABOR 1.5

Other Services

Code	Description	Qty	Price	Total
SSE	SHOP SUPPLIES EXTERNAL	1.00	N/C	N/C

Subtotal for Job #4: 0.00**Job #5 - Warranty**

COMPLAINT: INSERT ON THE ENTRANCE DOOR IS COMING OUT CHECK AND ADVISE

CAUSE: VERIFIED THE EXTERIOR OF THE ENTRY DOOR COMING LOOSE. TECH STATED THE ENTRY DOOR SIDE MOUNTS HAVE BEEN SCREWED IN TO TIGHT. THIS HAS CAUSED THE DOOR FRAME TO POP LOOSE AND WARP.

CORRECTION: DOOR FRAME DAMAGED DUE TO IMPROPER INSTALL AT BUILD AND WILL NEED TO REPLACE THE DOOR AND FRAME.

LABOR 1.5

Subtotal for Job #5: 0.00**Job #6 - Warranty**

COMPLAINT: FACING BEDROOM CLOSET THE DOOR ON THE RIGHT HAND SIDE IS BOWING CHECK AND ADVISE

CAUSE: VERIFIED THE DOOR IS BOWING, FAULTY WOOD THE CABINET IS BUILT WITH.

CORRECTION: REPLACE CABINET DOOR

LABOR .50

Subtotal for Job #6: 0.00**Job #7 - External**

CUSTOMER DOES NOT WANT WINTERIZED

Subtotal for Job #7: 0.00

Parts Total: 0.00

Labour Total: 0.00

Sublet Total: 0.00

Extras Total: 0.00

WORK ORDER TOTAL: 0.00

I HEREBY ACCEPT ABOVE DESCRIBED WORK AS SATISFACTORY & COMPLETE TO MY SATISFACTION.

X

MOTOR VEHICLE REPAIR REGISTRATION #MV-04967

Customer #: 89454
CONDER, ANDREA

Customer Signature : _____

Date: 02 Sep 2026

W/O: 27632



Customer #: 89454
CONDER, ANDREA



Customer Work
Order

