

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
47725
812-867-5200

WARRANTY CLAIM # 67914
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 1000 - BASDEN'S AMERICAN RV
Address: 600 E. BASELINE RD. EVANSVILLE, IN
USA
47725

Phone:

Stock Number: 11231 - 2022 FREEDOM EXPRESS 20SE 5ZT2FEJB1NW025268
VIN: 5ZT2FEJB1NW025268 HIN: SER#: 5ZT2FEJB1NW025268
Mileage: 0 Work Order Comp: 11 JUL 22
Auth. No: Dealer #:
Warr. Date: Work Order Date: 07 JUL 22 Inv #: 379707

WO # Job # Description JOB INFORMATION

67914 5 GRAVITY FILL HOSE PINCHED FLAT BELOW FLOOR
GRAVITY FILL HOSE PINCHED FLAT BELOW FLOOR.
Fill hose is between top of tank and floor. Removed clamps
holding LP line. Removed tank supports to take pressure off of
tank and it to drop a little. Disconnected fill hose at both
ends. Pulled fill hose up thru hole in floor and removed.
Inserted new fill hose down thru floor and connected to tank.
Vent hose also pulled off at outside fill fitting. Hose too
short. Removed outside fill and reconnected vent hose. Added a
3 inch section to vent hose to reach outside fill flange.
Connected new fill hose to outside fill fitting. Line from water
tank to water pump too short and is pinched flat where it
connects to winterizing hose. Cut hose and added a 90 deg.
fitting to eliminat pinch. Checked fill hose for leaks. Fill
hose leaks at tank fitting. Resealed hose fitting and
retightened. No leak. Repaired cut in underbelly made for acess
to tanf fitting. Remounted tank supports and secured LP line .
67914 2 SUPPORT UNDER DINETTE SEAT BROKEN
SUPPORT UNDER DINETTE BROKEN.
Removed broken cross support. Cut off old staples holding cross
support. Cut new support to fit. Secured in place with angle
brackets.
67914 3 REAR WINDOW BLIND WON'T STAY UP
REAR WINDOW BLIND WON'T STAY UP

Claim : 67914

 WO # Job # Description JOB INFORMATION

 String needs tightened. Bottom anchor screw hole stripped.
 Shortened blind string and installed with a larger screw. Blind
 now stays up.

67914 4 PANTRY DOOR WON'T LATCH CLOSED
 PANTRY DOOR WON'T LATCHED CLOSED.
 Latch plate is not aligned with door knob plunger. Removed latch
 plate and remounted to align with door plunger. Door now latches
 closed.

 Part No Job# Description PARTS Qty Price Total

 11-0186 5 1-3/8"x10' FLEX FILL HOSE 1.00 21.51 21.51
 10-0851 5 BARB UNION 1.00 0.61 0.61
 10-0901 5 BARB ELBOW 1/2 X 1/2 1.00 0.86 0.86

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 5 MISC LABOUR CODE (EXTERNAL) 1.50 150.00 225.00
 Z990 5 MISC LABOUR CODE (EXTERNAL) 1.50 150.00 225.00
 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.40 150.00 60.00
 Z990 3 MISC LABOUR CODE (EXTERNAL) 0.15 150.00 22.50
 Z990 4 MISC LABOUR CODE (EXTERNAL) 0.10 150.00 15.00

Parts Total: 22.98
 Labour Total: 547.50
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 570.48

Customer Signature: _____

Date: _____