

e-Authorization

8/17/20
10:45:34

3-Authorization number PA03203358 Reference no: 68054 Status: Approved Approved by kiddz Approved date 7/28/2022
rving Name Address VIN Retail sold on

34 Basden's American RV Basden's American RV 4YDFCGS27P2500340
600 E Baseline Rd
Evansville, IN 47725

Lu Root e operation of	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty	Base hours	Complaint / Cause / Correction
1	6200403B LP Bottle Holdov	0.00	0.30	0.30		1	0.20	Complaint:STRAP BROKE ON LP TANK Cause:STRAP BROKE ON LP TANK. Correction:Rivets broke off of strap that secures LP tank. Drilled out remaining parts of rivets. Reinstalled locking clasp to strap with new pop rivets.
2	5114319B Receptacle - 12V	0.00	0.70	0.30		1	0.30	Complaint:USB OUTLET NEXT TO REAR COUCH DOES NOT WORK Cause:USB OUTLET NEXT TO REAR COUCH DOES NOT WORK. Correction:Removed USB outlet from wall. Ground wire not connected. Removed 110 outlet below USB outlet for access to 12v wires. Could not pull ground wire out of wall to find original splice. Used a wire connector and connected ground wire from USB outlet to white ground wire behind 120v outlet. Checked operation of USB outlet. Now working. Remounted USB and 120v outlets on wall. KRV - Labor time approved in accordance with Keystone RV's flat rate manual. VCB
3	4147506B Oven - Furrion - A	0.00	1.00	0.50		1	0.10	Complaint:THE PILOT LIGHT ON THE RANGE OVEN WILL NOT STAY ON. Cause:THE PILOT LIGHT ON THE RANGE OVEN WILL NOT STAY "ON". Correction:Pilot light will come on, but will go out after holding knob for 5 mins. Thermocouple is in pilot flame. 7/27/2022: Turned in parts request for a new thermocouple. KRV - Labor time approved in accordance with Keystone RV's flat rate manual. VCB
4	3201314B Door - Interior Slic	0.00	0.50	0.50		1	0.10	Complaint:THE BEDROOM DOOR WILL NOT LATCH CLOSED Cause:THE BEDROOM DOOR WILL NOT LATCH CLOSED. Correction:Removed latch plate. Cut out hole in door frame to

paper claims only use one pre-authorization number per warranty claim for

ple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim
m. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the

e-Authorization

8/17/20
10:45:34 :

Root operation of	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty	Base hours	Complaint / Cause / Correction
-------------------------	-------------	--------	-----------	-------------------	-----------------	-----	---------------	--------------------------------

3-Authorization number PA03203358

1.60

allow latch plate to be repositioned. Reattached latch plate and checked. Door now latches closed.