



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRV.com

812.867.5200
FAX 812.868.1012

W/O: 68245

CUSTOMER WORK ORDER

WO #: 68245

Customer: 49159 - KEEPE, THOMAS J.
- 618-731-0887

Tag:
Author: BH

Location: 0820 CHECK PREAUTH

Stock #: 10976
Stock Desc: 2022 5W KEYSTONE
COUGAR 354FLS
Chassis #: 4YDFCGS27N2503252
Serial #: 4YDFCGS27N2503252
Mileage: 0
Licence:

Invoice #:
Date In: 11 AUG 22
Promised:
Date Sched:
Completed: 17 AUG 22
Warr. Date: 30 JUL 22

Job #1 - Internal

AUTO LEVEL NEEDS ZERO POINT

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Subtotal for Job #1:			0.00

Job #2 - Warranty

COMPLAINT: OVERHEAD TRIM ON OBS SLIDE TRIM LOOSE

CAUSE: trim loose on slide out.

CORRECTION: secured trim with brad nails. filled staple holes with putty.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	ZMS	15.00
Subtotal for Job #2:			15.00

Job #3 - Warranty

COMPLAINT: 2X4 IN BASEMENT AREA BROKEN NEEDS REPLACED

CAUSE: 2x4 under bed is split on one side where they secured it into the wall.

CORRECTION: removed damaged 2x4. got a new 2x4 and cut to length. drilled pilot holes so i could toe nail it into the wall without splitting. secured to wall secured from top through the plywood under the bed. cleaned up mess.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	ZMS	45.00
Z990	MISCELLANEOUS REPAIR	ZMS	30.00

Parts

Part #	Description	Qty	Price	Total
2496STUD	2X4X8 STUD	1.00	4.97	4.97
Subtotal for Job #3:				79.97

Job #4 - Internal

COMPLAINT: SCREWS ON BOTH FENDERS ARE LOOSE AND CAUCK IS COMING LOOSE



Customer #: 49159
KEEPE, THOMAS J.



CAUSE: fenders coming loose from j wrap.

CORRECTION: removed screws that were stripped out. found 2 wider screws and painted them black to match. installed screws on ends of fenders. cleaned fenders. sealed all fenders on unit as needed.

Labor Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	ZMS	N/C
Subtotal for Job #4:			0.00

Job #5 - Warranty

COMPLAINT: VENT FOR FRESH TANK NOT WORKING

CAUSE: vent for fresh tank is pinched somewhere in the underbelly. causing water to backfeed through fill hose.

CORRECTION: cut open underbelly to access tank fitting. removed fresh water inlet housing removed vent line. removed breaker panel to access hole in floor leading to underbelly. ran new hose through floor. took fish tape and pulled line over to fresh tank. secured line to vent line on housing. filled fresh tank all the way without water backfeeding. taped underbelly. installed breaker panel. installed fresh inlet housing and sealed with silicone. drained fresh tank

Labor Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	ZMS	294.00
Z990	MISCELLANEOUS REPAIR	ZMS	6.00
Z990	MISCELLANEOUS REPAIR	ZMS	0.00

Parts

Part #	Description	Qty	Price	Total
10-0087	22733 25' 1/2" TASTE PURE DRINK HOSE	1.00	14.89	14.89

Subtotal for Job #5: 314.89

Parts Total: 19.86
 Labour Total: 390.00
 Sublet Total: 0.00
 Extras Total: 0.00
WORK ORDER TOTAL: 409.86

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 17 Aug 2022



Customer #: 49159
KEEPES, THOMAS J.

