

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 68563
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 53058 - DANIEL G. STONE
Address: 709 W MAIN ST BRUCEVILLE, IN

47516

Phone: 812-830-0647

Stock Number: 10915 - 2022 CHEROKEE GREY WOLF 22MKSE 5ZT2CKLB3NF002465

VIN: 5ZT2CKLB3NF002465 HIN: SER#: 5ZT2CKLB3NF002465

Mileage: 0

Work Order Comp: 27 SEP 22

Auth. No:

Dealer #:

Warr. Date: 23 SEP 22

Work Order Date: 15 SEP 22

Inv #: 383146

WO # Job # Description JOB INFORMATION

68563 2 BRAKE AWAY SWITCH IS FALLING APART
BRAKE AWAY SWITCH IS FALLING APART.
Brake away switch fell apart when cord was pulled. Removed
damaged switch. Mounted new switch and connected brake wires.
Checked operation of new switch. OK.

68563 3 WATER LEAKING IN REAR COMPARTMENT AND OUT OF UNDERBELLY
WATER LEAKING IN REAR COMPARTMENT AND OUT OF UNDERBELLY.
Removed shower faucet from shower wall. Found hot side of faucet
leaking when connected to city water or water pump was turned on.
Faucet did not have to be "ON". Removed both water lines from
back of faucet. Replaced both cone washers and reconnected water
lines to back of faucet. Checked for water leaks at both
connections. No leaks at this time. Remounted faucet to shower
wall. Resealed around faucet housing. Checked underbelly below
leak. Underbelly full of water. Cut out rear section of
underbelly material. This area does not have insulation.
Mounted underbelly hard material and secured to wood stringers.
Sealed edges with black tape.

68563 1 ALL OF THE CLEARANCE LIGHTS COME ON WHEN THE LEFT TURN SIGNAL IS
TURNED ON.
ALL THE CLEARANCE LIGHTS COME ON WHEN THE LEFT IS TURN ON.
Removed cover on 7 way junction box. Checked all wires
connections. All correct and tight. Replace cover. Removed
left rear tail cover. Checked bulb. OK. Removed tail light

Claim : 68563

 WO # Job # Description JOB INFORMATION

assembly from mounting. Pulled all wires out of hole. Found
 that ground wire from light was going to the tail light
 connector. The black wire from the tail light was going to the
 ground connector. Checked operation of lights. All OK.
 Remounted tail light and resealed.

 Part No Job# Description PARTS Qty Price Total

 FAS80-00-2060 2 Trailer Breakaway System Switch; 1.00 16.63 16.63
 10-7150 3 CONE WASHER SWIVEL SEAL 2.00 0.30 0.60

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.40 150.00 60.00
 Z990 3 MISC LABOUR CODE (EXTERNAL) 0.80 150.00 120.00
 Z990 3 MISC LABOUR CODE (EXTERNAL) 0.80 150.00 120.00
 Z990 3 MISC LABOUR CODE (EXTERNAL) 1.40 150.00 210.00
 Z990 1 MISC LABOUR CODE (EXTERNAL) 0.70 150.00 105.00

Parts Total: 17.23
 Labour Total: 615.00
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 632.23

Customer Signature: _____

Date: _____