

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	1250979
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CKLB3NF002465
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$150.00	SITE/WAREHOUSE	086 / 086A
OWNER INFORMATION		ITEM #	CKT22MKSE-86
DANIEL G STONE		DEALER RO #	68563
709 W MAIN ST		CLAIM START DATE	09/26/2022
Bruceville, IN 47516		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	09/14/2022	WARRANTY EXPIRATION DATE	09/14/2023

Claim Line Details

Labor					
Line# 1	Operation Code	Operational Description			
	40-106-01-12-001216	Clearance Light - Electrical/12 Volt Exterior/Replace/Exterior Lighting			
	Complaint, Cause, Correction				
	Original Note : bhoffman@americanrvcenter.com, 2022-09-26 09:46:09 :: ALL OF THE CLEARANCE LIGHTS COME ON WHEN THE LEFT TURN SIGNAL IS TURNED ON. ALL THE CLEARANCE LIGHTS COME ON WHEN THE LEFT IS TURN ON. Removed cover on 7 way junction box. Checked all wires connections. All correct and tight. Replace cover. Removed left rear tail cover. Checked bulb. OK. Removed tail light assembly from mounting. Pulled all wires out of hole. Found that ground wire from light was going to the tail light connector. The black wire from the tail light was going to the ground connector. Checked operation of lights. All OK. Remounted tail light and resealed.Q				
	Model #	Dlr Sub Hrs	0.70	Sub Labor Amt	\$105.00
	Serial #	Appr Hrs	0.70	Appr Labor Amt	\$105.00

Notes

Labor					
Line# 2	Operation Code	Operational Description			
	40-106-01-00-001245	Pin & Lanyard Only - Break-Away Switch - Electrical/12 Volt Exterior/Replace/No Tread Code			
	Complaint, Cause, Correction				
	Original Note : bhoffman@americanrvcenter.com, 2022-09-26 09:48:03 :: BRAKE AWAY SWITCH IS FALLING APART BRAKE AWAY SWITCH IS FALLING APART. Brake away switch fell apart when cord was pulled. Removed damaged switch. Mounted new switch and connected brake wires. Checked operation of new switch. OK.				
	Model #	Dlr Sub Hrs	0.40	Sub Labor Amt	\$60.00
	Serial #	Appr Hrs	0.40	Appr Labor Amt	\$60.00

Notes

Labor					
Line# 3	Operation Code	Operational Description			
	60-136-15-00-001499	Water Line - Plumbing/Fresh Water Supply/Repair or Replace/No Tread Code			
	Complaint, Cause, Correction				
	Original Note : bhoffman@americanrvcenter.com, 2022-09-26 09:49:18 :: WATER LEAKING IN REAR COMPARTMENT AND OUT OF UNDERBELLY WATER LEAKING IN REAR COMPARTMENT AND OUT OF UNDERBELLY. Removed shower faucet from shower wall. Found hot side of faucet leaking when connected to city water or water pump was turned on. Faucet did not have to be "ON". Removed both water lines from				

back of faucet. Replaced both cone washers and reconnected water lines to back of faucet. Checked for water leaks at both connections. No leaks at this time. Remounted faucet to shower wall. Resealed around faucet housing. Checked underbelly below leak. Underbelly full of water. Cut out rear section of underbelly material. This area does not have insulation. Mounted underbelly hard material and secured to wood stringers. Sealed edges with black tape.

Model #	Dir Sub Hrs	3.00	Sub Labor Amt	\$450.00
Serial #	Appr Hrs	3.00	Appr Labor Amt	\$450.00

Notes

Submitted	Labor Amt	\$615.00
	Parts & Freight	\$0.00
	Total	\$615.00

Approved	Labor Amt	\$615.00
	Parts & Freight	\$0.00
	Total	\$615.00

DEALER	DATE
SIGNATURE	

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER	DATE
SIGNATURE	

All repairs described have been inspected and are satisfactory.