

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 80476
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 1000 - BASDEN'S AMERICAN RV
Address: 600 E. BASELINE RD. EVANSVILLE, IN
USA
47725
Phone:
Stock Number: 11800 - 2027 CATALINA SUMMIT 261BHS 5ZT2CARBXVU049067
VIN: 5ZT2CARBXVU049067 HIN: SER#: 5ZT2CARBXVU049067
Mileage: 0 Work Order Comp: 19 OCT 26
Auth. No: Dealer #:
Warr. Date: Work Order Date: 01 JUL 26 Inv #: 436036

WO # Job # Description JOB INFORMATION

80476 2 VINYL INSERT ON SLIDE ROOM IS TORN
On pdi found screw torn through vinyl insert.
Replace vinyl insert

80476 3 NON DOR SIDE BREAK LIGHT WON'T GO OFF
On pdi found off door side brake light won't turn off.
Wired incorrectly and ties in with blue wires with diode on it
that blew. Parts ordered.

80476 7 FRONT CORNER TRIM LED NOT WORKING
On pdi found that diode on blue wires blown. Led lights are not
working properly. The diode was put on the wrong wire.
Replace blue wires with diode. I removed the cover panel and
exposed the wiring. I tested all of the wiring to find out why
the lights did not work as intended. I removed each wire and
tested the function of the relay. The relay is still working
properly. I could not understand the reason for the diode on the
green jumper wire. I removed the diode and the system started
working. The left turn signal was staying on, so I put the diode
on the blue turn signal/ brake light wire. The line in the diode
is located on the relay side. Now the lights work on there own
and turn off with the brake light wire. The relay latches when
the brakes are activated. To use the lights, you must not have
the brake lights on and then you must push the enable switch to
release the latch on the relay. I made a wiring diagram and put
the unit back together.

Claim : 80476

 WO # Job # Description JOB INFORMATION

80476 4 SCRATCH ON FRONT OF STOVE
 On pdi found scratch on range that won't clean.
 Was told to replace it.

80476 1 TOP DOOR SIDE VINYL INSERT IS SHRINKING
 On pdi found vinyl insert shrunk and made a gap.
 Replace insert.

80476 5 REPLACE INSULATION TAPE IN A/C
 On pdi hear a little rattle coming from ac unit. Took panel off
 and found tape ripped off.
 Replace tape.

80476 6 NO TV SIGNAL
 On pdi found TV has no signal. Connector to antenna fell off.
 Replace connector.

 Part No Job# Description PARTS Qty Price Total

RVDE369	2	E369 BLACK HD 1" x 25' INSERT TRI		1.00	12.01	12.01
13880	3	IN4007 DIODE		1.00	1.44	1.44
F100852425	7	RADIUS LIGHTS 30% SMOKE 9.6W/M R		1.00	71.15	71.15
F100418926	4	RANGETOP, GE 21" STAINLESS, 3 BUR		1.00	261.69	261.69

 Lab Code Job# Description LABOUR Hrs Rate Total

Z990	2	MISC LABOUR CODE (EXTERNAL)		0.10	195.00	19.50
Z990	2	MISC LABOUR CODE (EXTERNAL)		0.00	195.00	0.00
Z990	3	MISC LABOUR CODE (EXTERNAL)		0.00	195.00	0.00
Z990	3	MISC LABOUR CODE (EXTERNAL)		0.30	195.00	58.50
Z990	3	MISC LABOUR CODE (EXTERNAL)		0.00	195.00	0.00
Z990	7	MISC LABOUR CODE (EXTERNAL)		0.00	195.00	0.00
Z990	7	MISC LABOUR CODE (EXTERNAL)		0.20	195.00	39.00
Z990	7	MISC LABOUR CODE (EXTERNAL)		0.10	195.00	19.50
Z990	7	MISC LABOUR CODE (EXTERNAL)		0.70	195.00	136.50
Z990	4	MISC LABOUR CODE (EXTERNAL)		0.00	195.00	0.00
Z990	4	MISC LABOUR CODE (EXTERNAL)		0.00	195.00	0.00
Z990	4	MISC LABOUR CODE (EXTERNAL)		0.25	195.00	48.75
Z990	1	MISC LABOUR CODE (EXTERNAL)		0.10	195.00	19.50
Z990	5	MISC LABOUR CODE (EXTERNAL)		0.30	195.00	58.50
Z990	6	MISC LABOUR CODE (EXTERNAL)		0.10	195.00	19.50

 Excode Job# Description EXTRAS Qty Price Total

FRT	7	UPS-LIGHT		1.00	16.89	16.89
-----	---	-----------	--	------	-------	-------

Claim : 80476

```
*****
Excode   Job#   Description      EXTRAS          Qty    Price    Total
*****
FRT       4     UPS-RANGE TOP                1.00    54.96    54.96
```

```
Parts Total:      346.29
Labour Total:     419.25
Sublet Total:       0.00
Extras Total:      71.85
```

>>>> Claim Total: 837.39

Customer Signature: _____

Date: _____