



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 69027
Promised Date:
20 NOV 22



Customer #:
52273



CUSTOMER WORK ORDER

WO #: 69027 (Appointment Date: 21 OCT 2022 - Time: 07:00am)

Customer: 52273 - BULLARD, JUSTIN
L. - 618-516-3017

Tag:

Author: BH

Location: 1116 BH TO CLOSE WO

Stock #: 10646

Stock Desc: (10646) 2022

COACHMEN CATALINA 263BHCKLE

Chassis #: 5ZT2CARB3NU039464

Serial #: 5ZT2CARB3NU039464

Mileage:

Licence:

Invoice #:

Date In: 21 OCT 22

Promised: 30 NOV 22

Date Sched:

Completed: 16 NOV 22

Warr. Date: 12 FEB 22

Job #22V243 - Warranty

COMPLAINT: RECALL 22V243 LP QUICK CONNECT

CAUSE: 22V243 - RECALL 22V243 LP QUICK CONNECT.

CORRECTION: Moved unit into shop from service lot. Checked Quick Connect for Recall part. Quick connect is affected recall part. Removed quick connect part. Cleaned threads per recall instructions. Applied thread seal and installed new part. Performed 3 min. drop test. No leaks.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	45.00

Subtotal for Job #22V243: 45.00

Job #BRAKE - Warranty

COMPLAINT: JOB #22V477 BRAKE AWAY SWITCH WIRING RECALL

CAUSE: BRAKE - JOB #22V477 BRAKE AWAY SWITCH WIRING RECALL.

CORRECTION: Removed all tape around factory cut hole in underbelly. Removed brake-away switch from frame mounting. Took picture of back of switch and brake-away wire going to small breaker. Cut wire off at terminal. Rerouted wire to battery side of disconnect switch. Installed new ring terminal. Removed nut on disconnect switch and installed wire from brake-away switch. Reinstalled nut on back of switch and tightened. Remounted brake-away switch on frame. Sealed up hole in underbelly with underbelly tape.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	45.00

Subtotal for Job #BRAKE: 45.00

Job #3 - Warranty

COMPLAINT: CHECK GAPS ON EACH LOWER CORNER OF THE SLIDE ROOM WHEN IT IS IN OR OUT. HE BELIEVES THAT A PART OF THE SEAL MIGHT HAVE COME OFF.

CAUSE: CHECK GAPS ON EACH LOWER CORNER OF SLIDE ROOM WHEN IT IS IN OR OUT. CUSTOMER BELIEVES THAT A PART OF THE SEAL MIGHT HAVE COME OFF.

CORRECTION: Checked lower flap seals. Seals are being pulled in under slide room when running room in and tearing flap seals. 10/24/2022: Turned in parts request for new flap seals. Received new flap seals. Removed bottom corner seals. Replaced damaged flap on corner pieces. Installed new flap seal on both pieces. Cut off flap on old seal that would flip in when slide out is ran in. Cut to length new flap seal.



W/O: 69027
Promised Date:
30 NOV 22



Customer #:
52273



Stapled new flap seal in place. Added metal strip over mounting of flap seal to secure in place.
Remounted corner seals to close up corner gap. Remounted wire support. Checked operation of slide out
several times. New flap seal not rolling under slide out. Moved unit to service completed area.
HELPED DAVE PUT ON SEAL

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	136.50
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	3.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	10.50
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BB	150.00

Parts

Part #	Description	Qty	Price	Total
C01249768	SINGLE WIPER SEAL	3.00	1.92	5.76
BRV111994	ANGLE FLAP SEAL-BLACK - KEYSTONE	14.00	0.78	10.92

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	0.00	0.00
FRT	UPS- SEAL	1.00	17.34	17.34
FRT	UPS-SEAL	1.00	15.96	15.96

Subtotal for Job #3: 349.98

Parts Total: 16.68
Labour Total: 390.00
Sublet Total: 0.00
Extras Total: 33.30
WORK ORDER TOTAL: 439.98

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited
to work performed. Consequential damages are not covered. All guaranteed work
must be completed in our service department.

Customer Signature : _____

Date: 16 Nov 2022

